




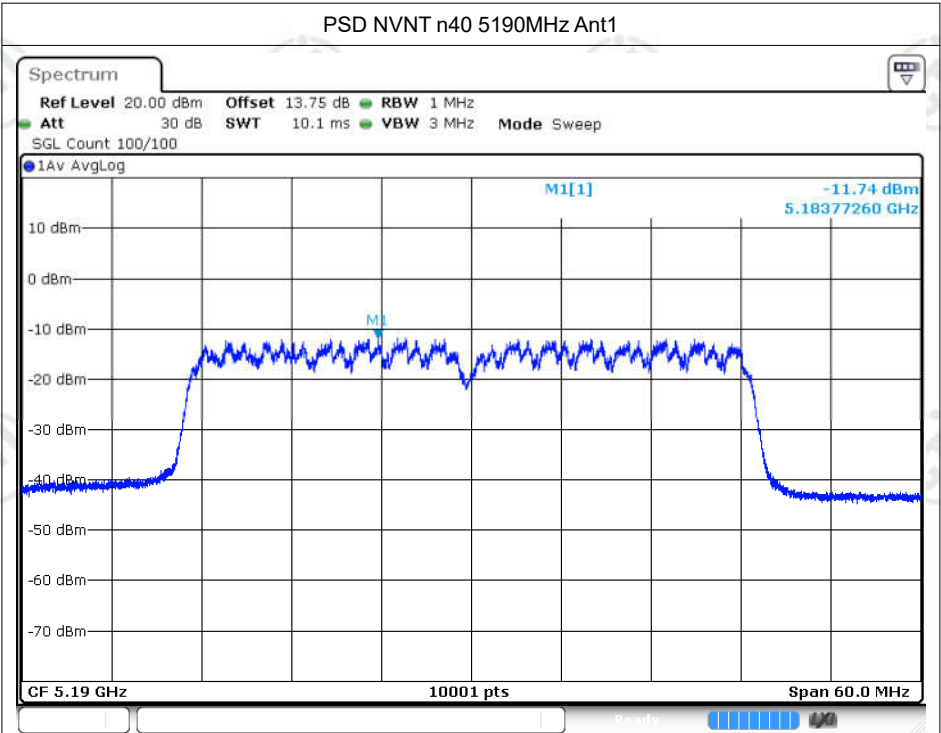


Date: 28.MAR.2023 09:29:04

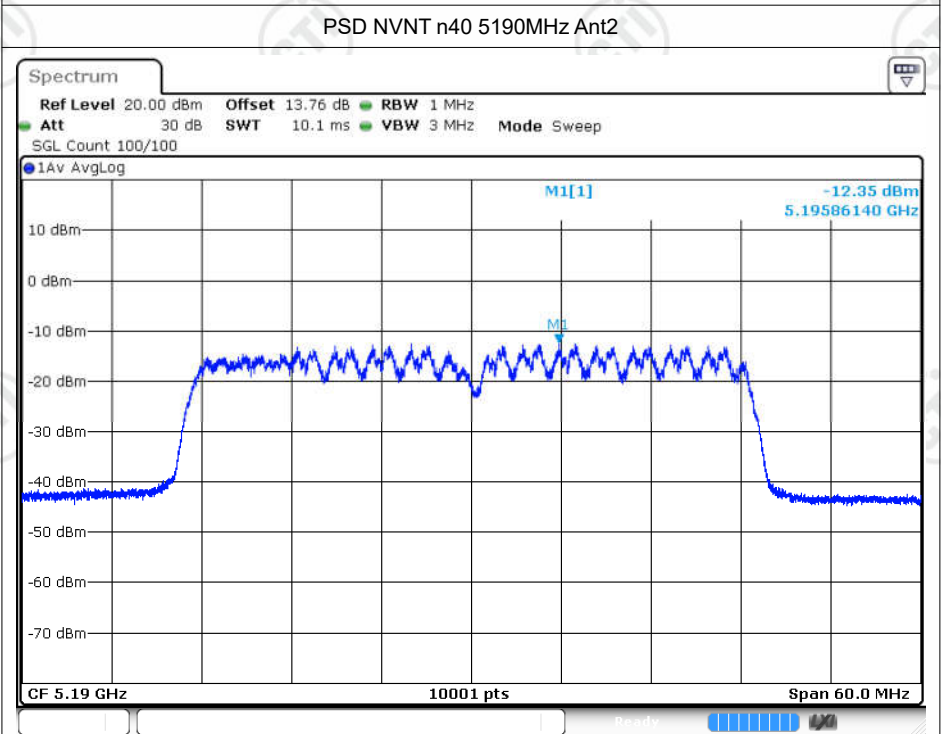


Date: 28.MAR.2023 09:29:07

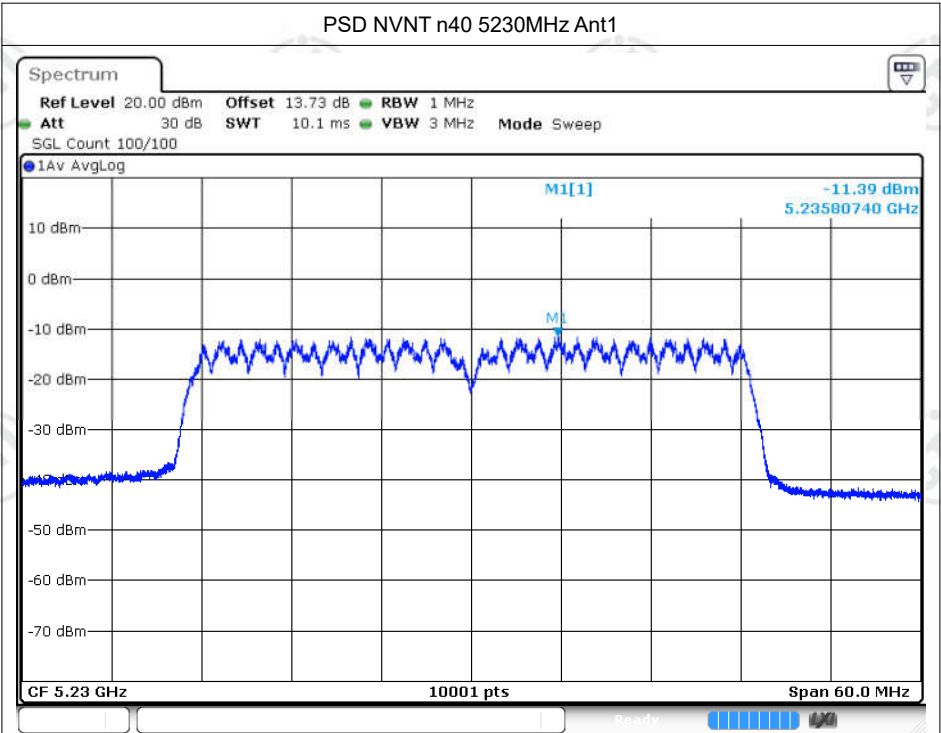


Date: 28.MAR.2023 09:29:45

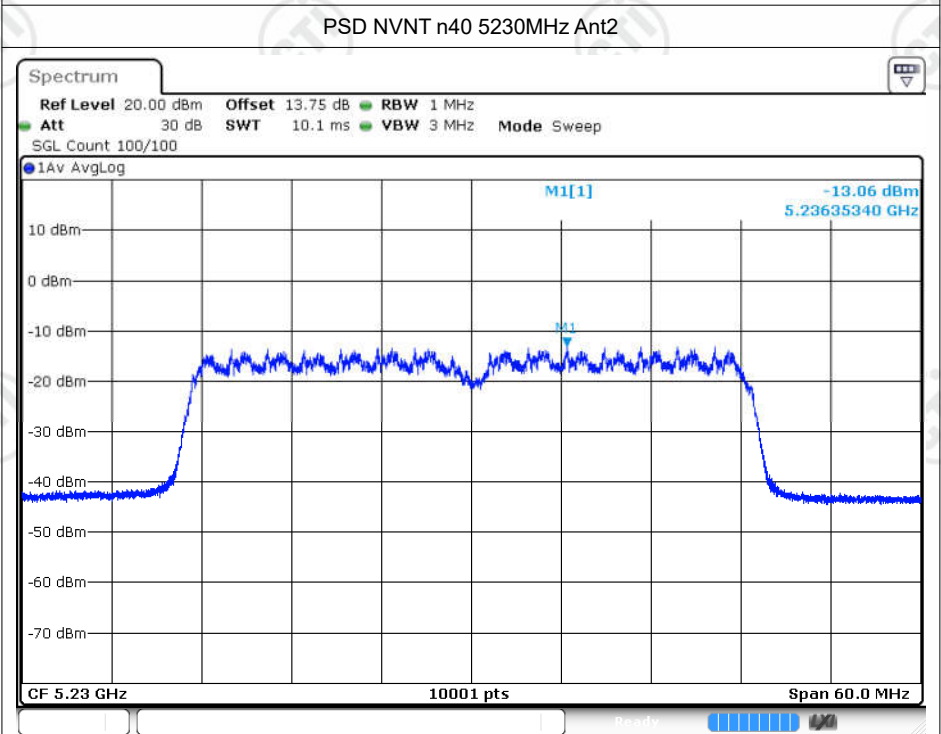


Date: 28.MAR.2023 09:29:48

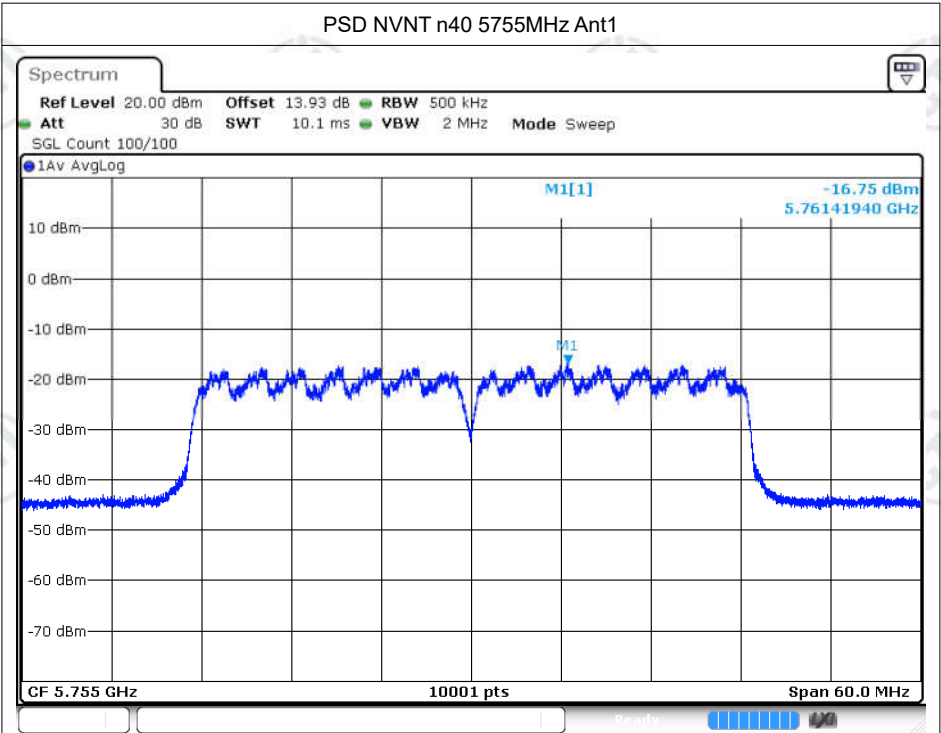


Date: 28.MAR.2023 10:29:23

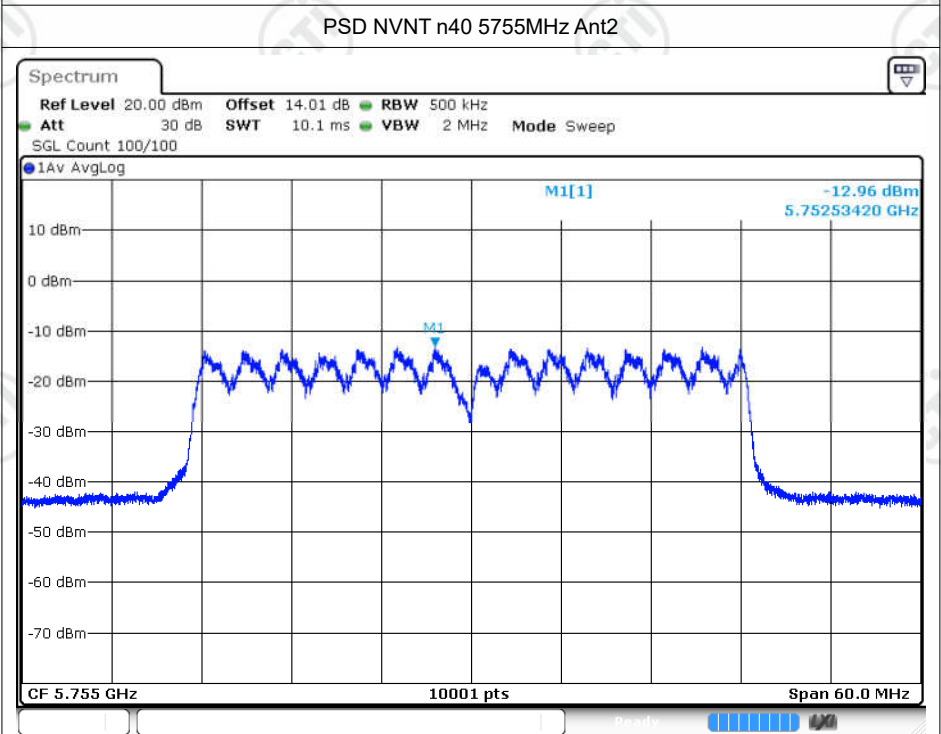


Date: 28.MAR.2023 10:29:26

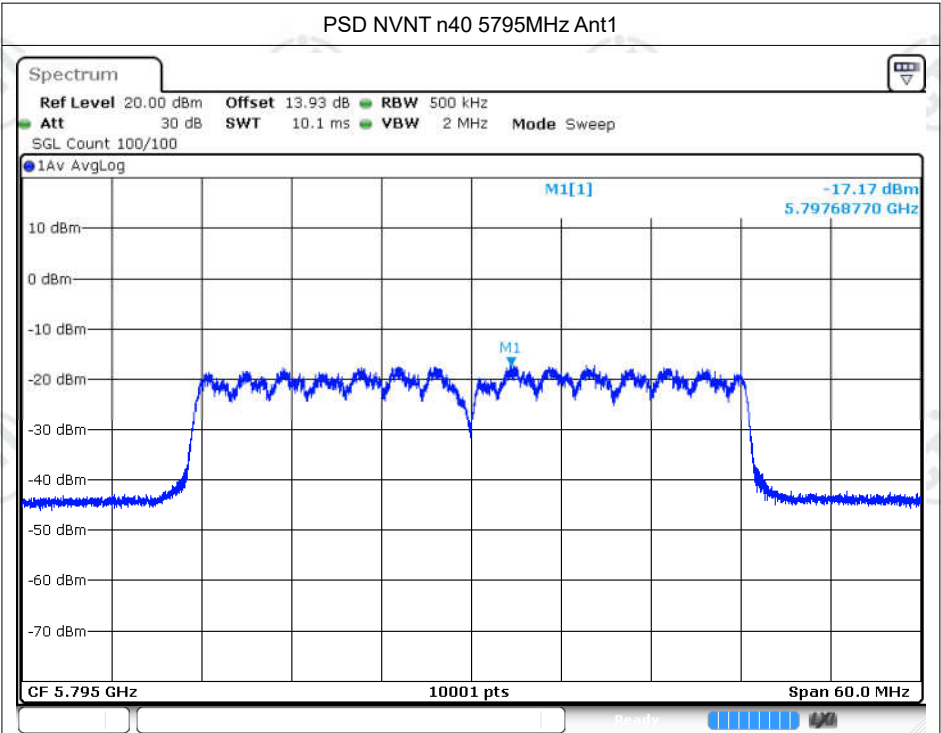


Date: 28.MAR.2023 10:30:17

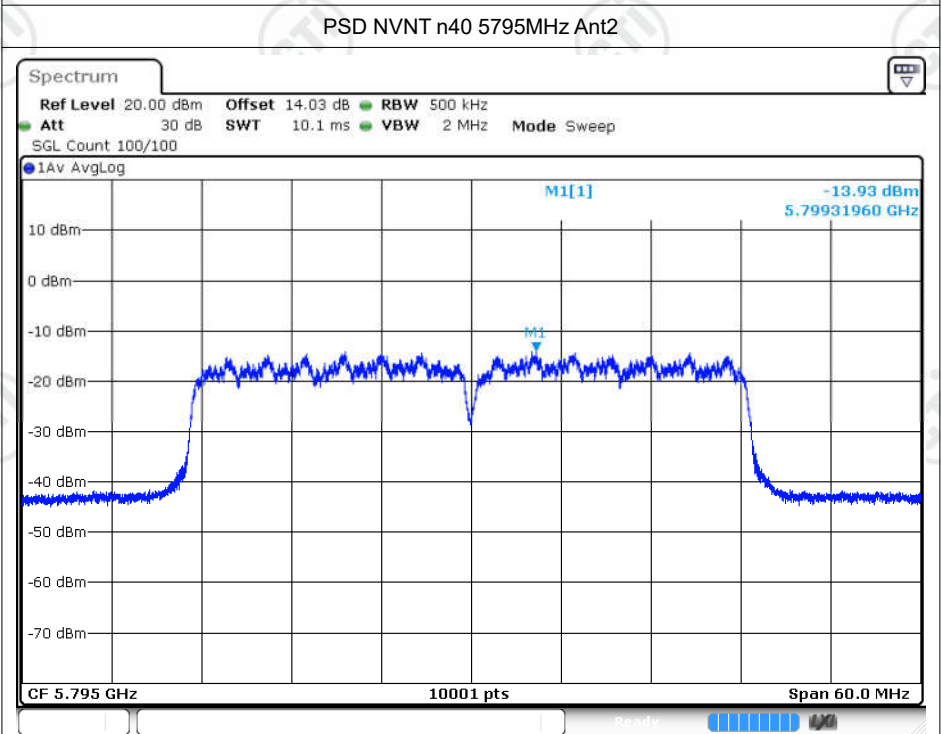


Date: 28.MAR.2023 10:30:20

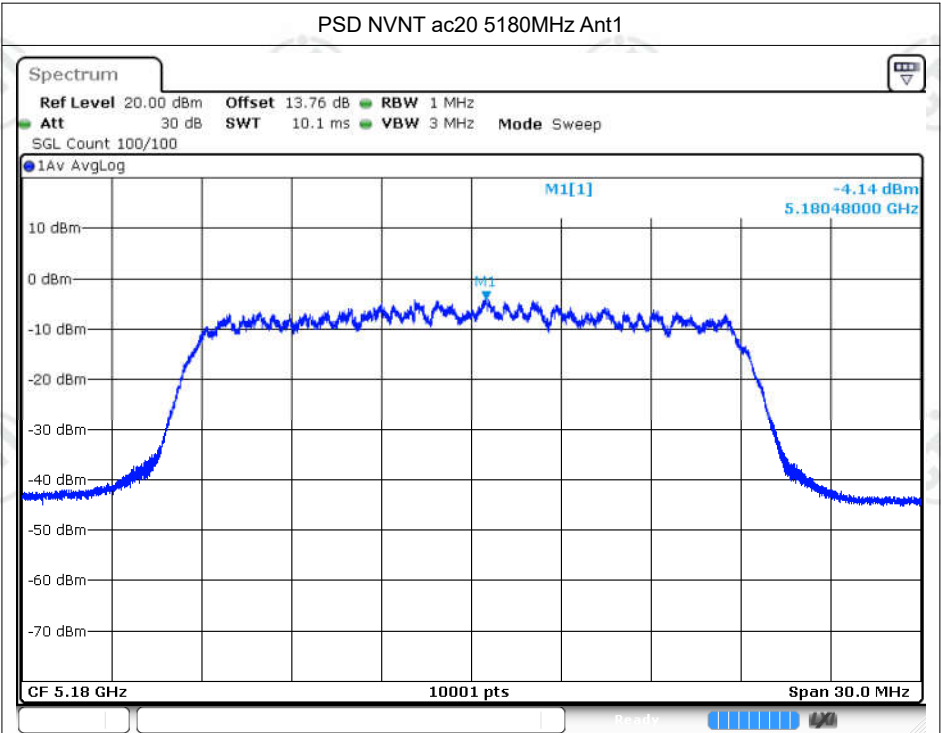


Date: 27. MAR 2023 15:25:04

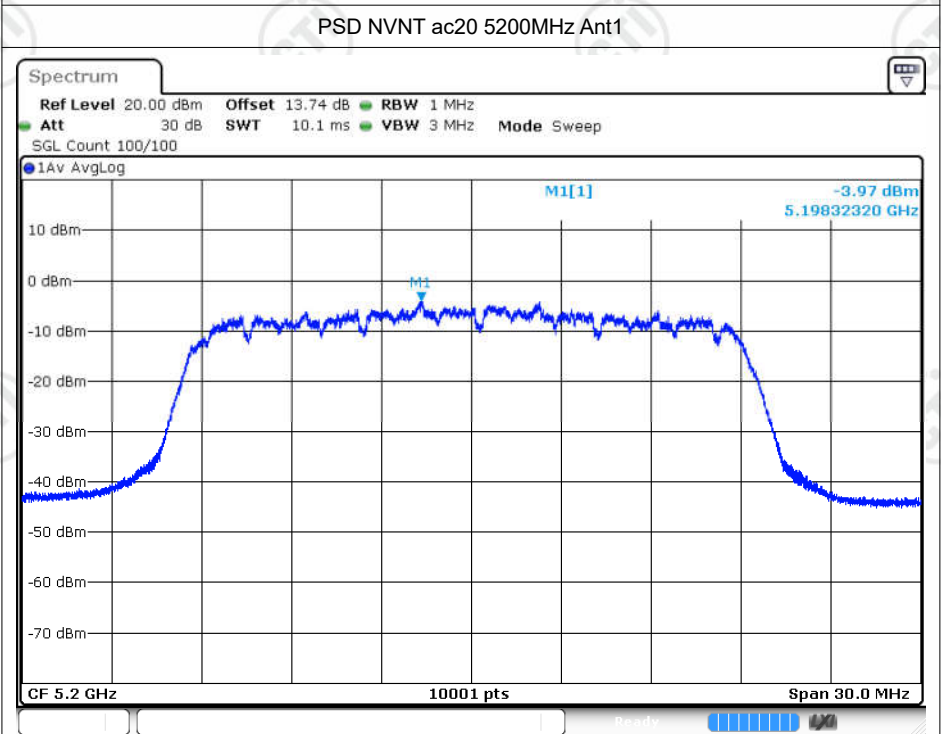


Date: 27. MAR 2023 15:26:55

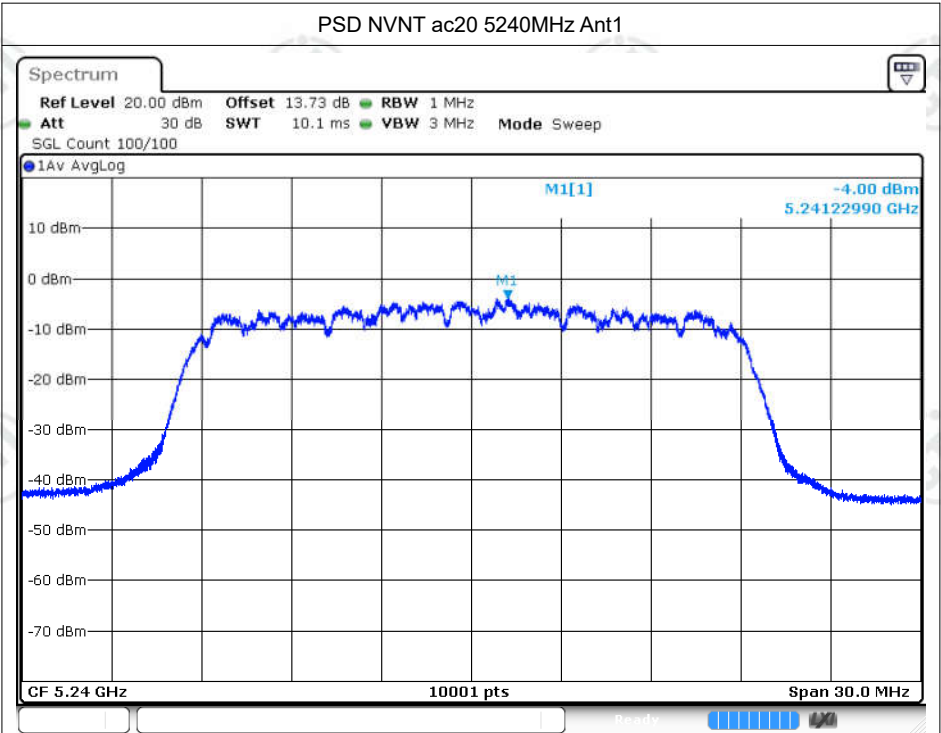


Date: 27. MAR. 2023 15:28:07

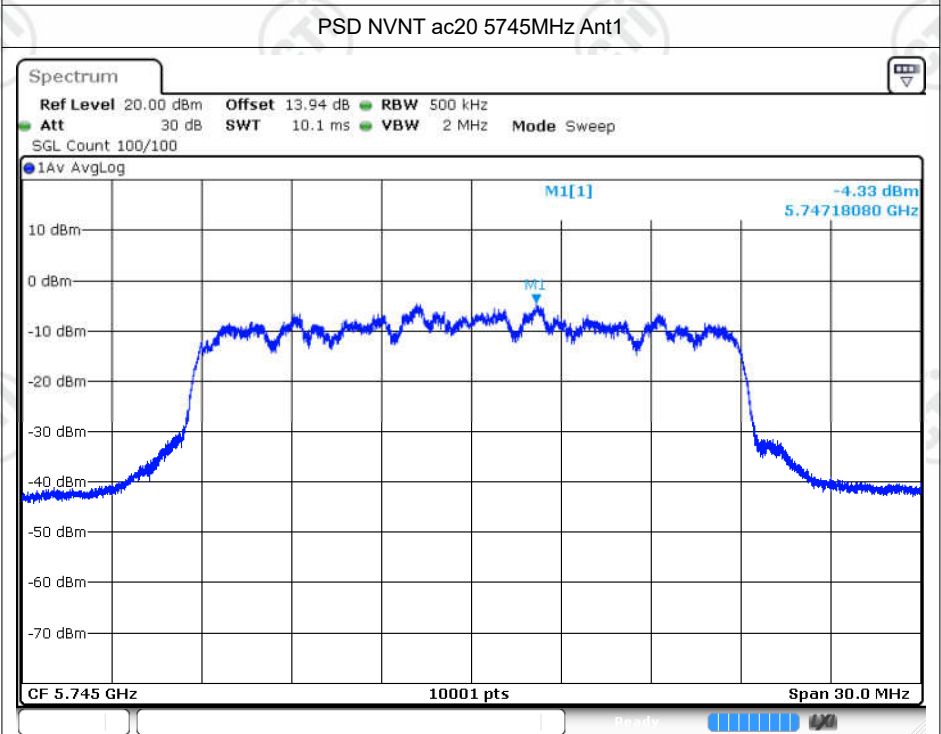


Date: 27. MAR. 2023 15:30:52

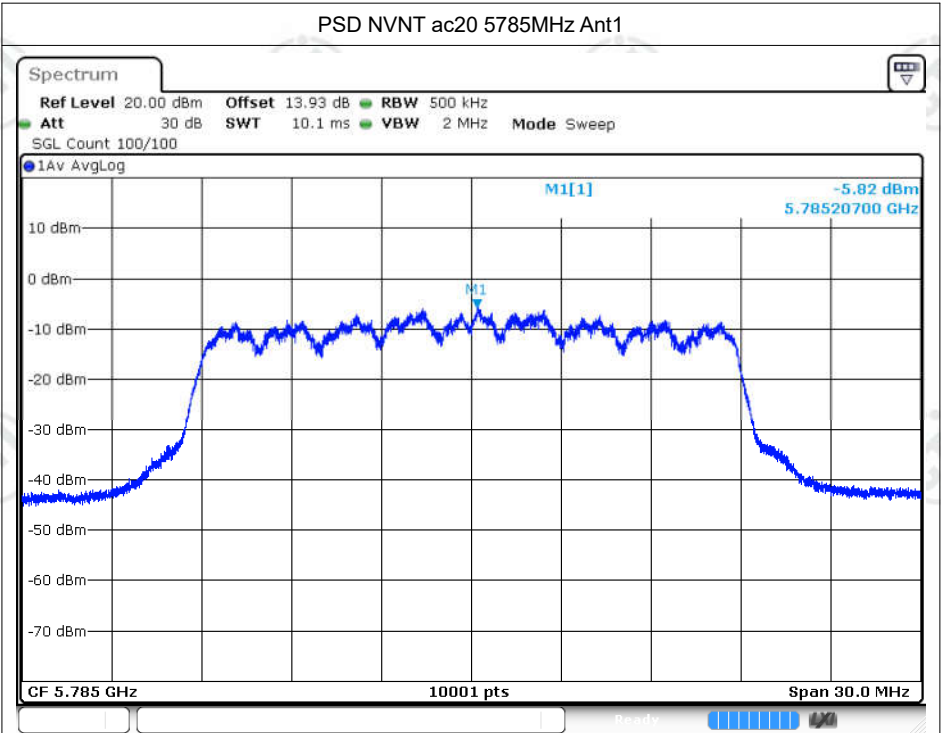


Date: 27. MAR 2023 15:33:47

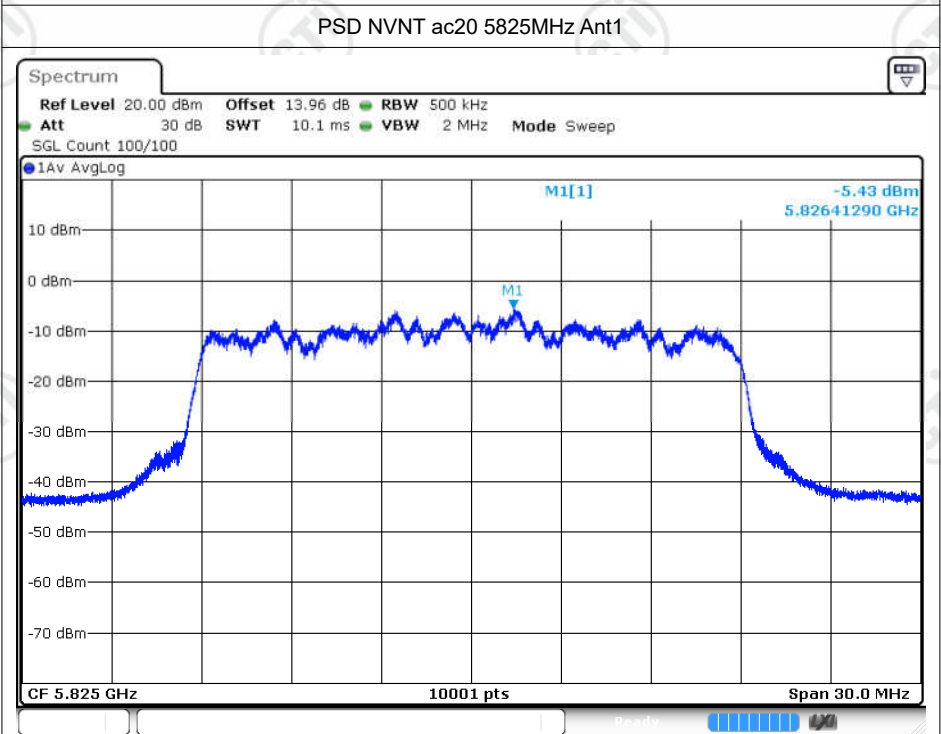



Date: 27. MAR 2023 15:36:03

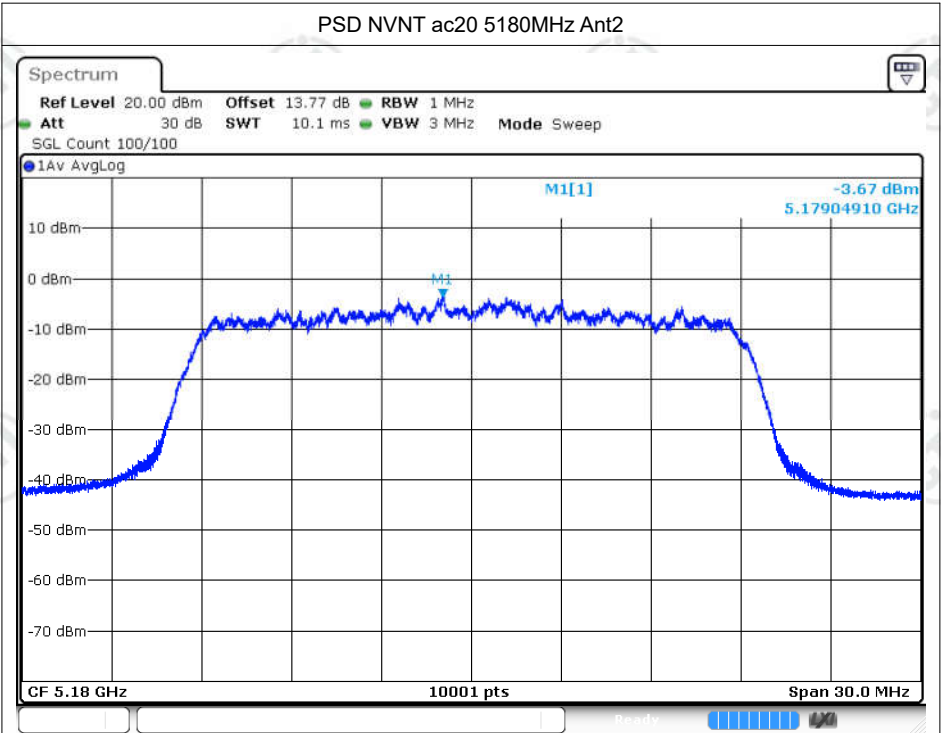


Date: 27. MAR. 2023 18:38:51

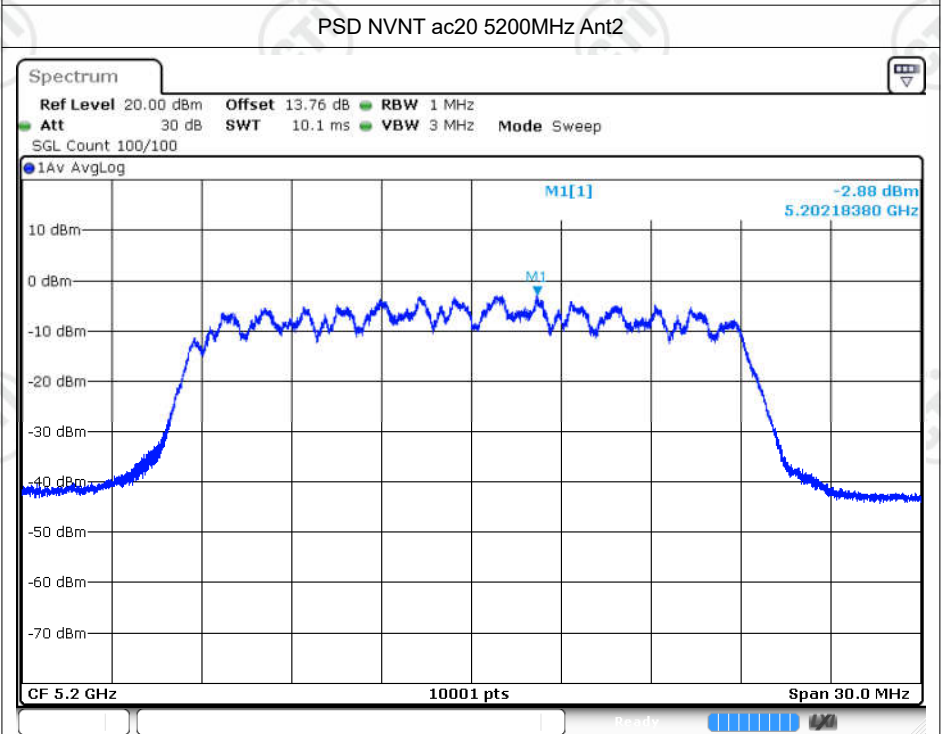


Date: 27. MAR. 2023 18:40:05

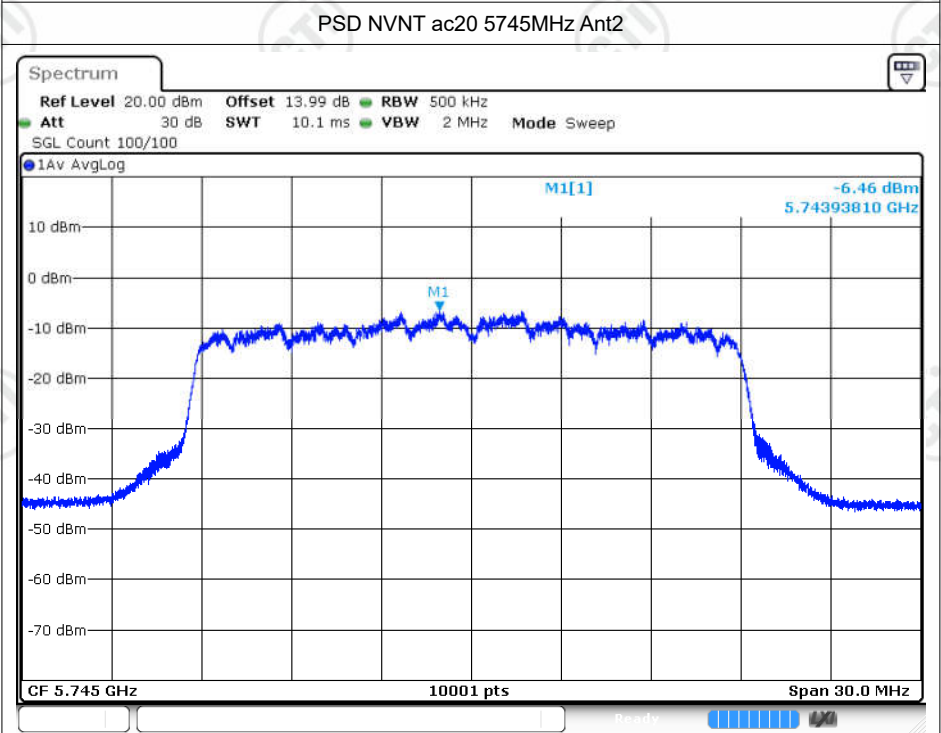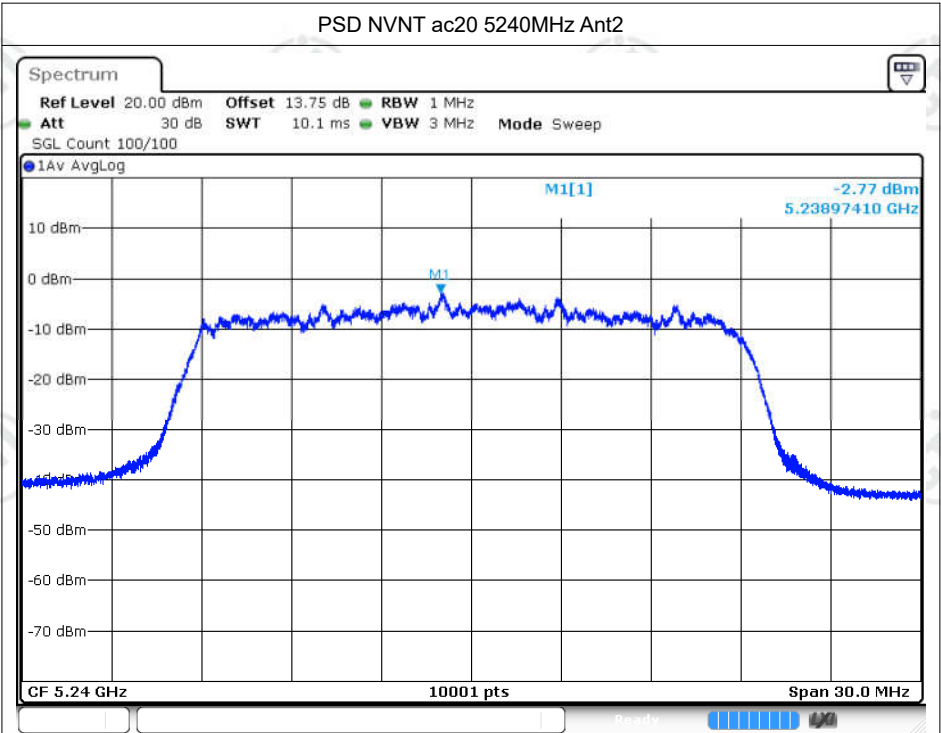


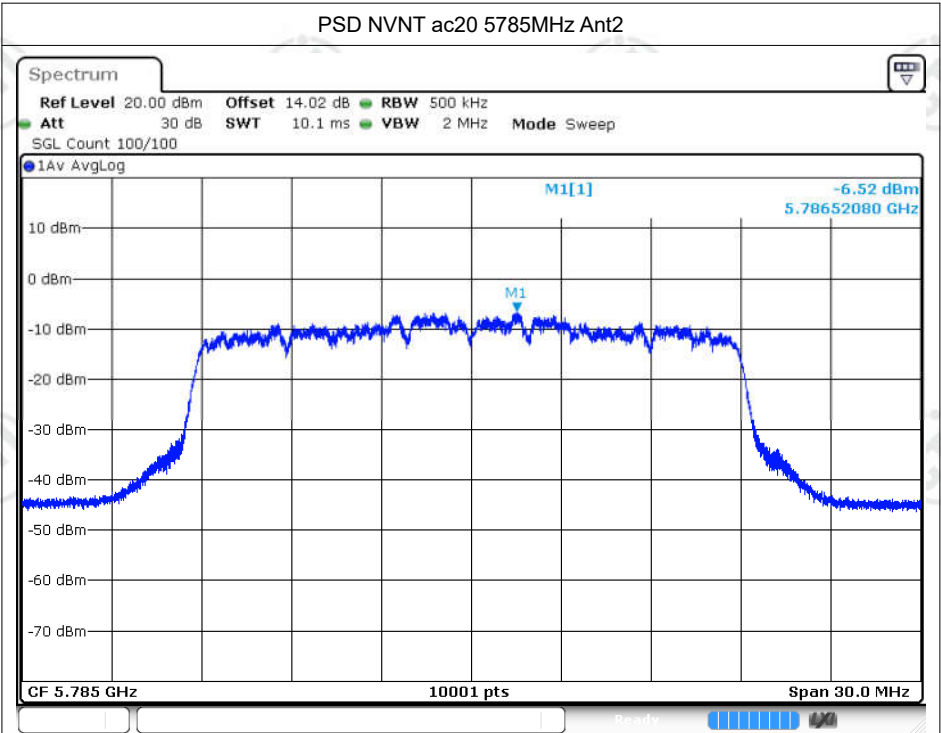


Date: 27. MAR 2023 19:16:32

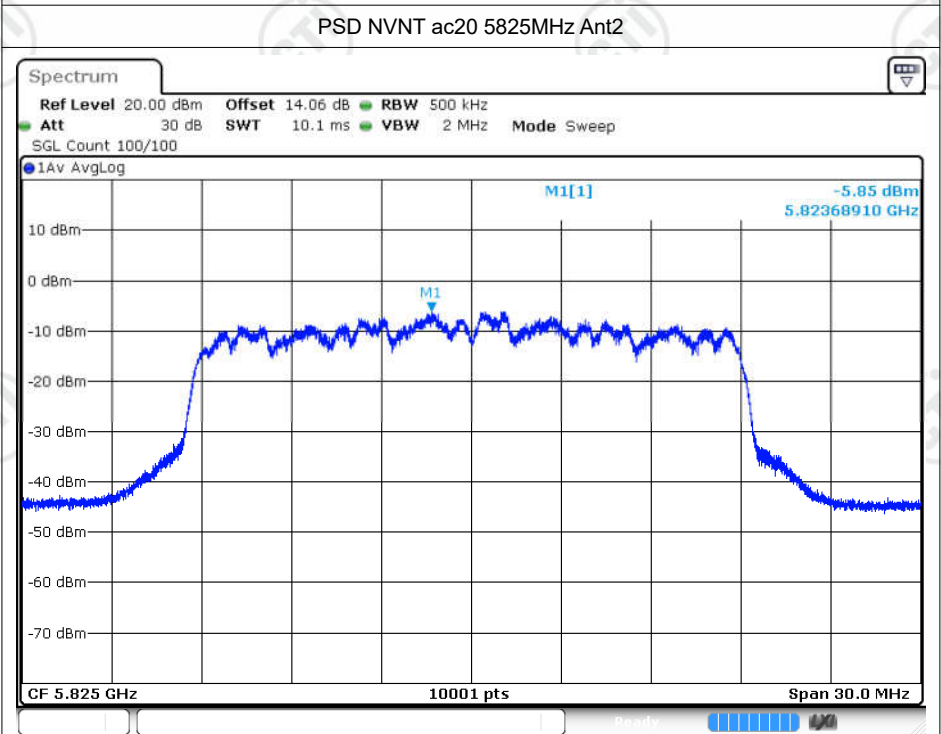


Date: 27. MAR 2023 19:17:20

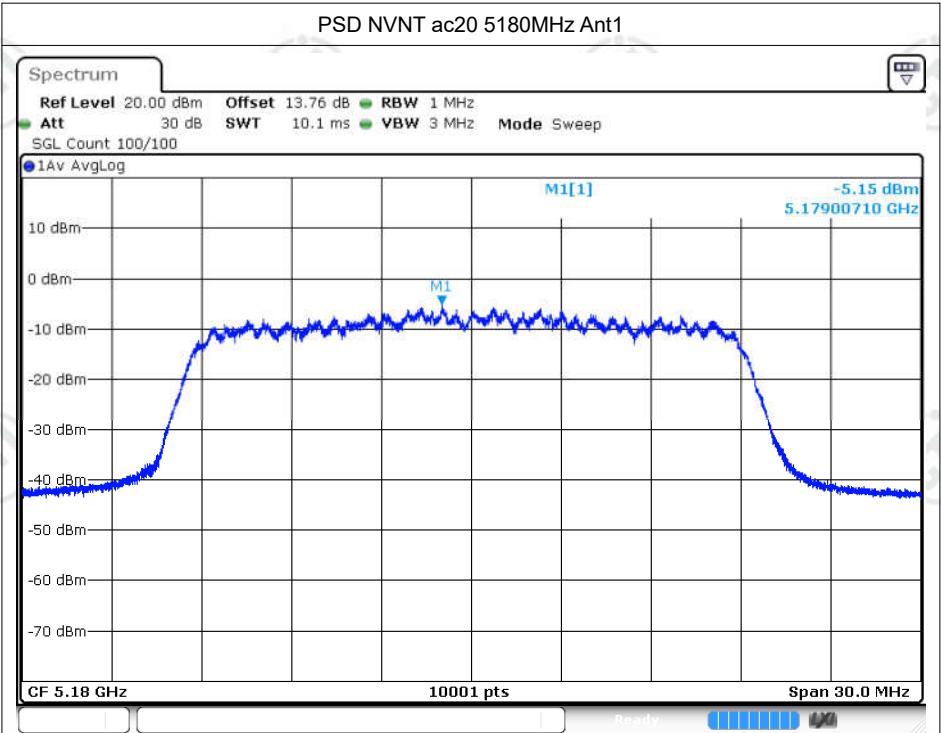


Date: 28.MAR.2023 13:07:57

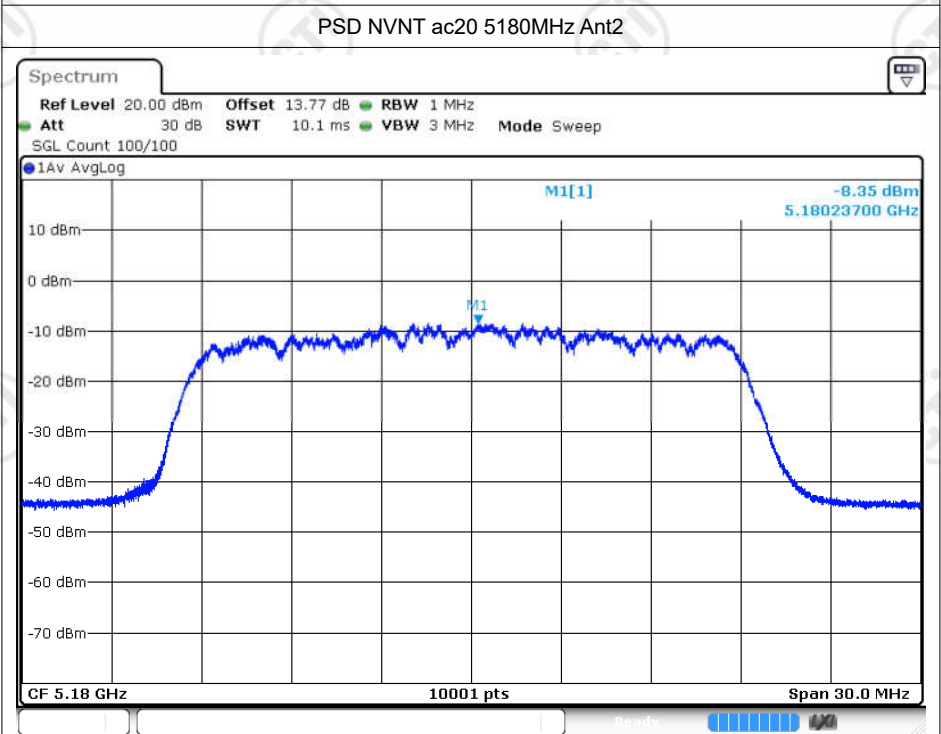


Date: 28.MAR.2023 13:08:00

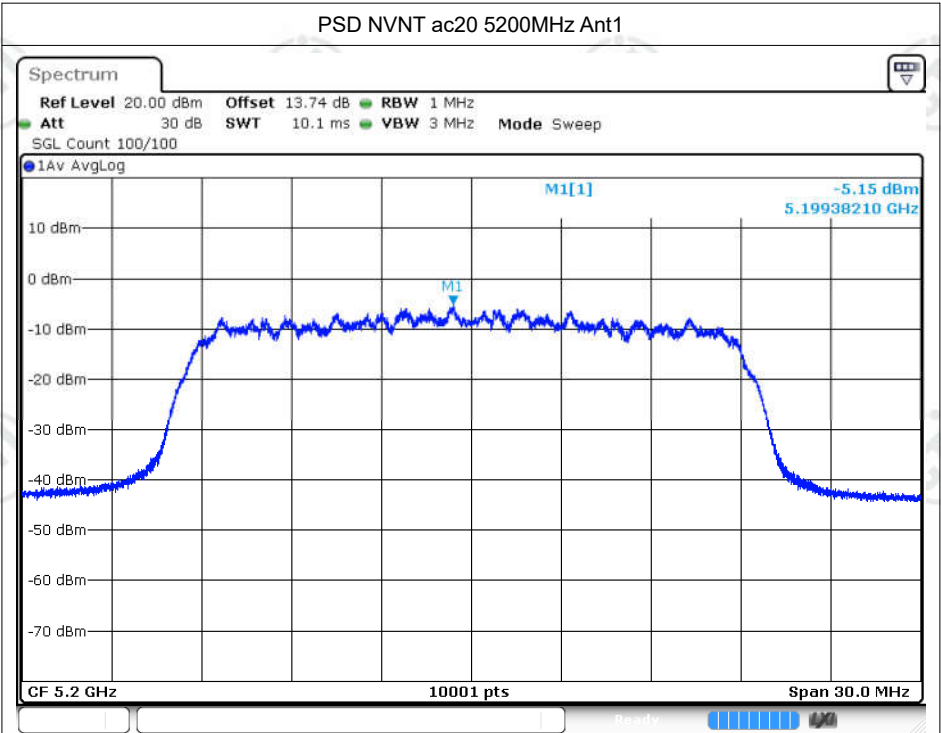


Date: 28.MAR.2023 13:08:46

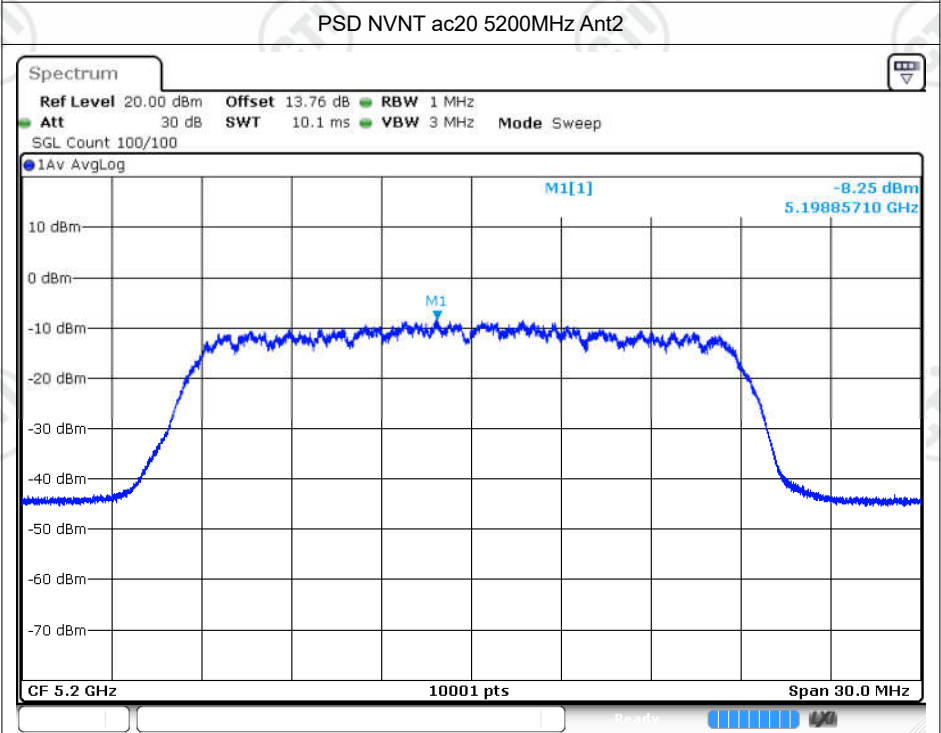


Date: 28.MAR.2023 13:08:49

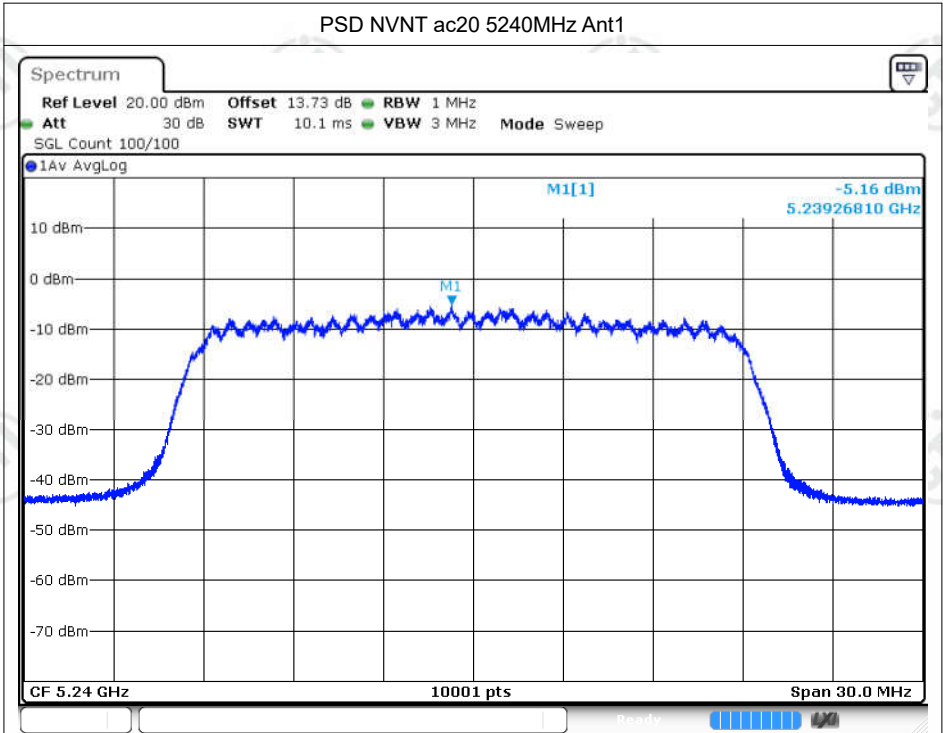


Date: 28.MAR.2023 13:09:27

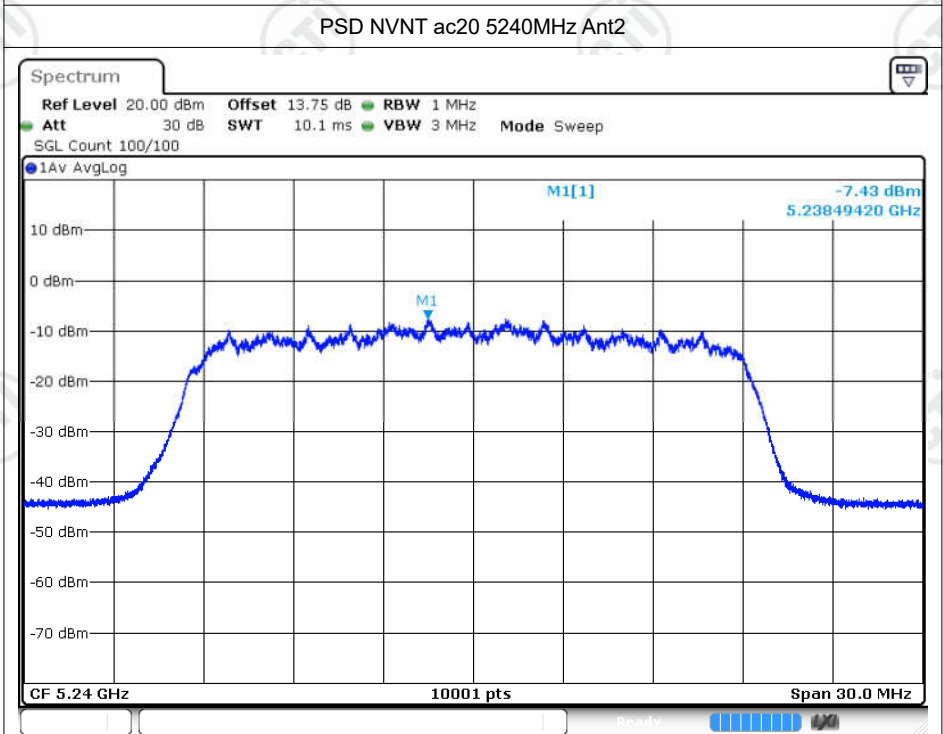



Date: 28.MAR.2023 13:09:30

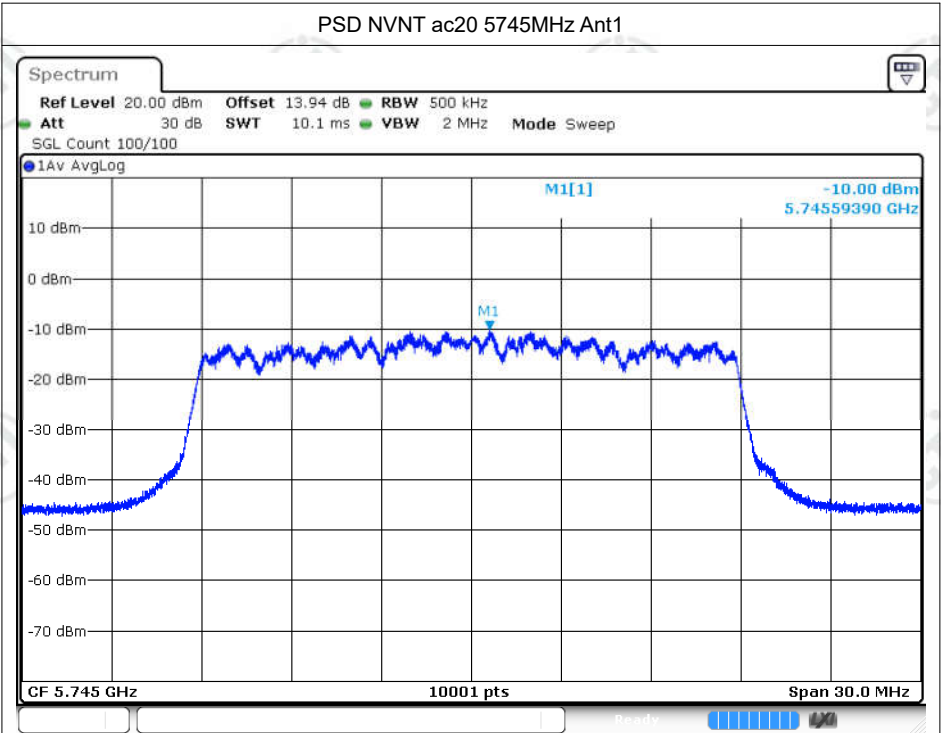


Date: 28.MAR.2023 13:11:41

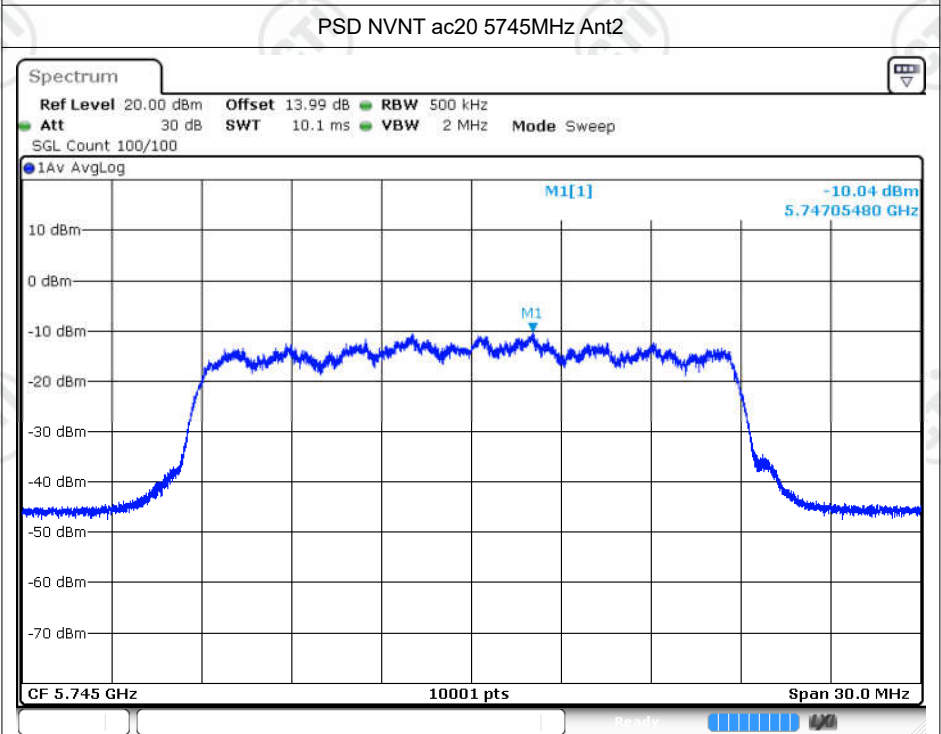


Date: 28.MAR.2023 13:11:44

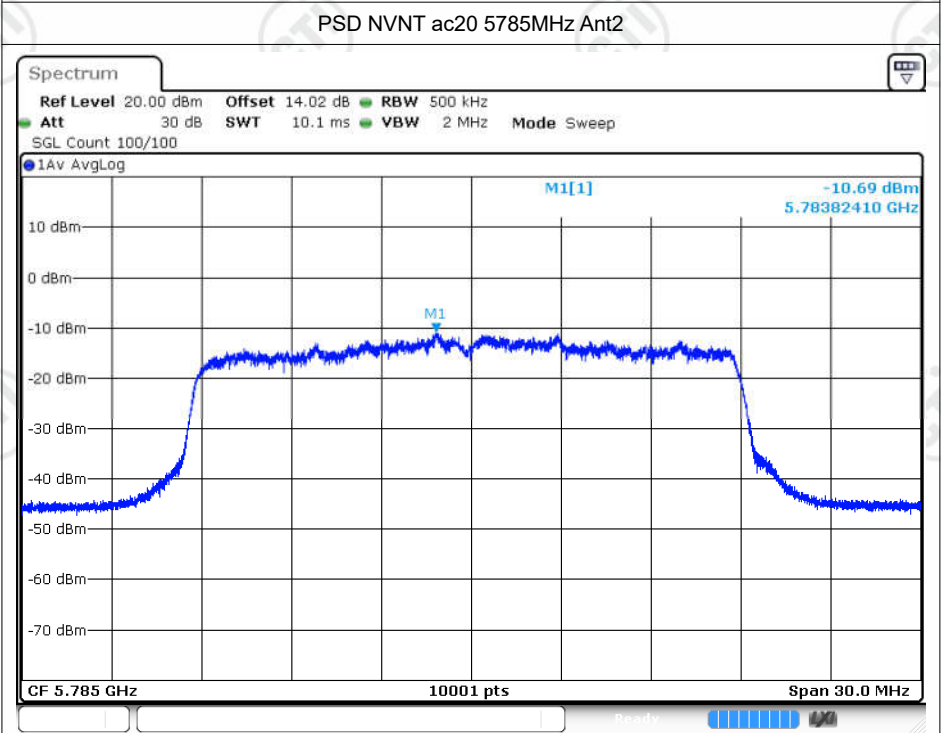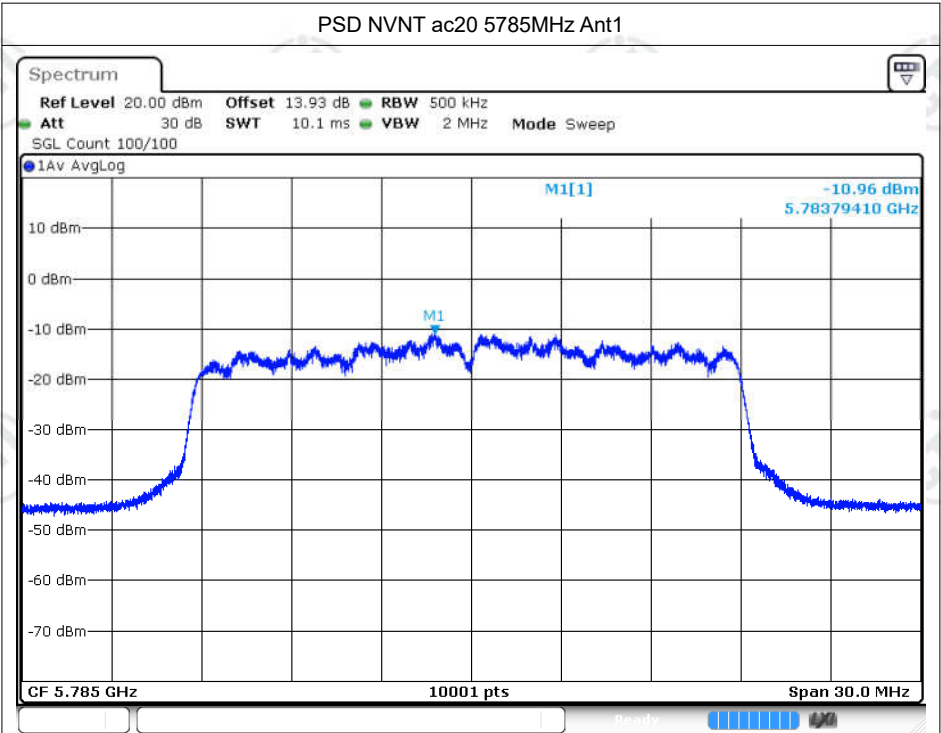


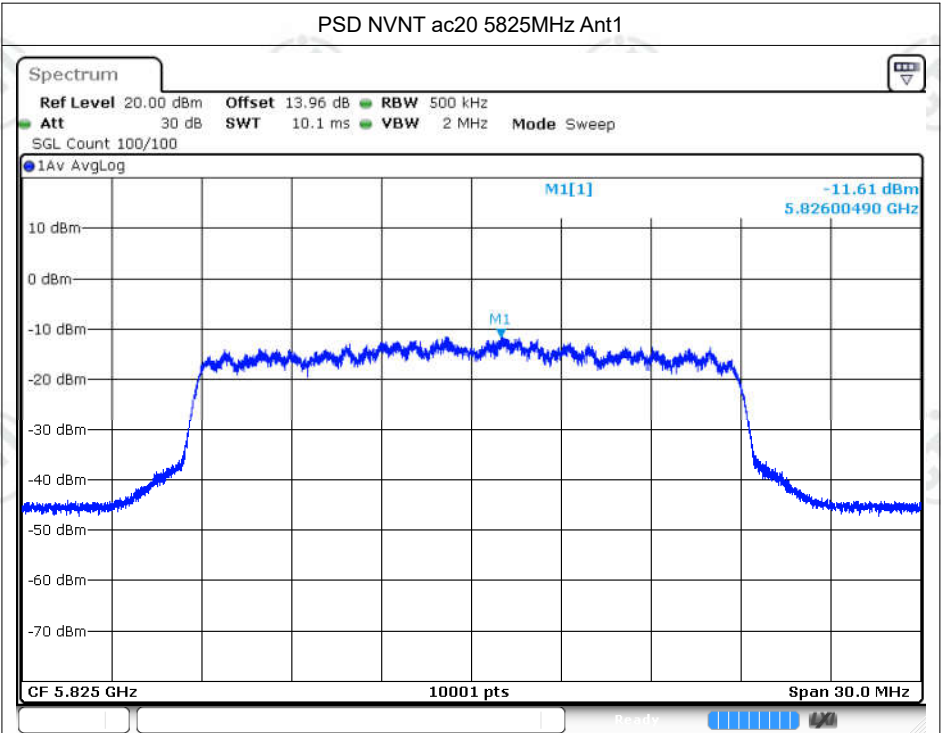


Date: 28.MAR.2023 13:47:59

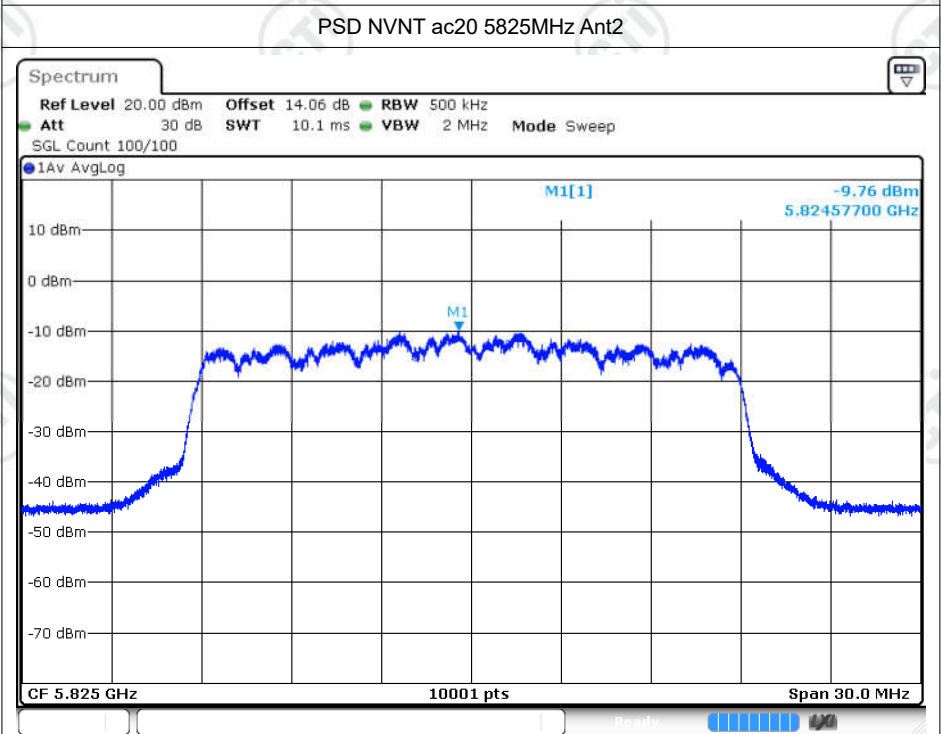


Date: 28.MAR.2023 13:48:02

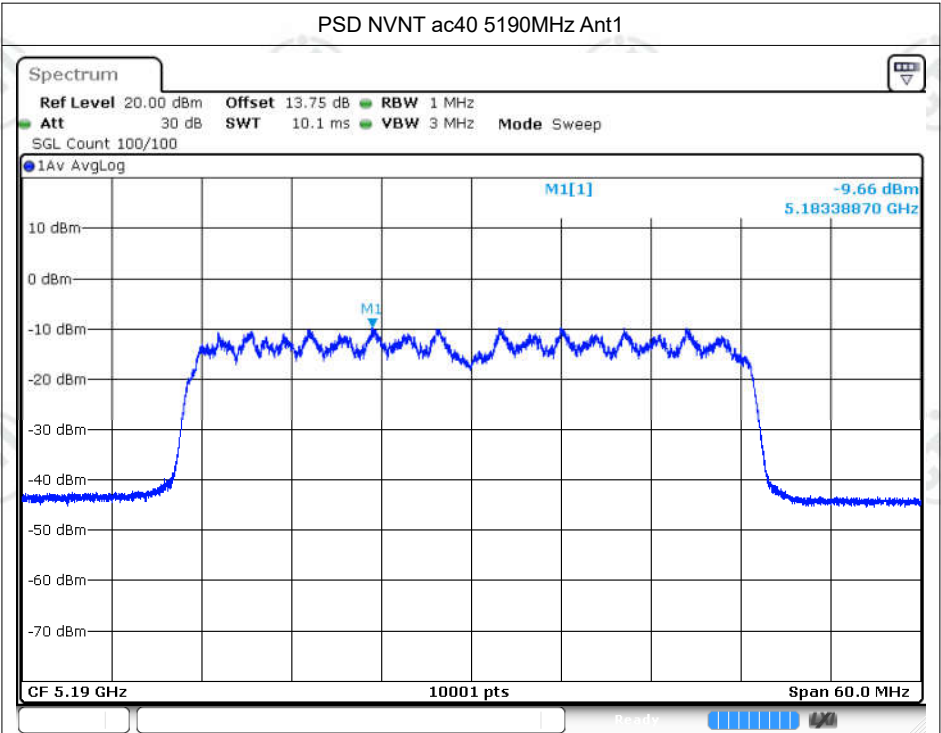


Date: 27. MAR. 2023 15:40:07

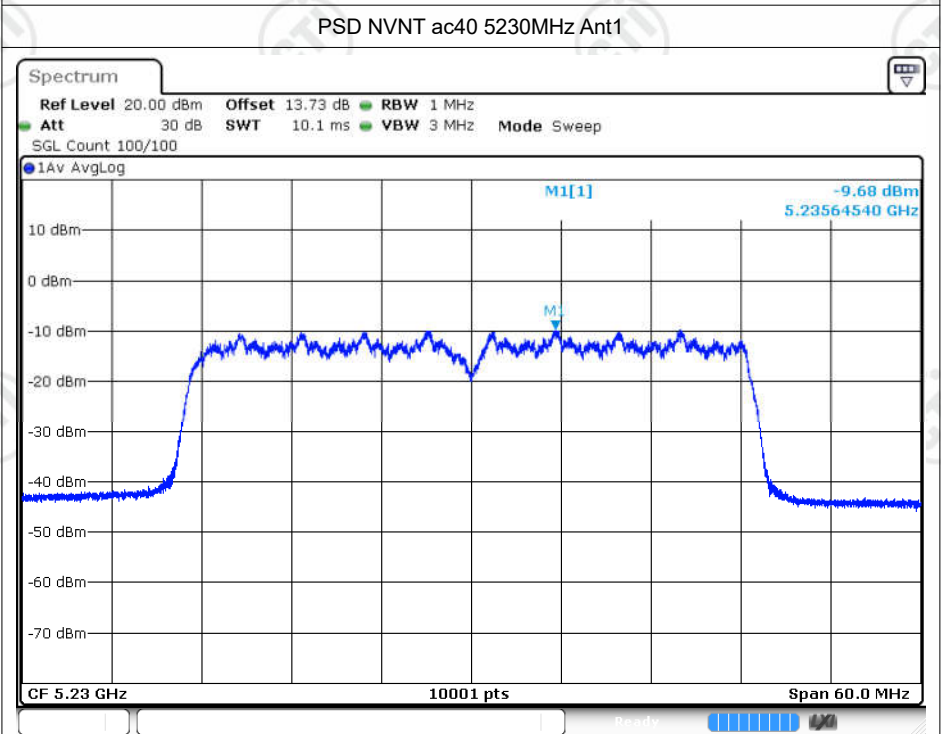


Date: 27. MAR. 2023 15:43:01

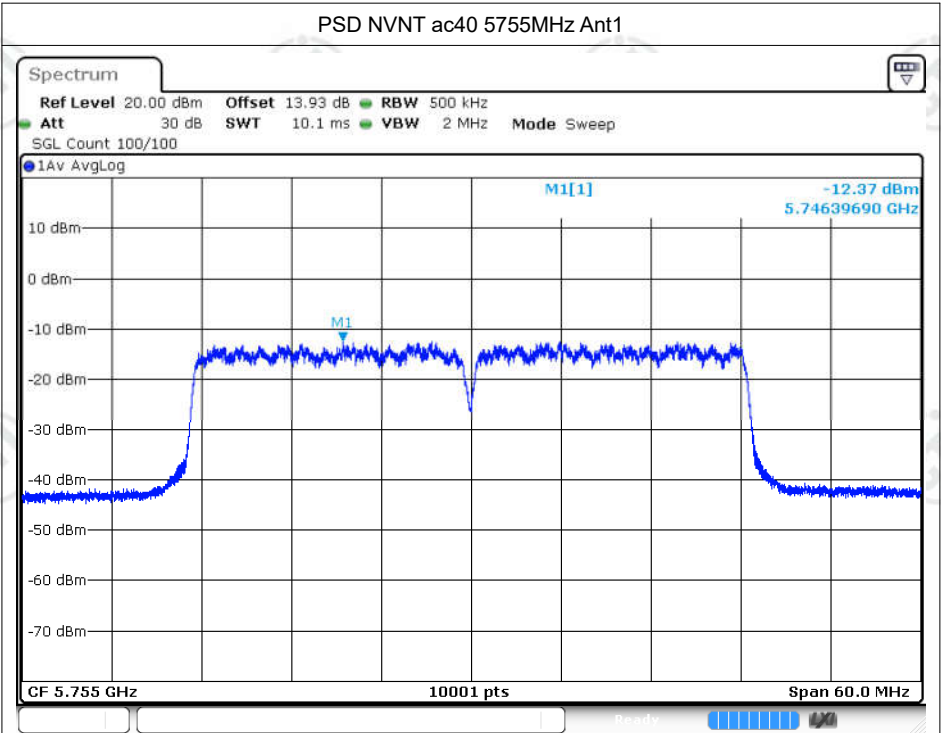


Date: 27. MAR. 2023 15:45:05

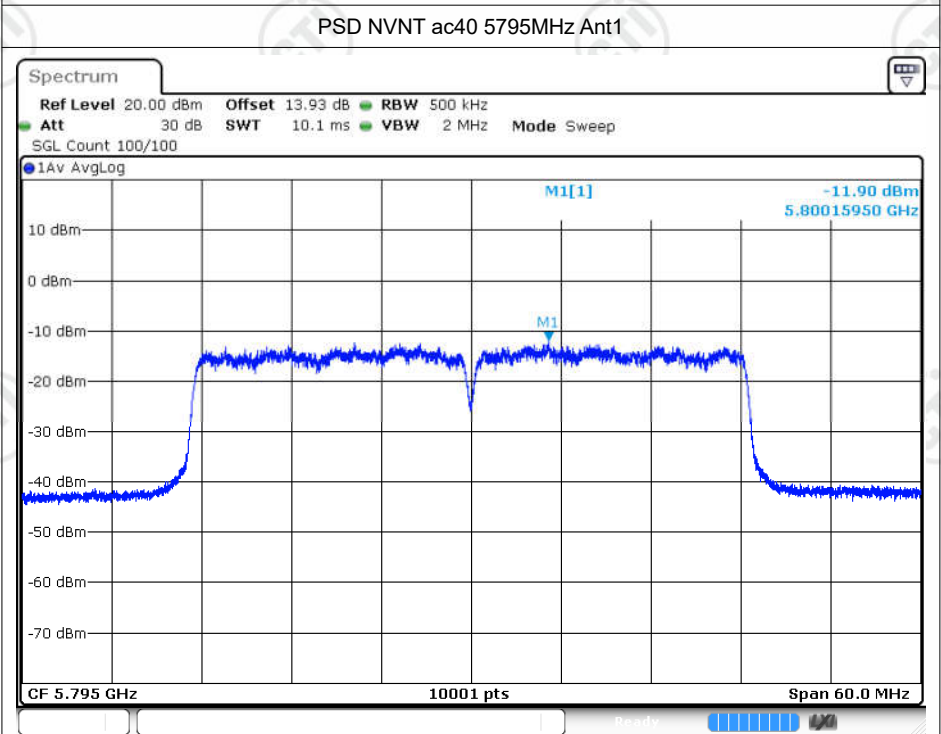


Date: 27. MAR. 2023 15:46:53

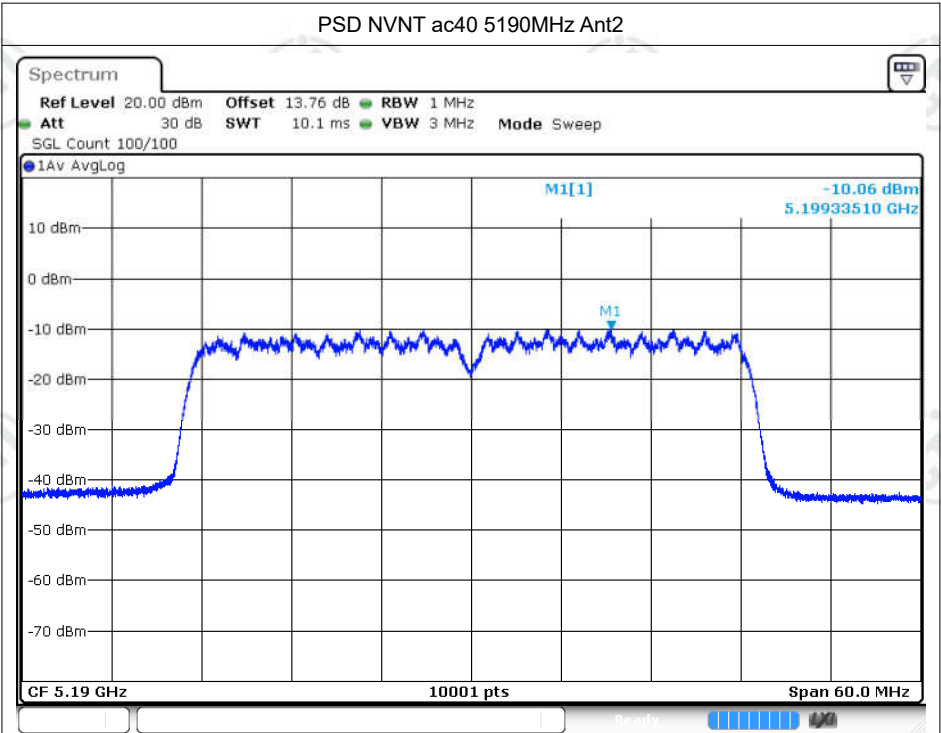


Date: 27. MAR. 2023 19:19:55

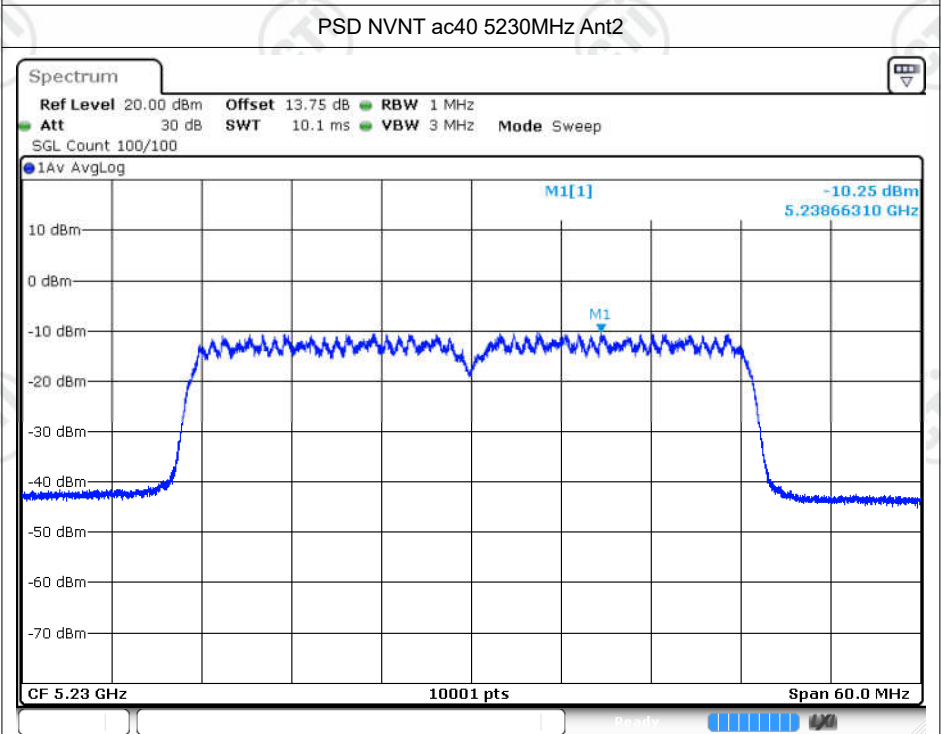


Date: 27. MAR. 2023 19:22:17

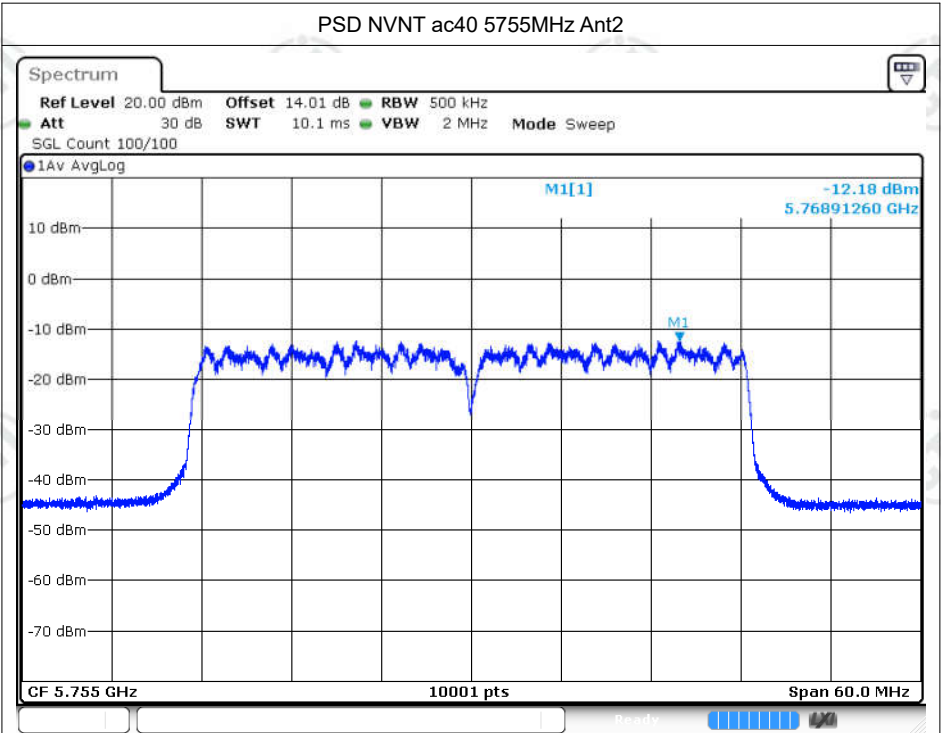


Date: 27. MAR 2023 19:25:19

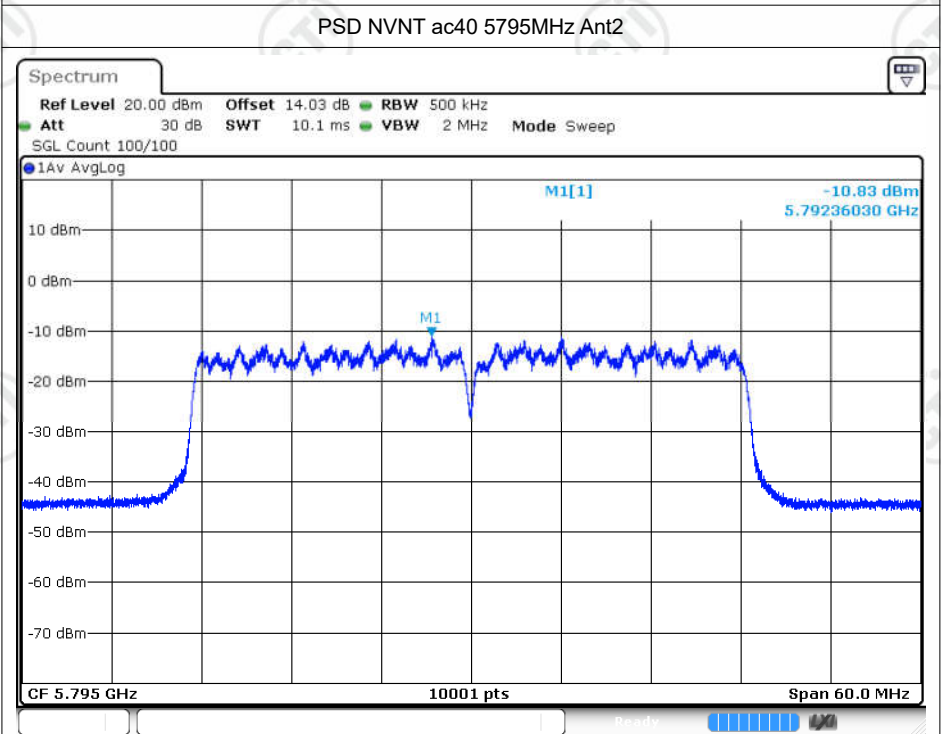


Date: 27. MAR 2023 19:26:49

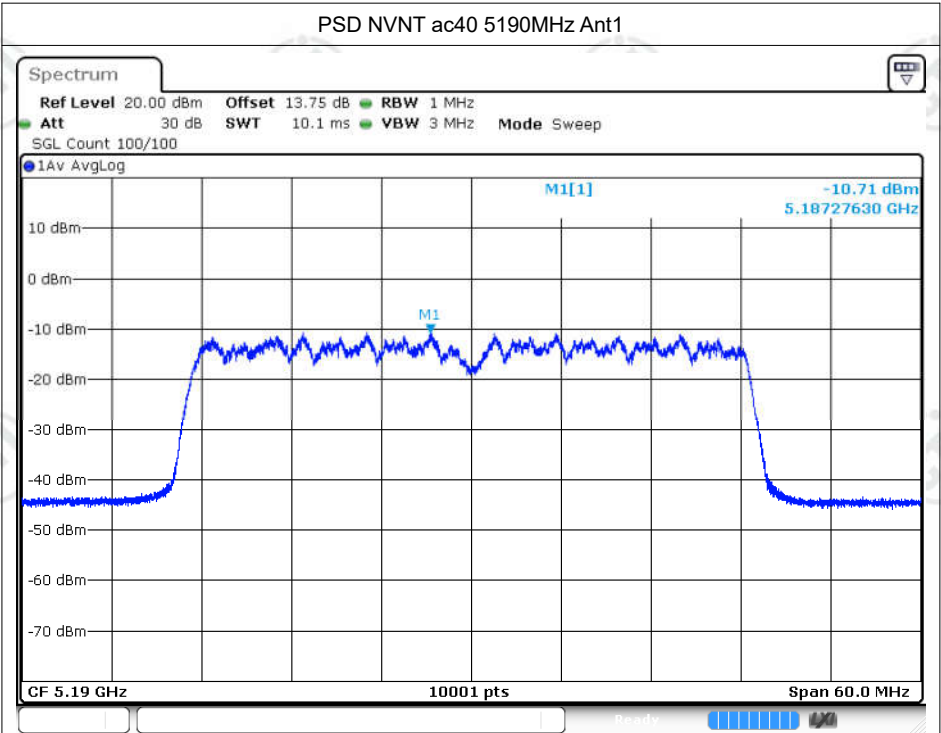


Date: 28.MAR.2023 13:35:51

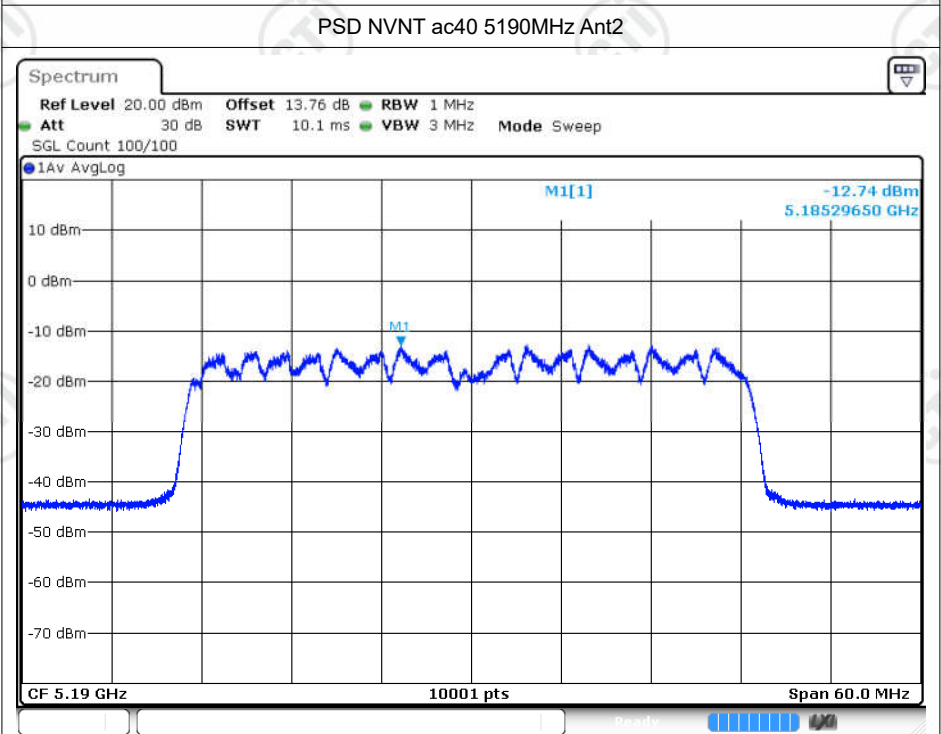



Date: 28.MAR.2023 13:35:54

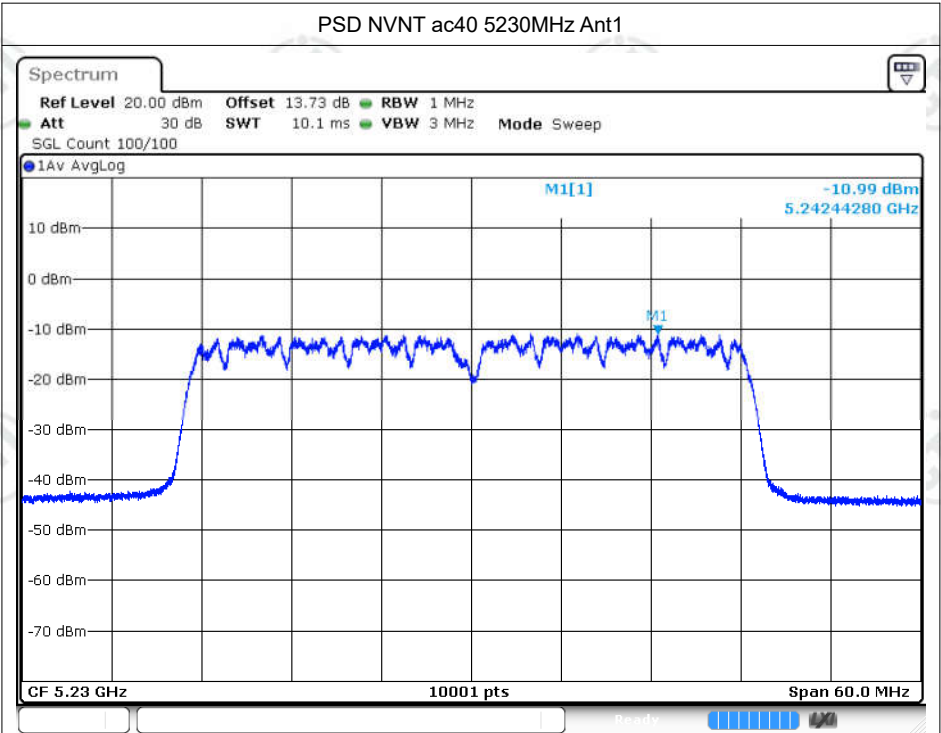


Date: 28.MAR.2023 13:35:29

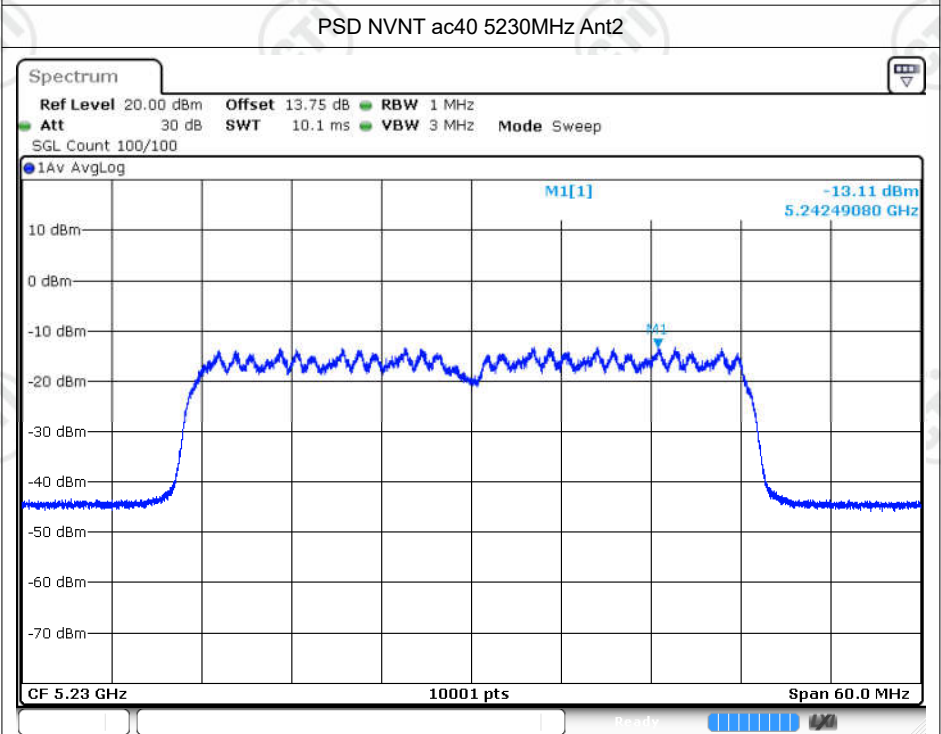


Date: 28.MAR.2023 13:35:33

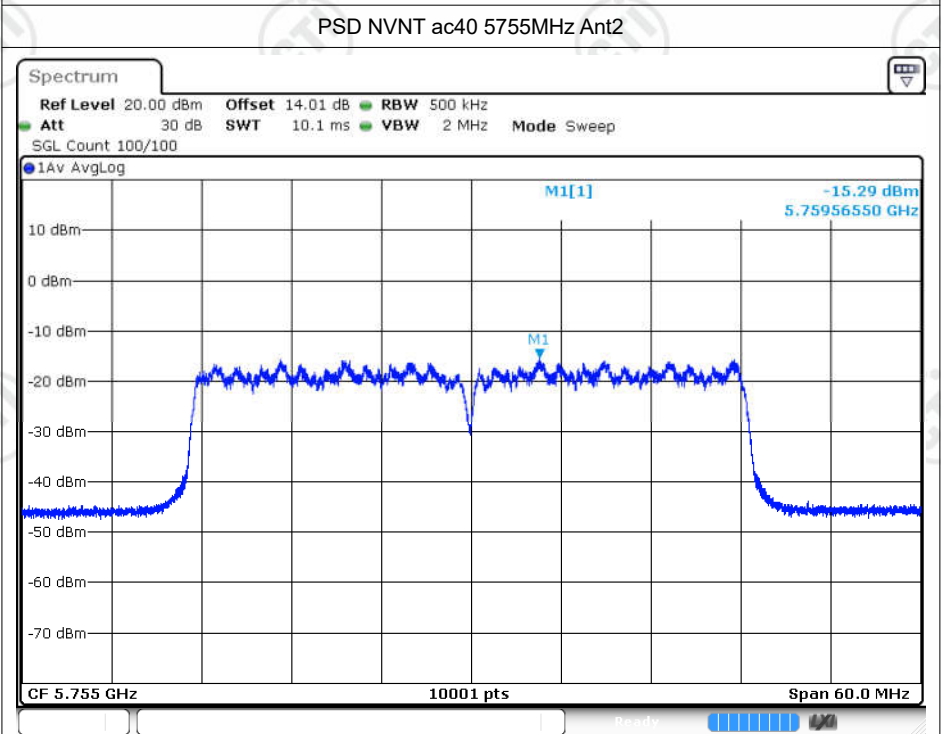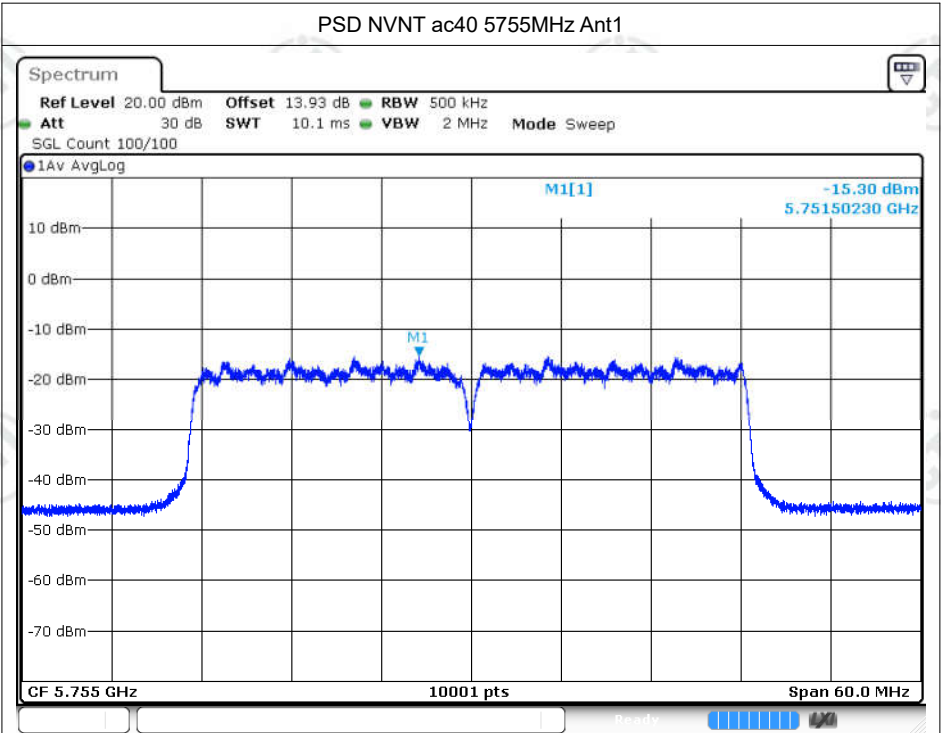


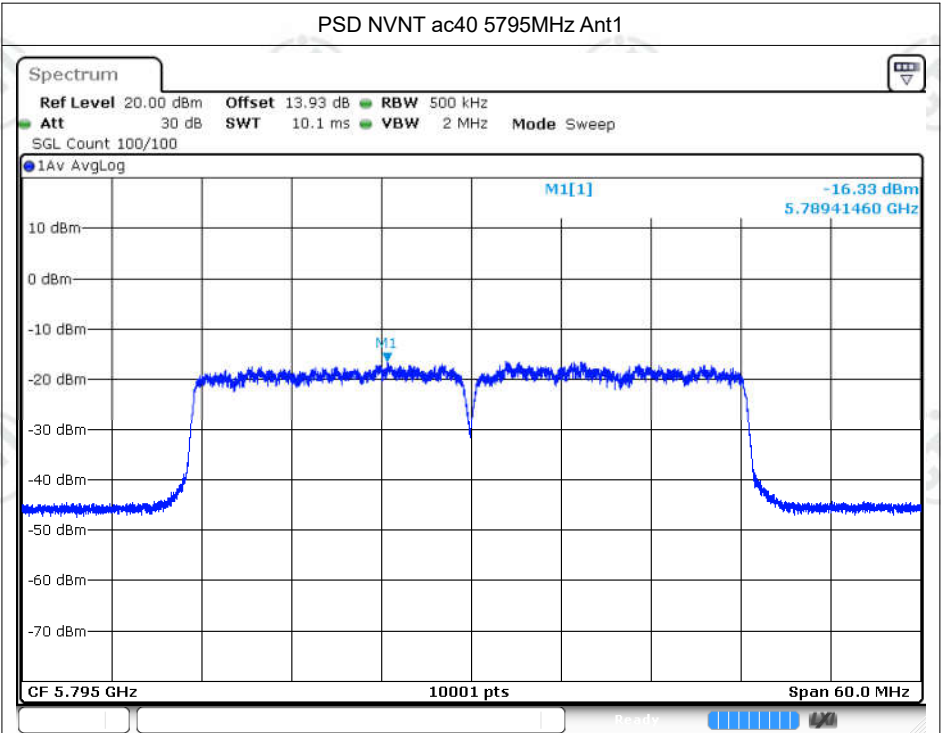


Date: 28.MAR.2023 13:39:29

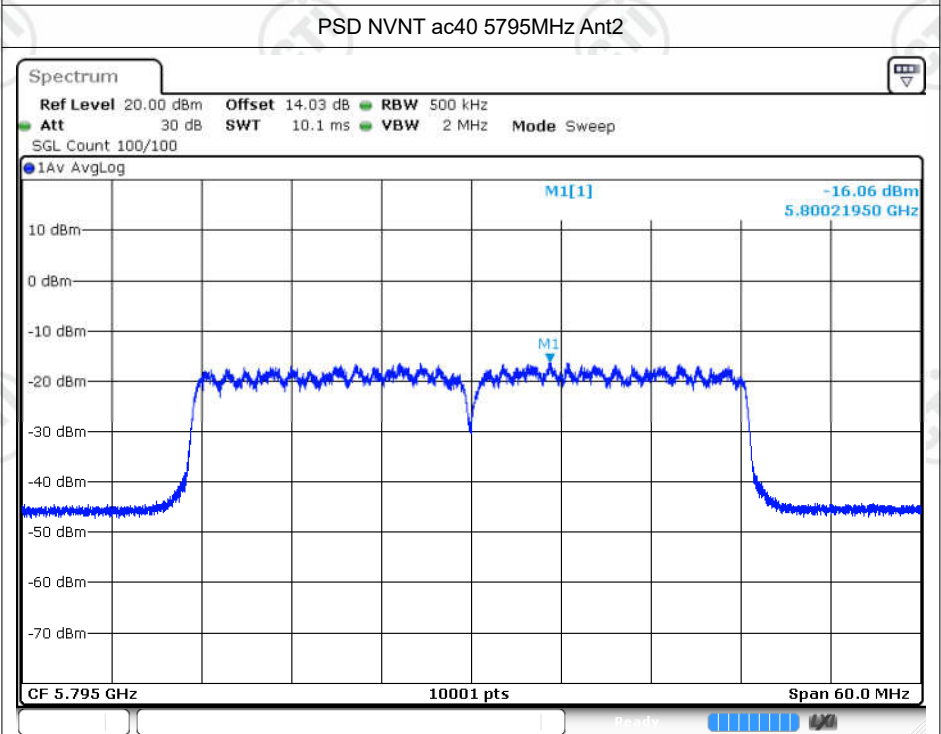


Date: 28.MAR.2023 13:39:32

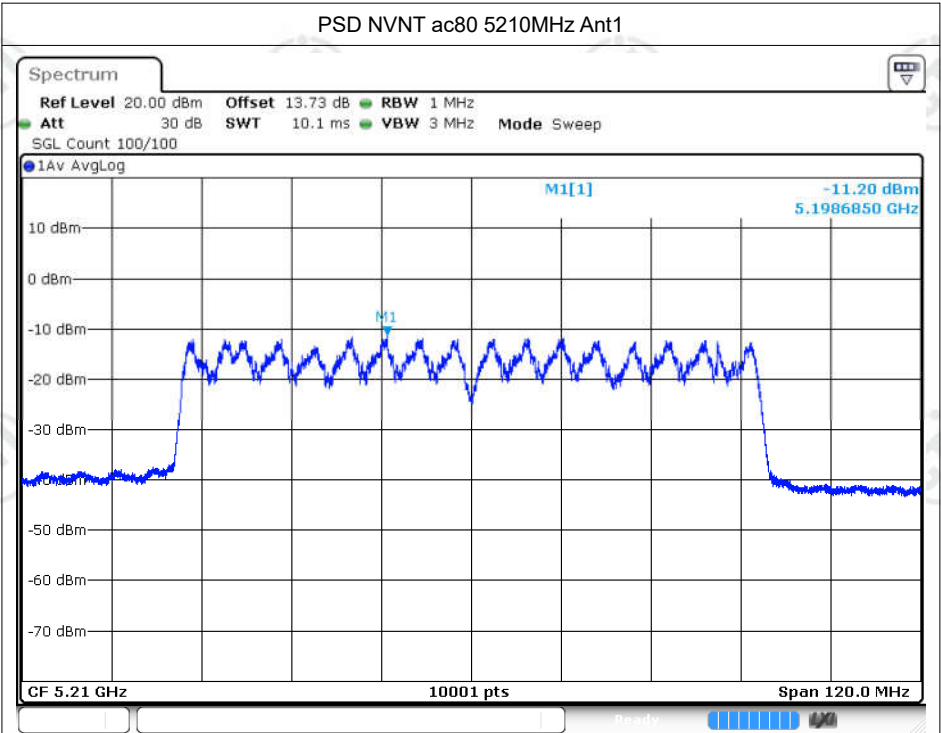


Date: 27. MAR 2023 15:52:56

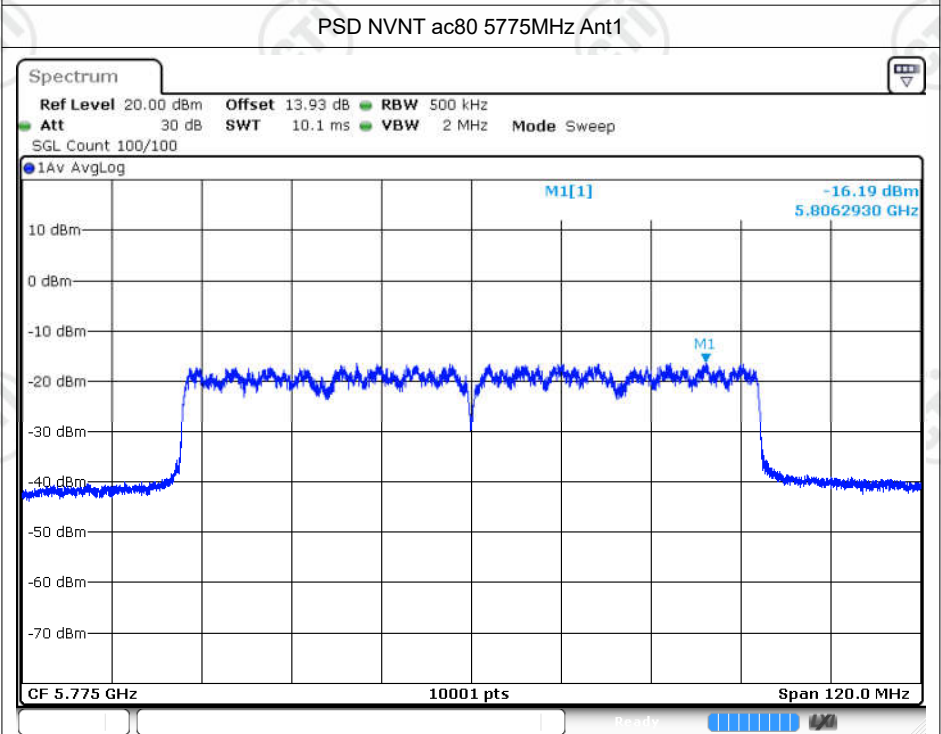


Date: 27. MAR 2023 15:57:07

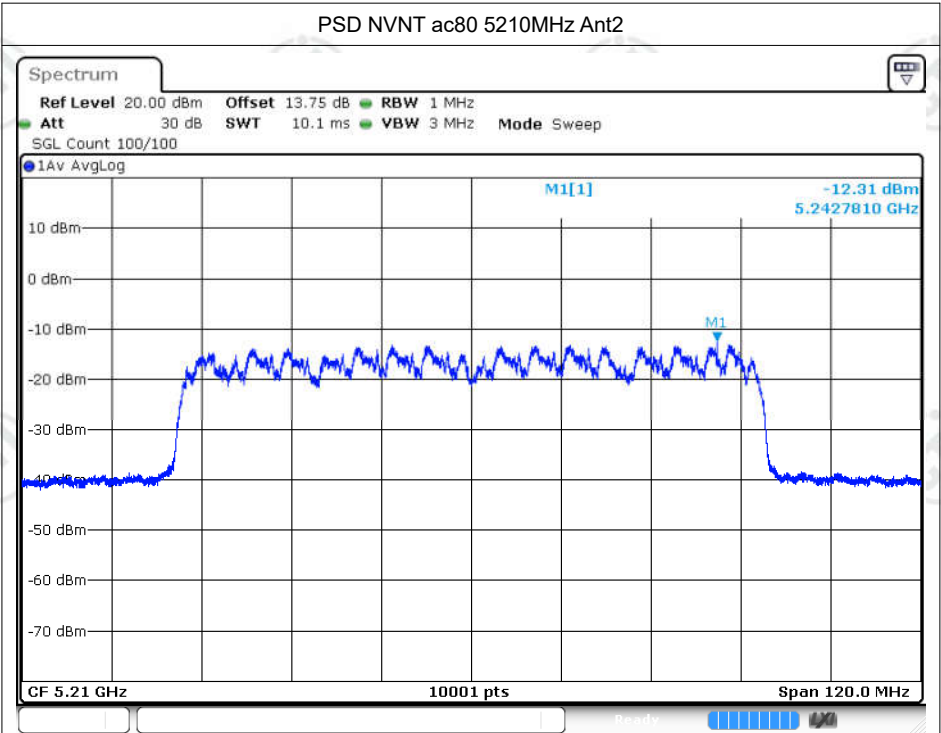


Date: 27. MAR 2023 19:29:38

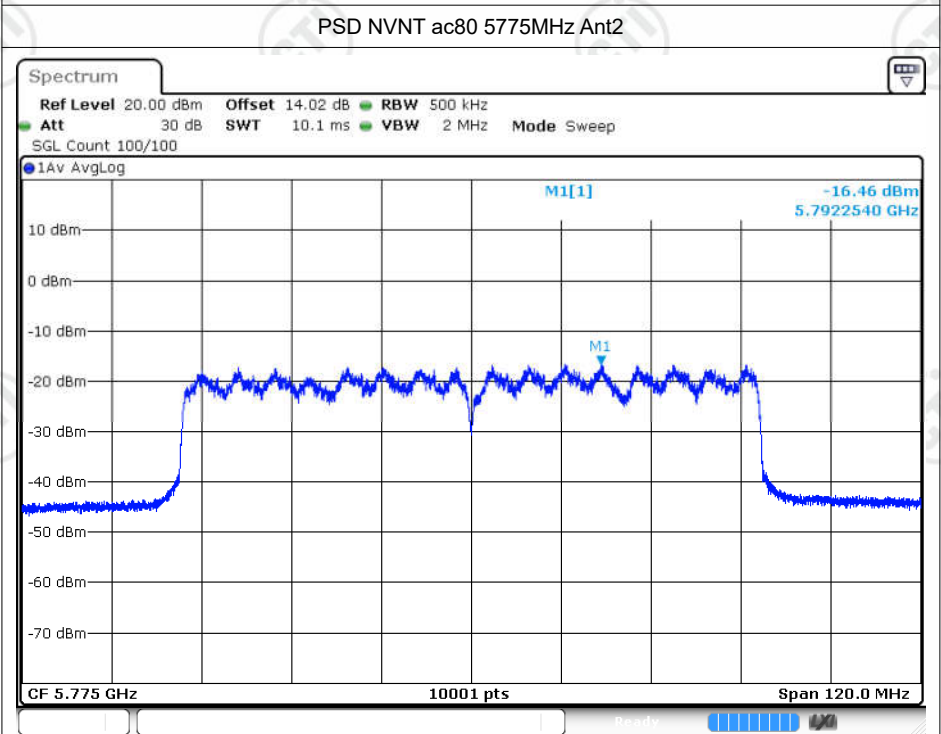


Date: 27. MAR 2023 19:32:27

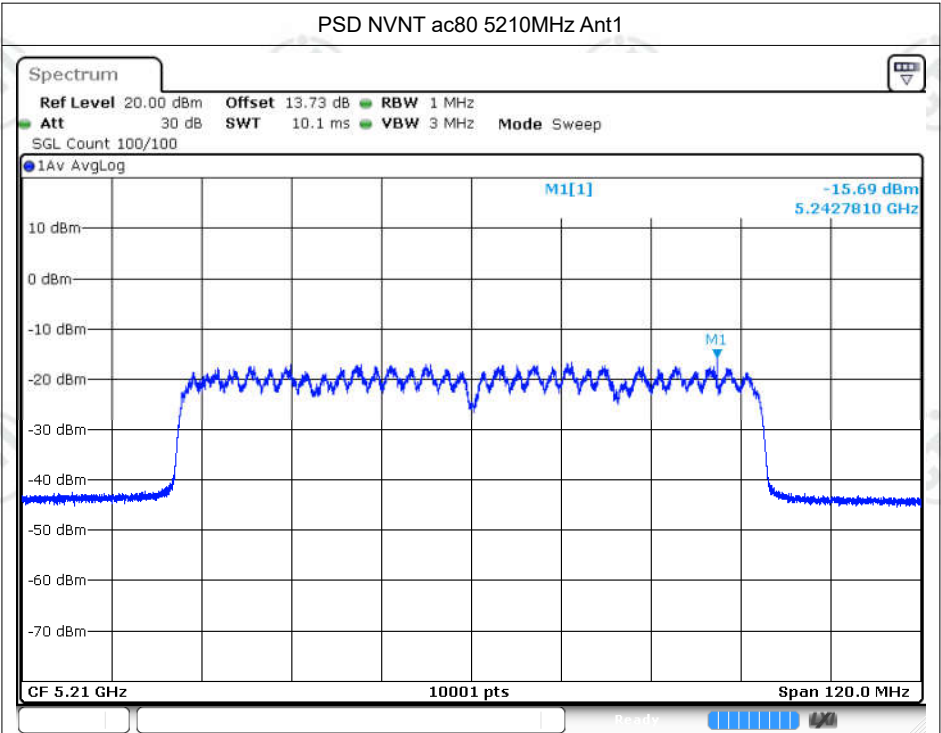


Date: 28.MAR.2023 13:41:56

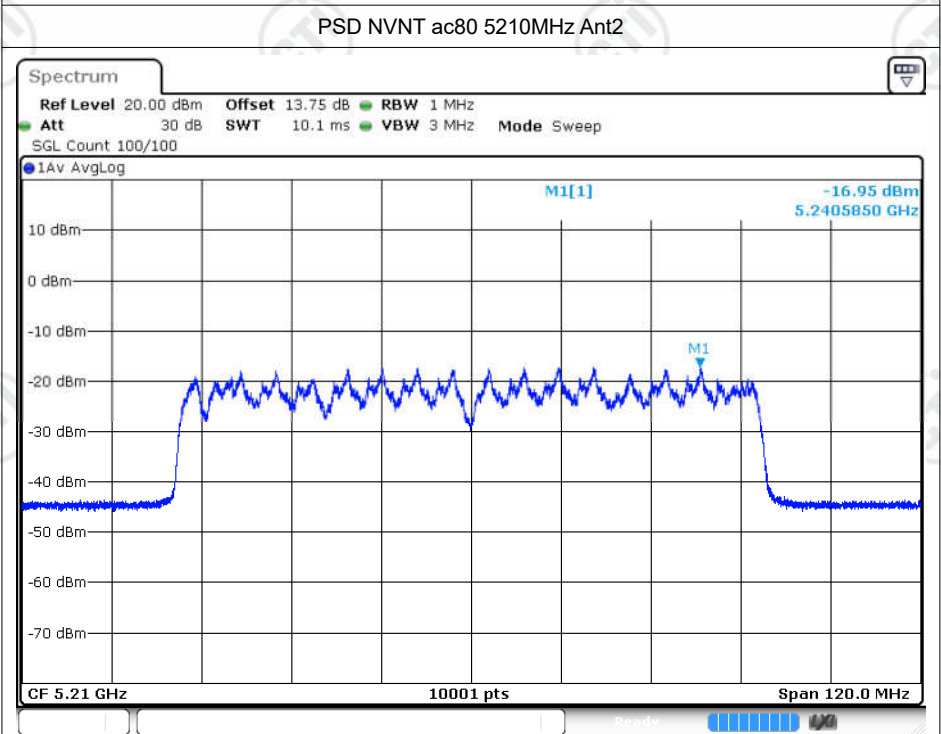


Date: 28.MAR.2023 13:42:00

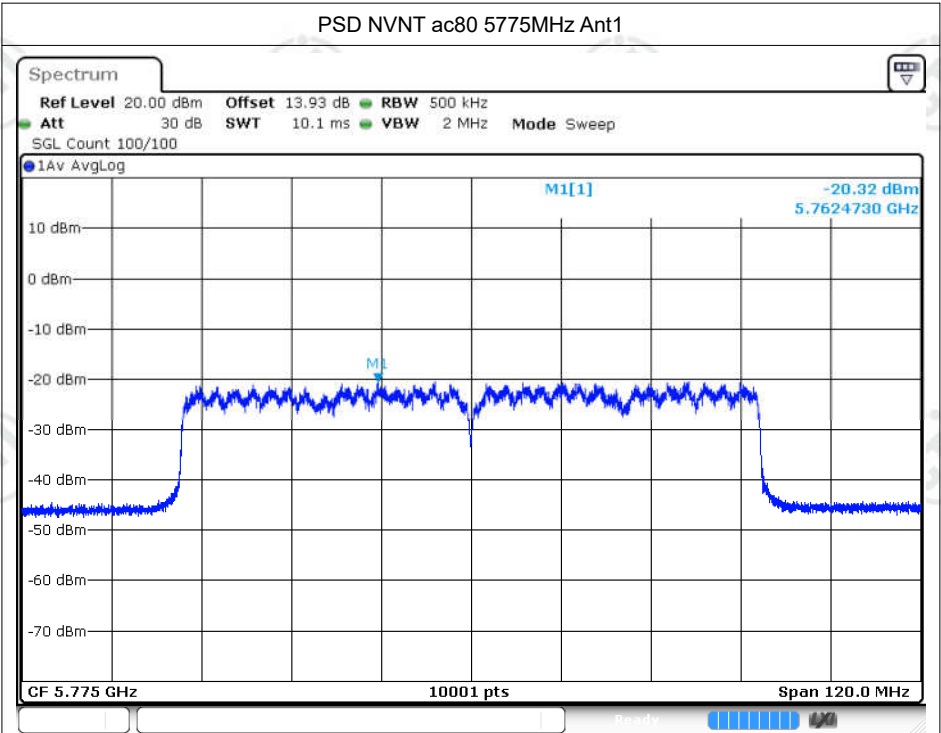


Date: 28.MAR.2023 13:43:35

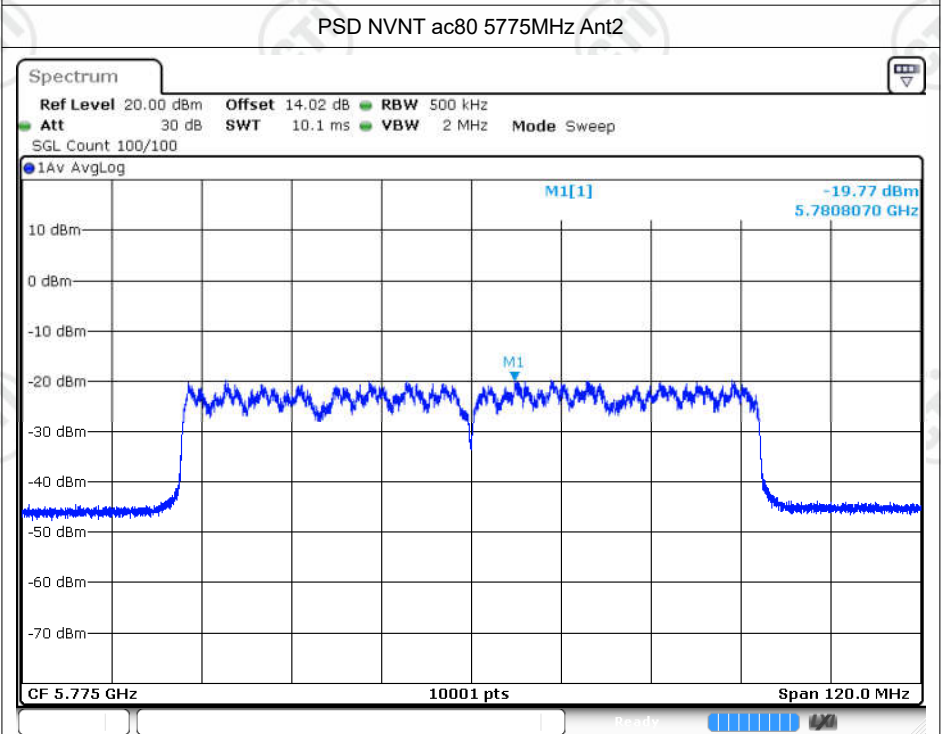


Date: 28.MAR.2023 13:43:39

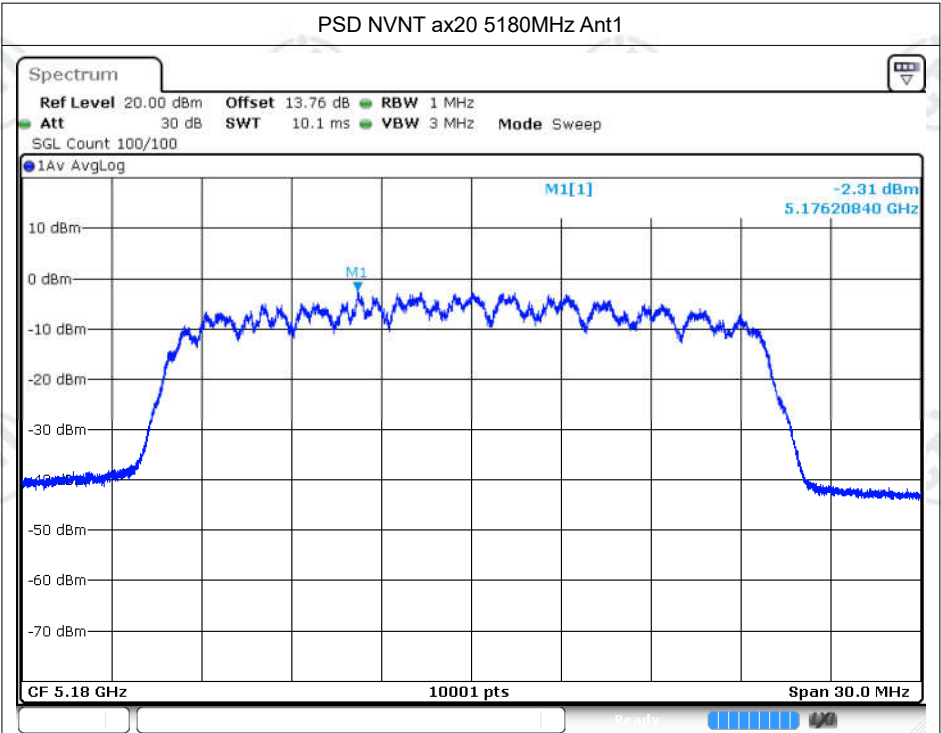


Date: 27. MAR 2023 16:00:59

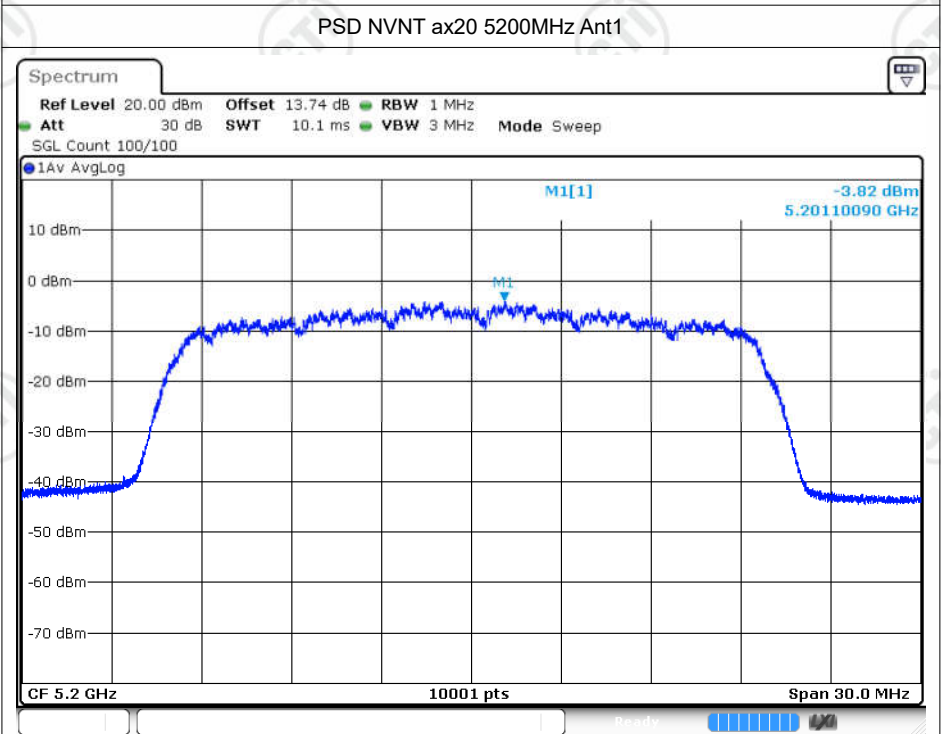


Date: 27. MAR 2023 16:27:24

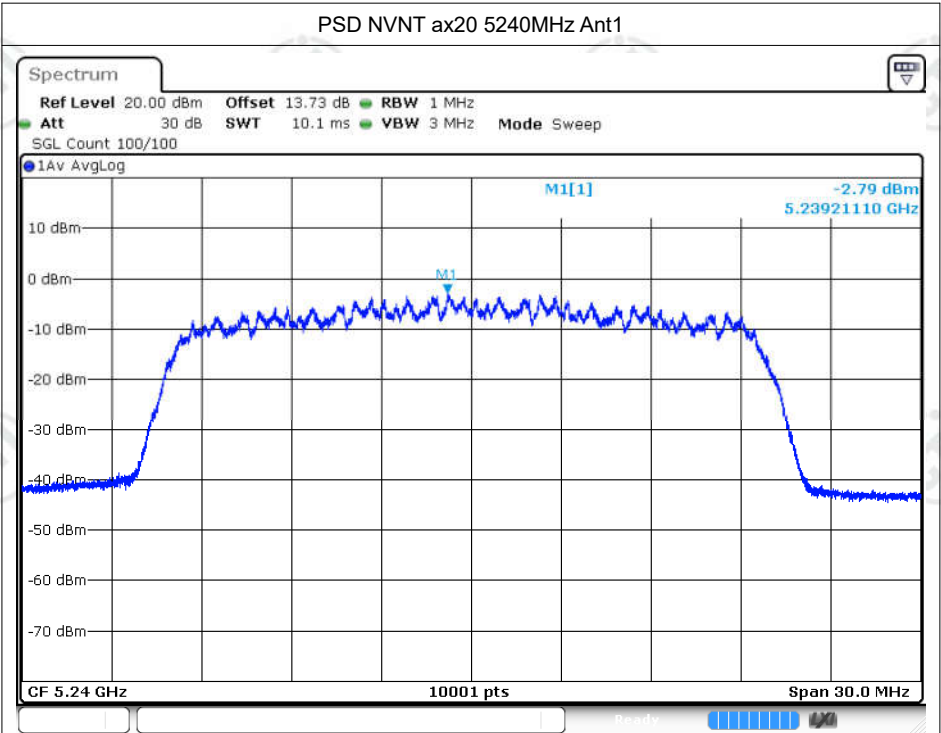


Date: 27. MAR 2023 16:29:36

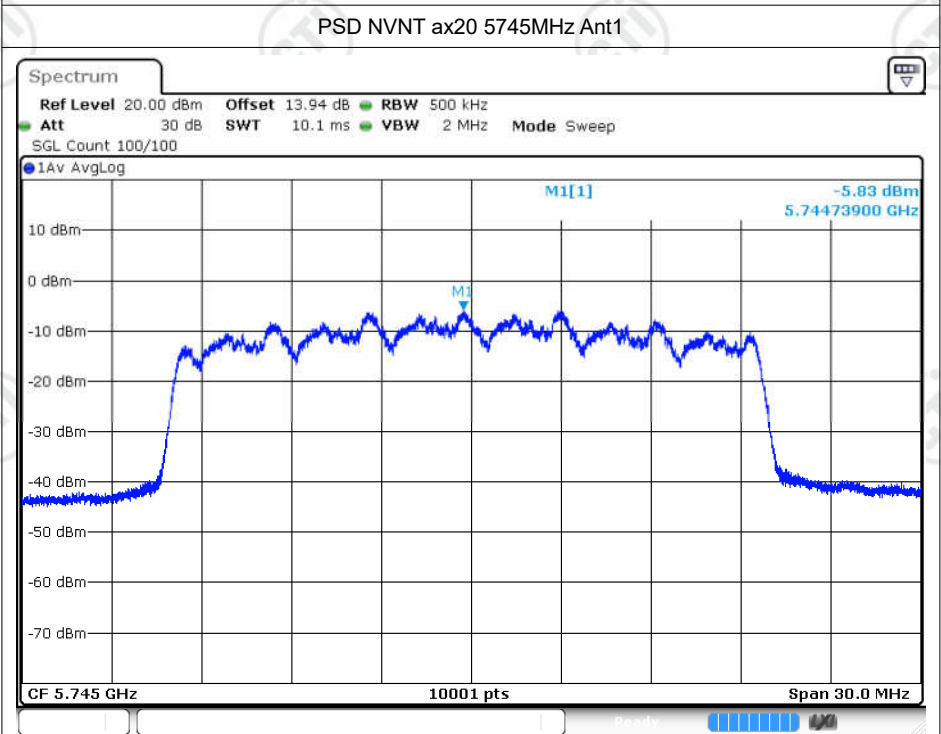


Date: 27. MAR 2023 16:44:30

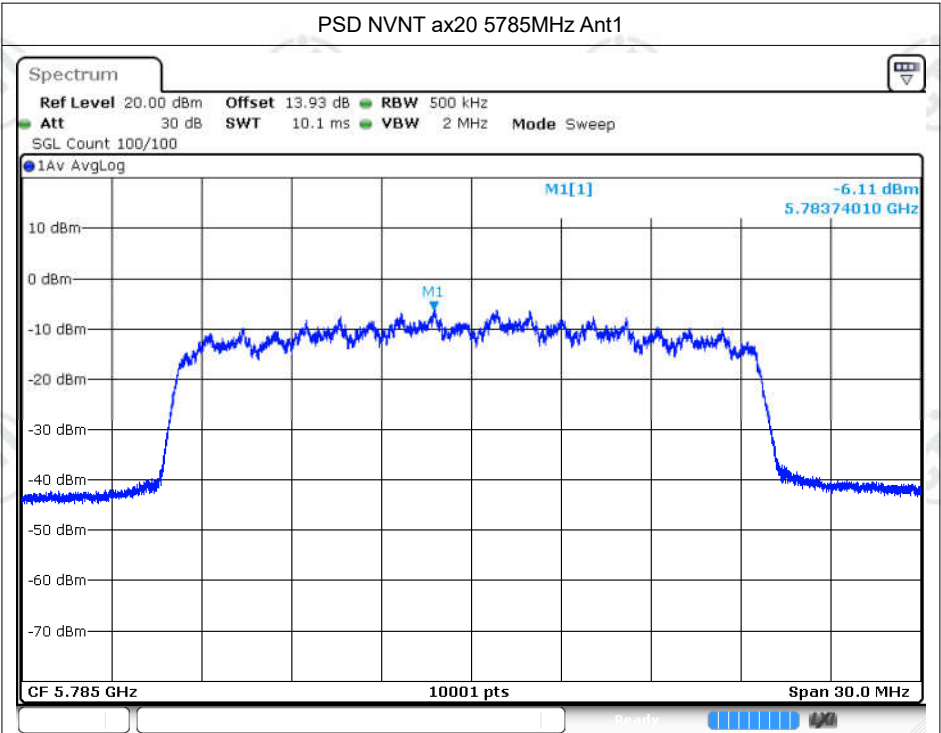


Date: 27. MAR 2023 16:45:54

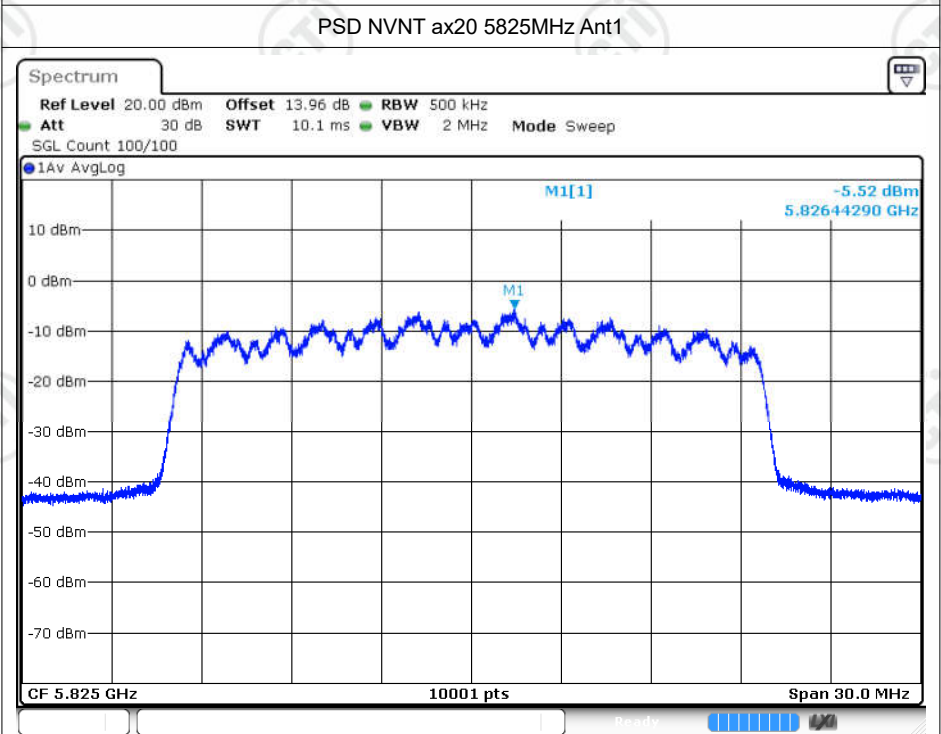


Date: 27. MAR 2023 16:47:13

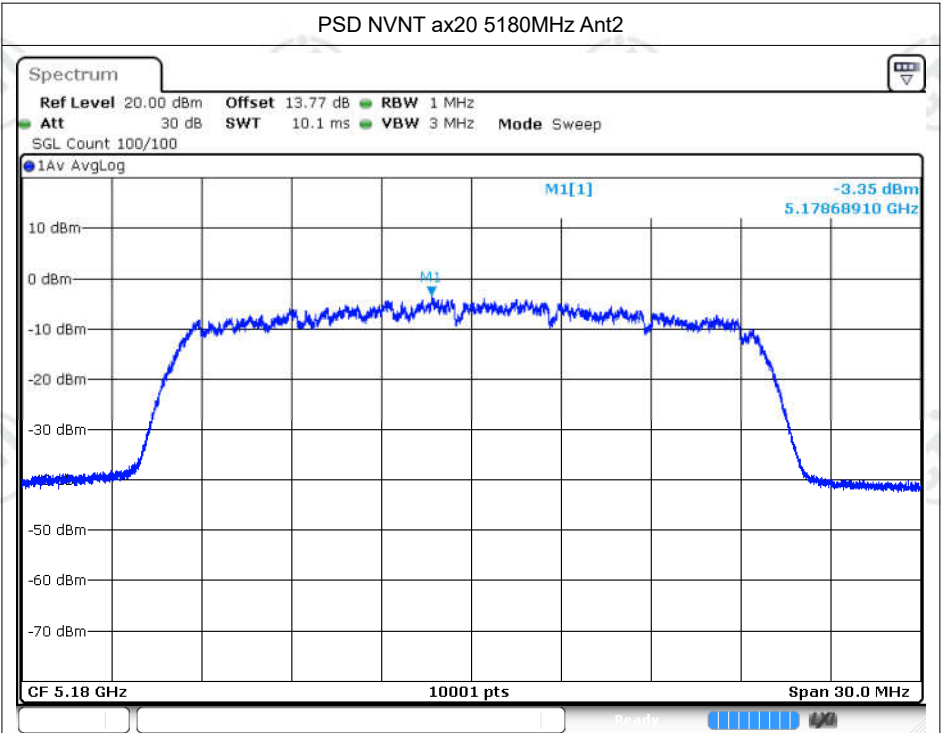


Date: 27. MAR 2023 19:35:13

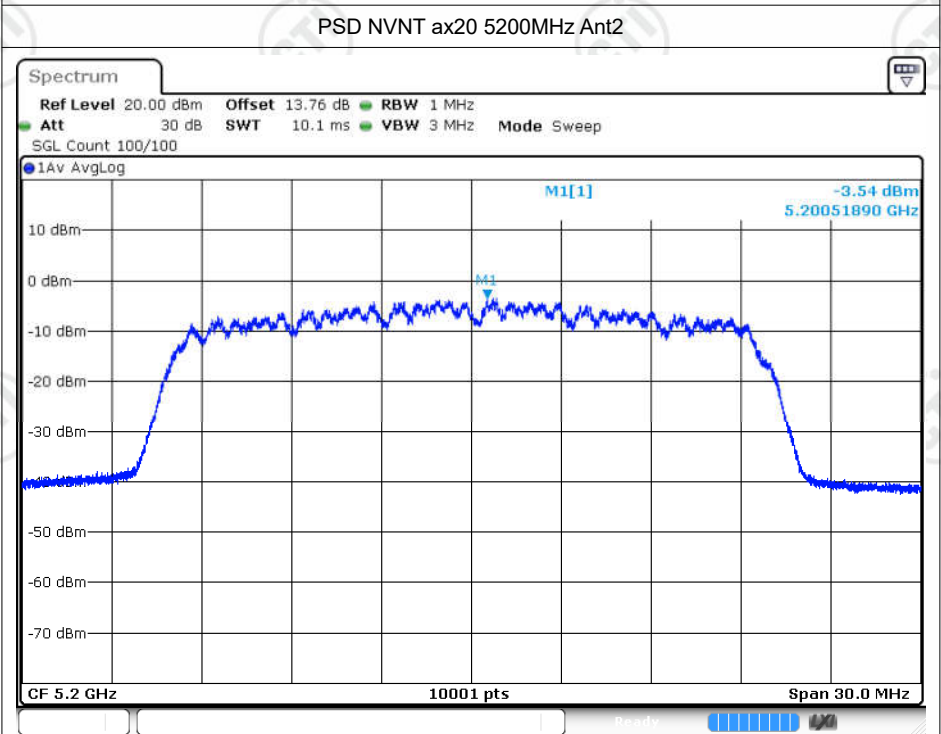


Date: 27. MAR 2023 19:36:37

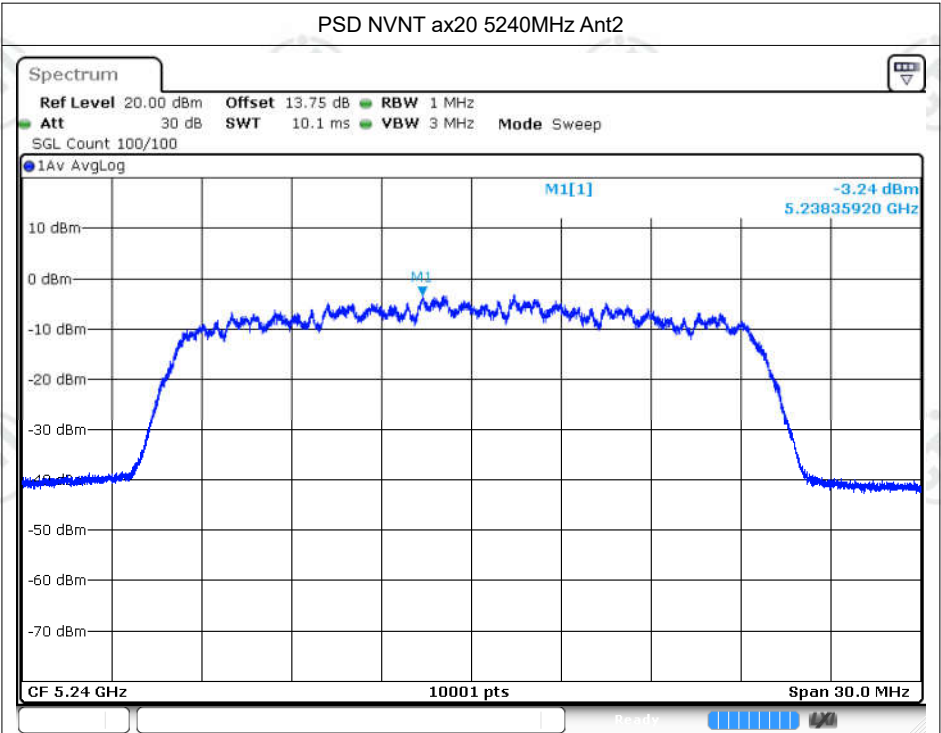


Date: 27. MAR 2023 19:38:10

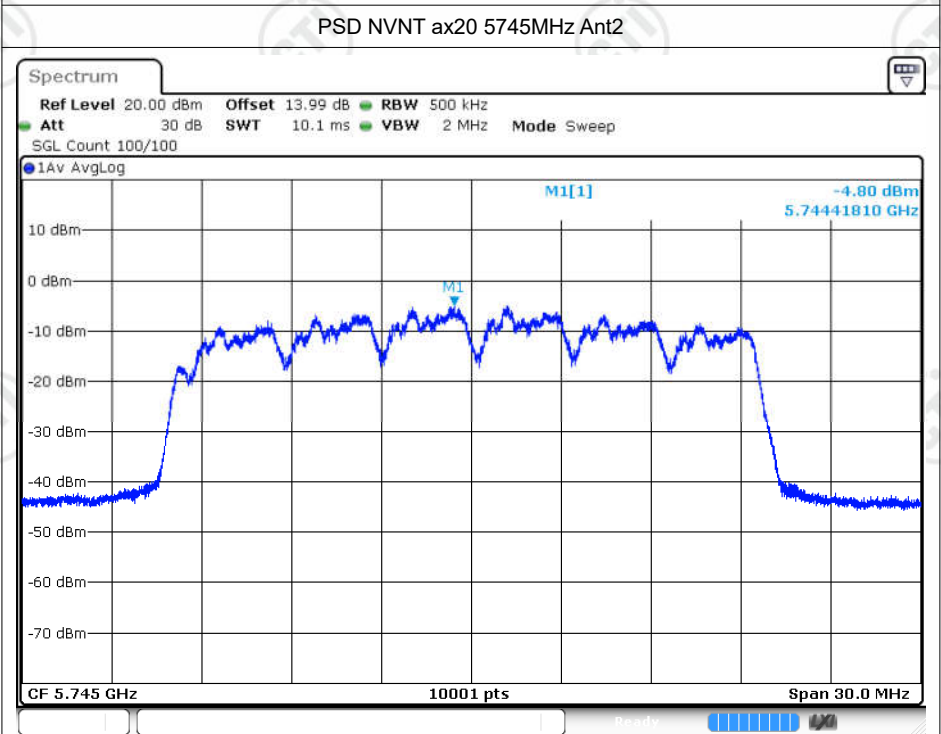


Date: 27. MAR 2023 19:45:41

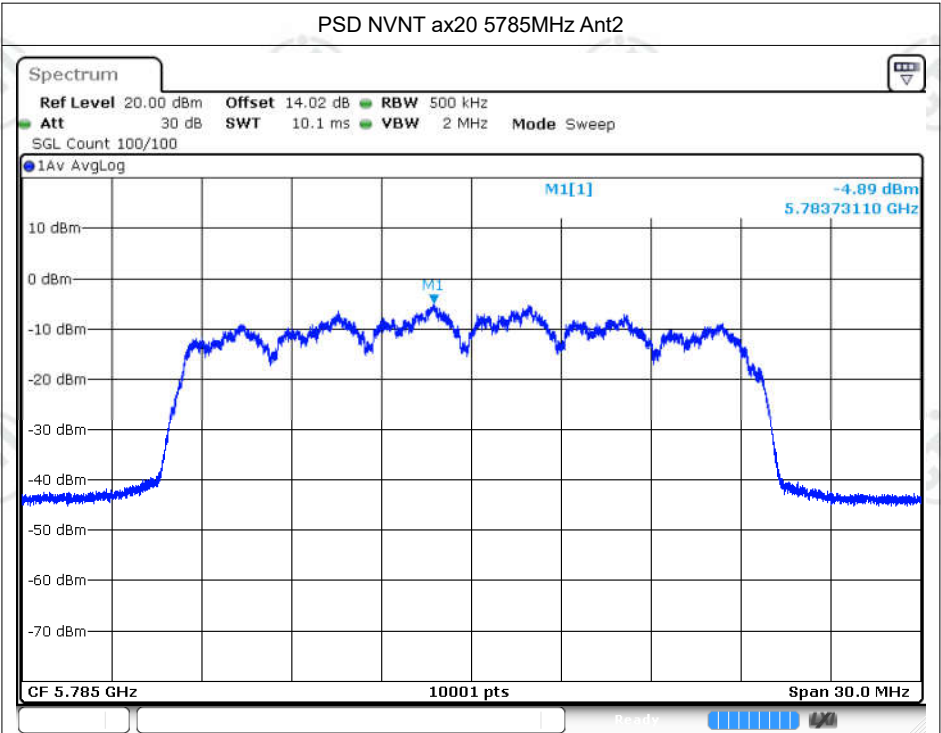


Date: 27. MAR 2023 19:43:15

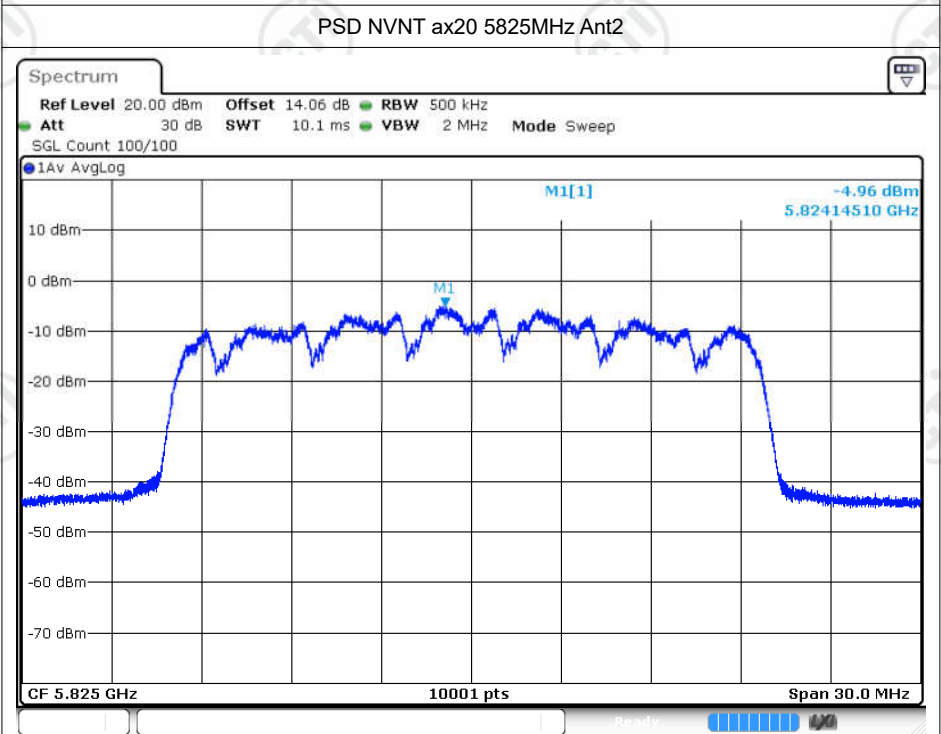


Date: 27. MAR 2023 19:44:26

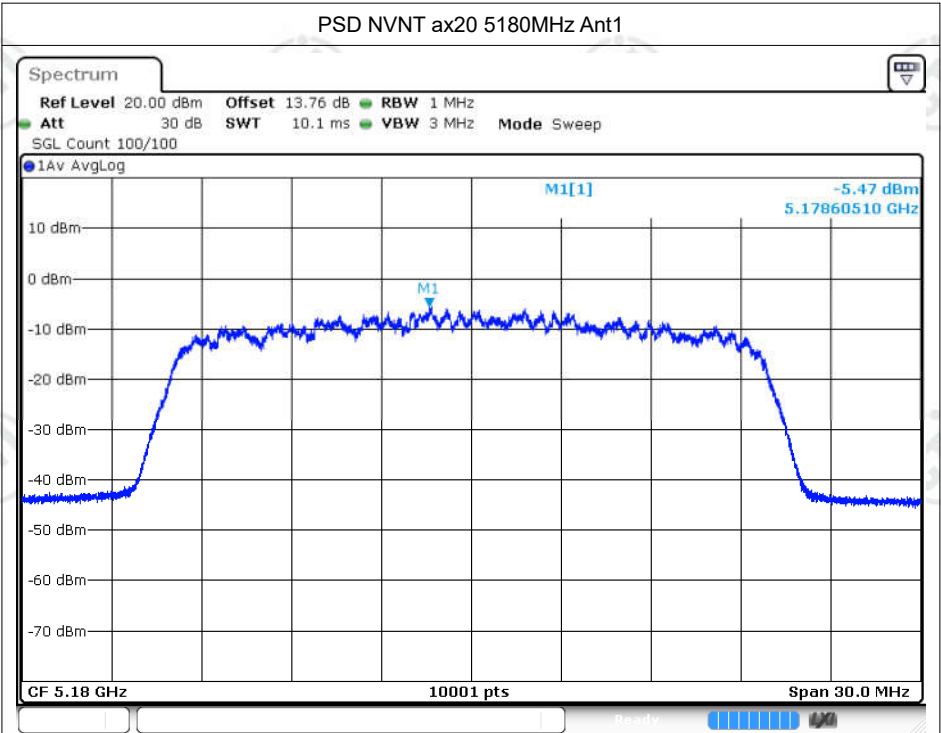


Date: 28.MAR.2023 10:43:38

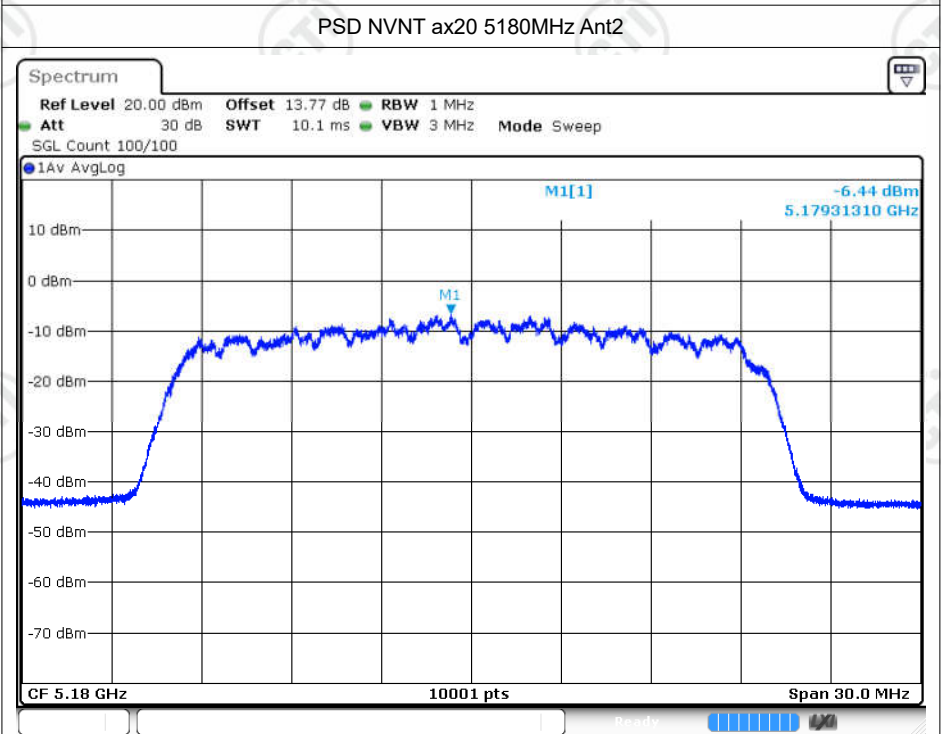


Date: 28.MAR.2023 10:43:41

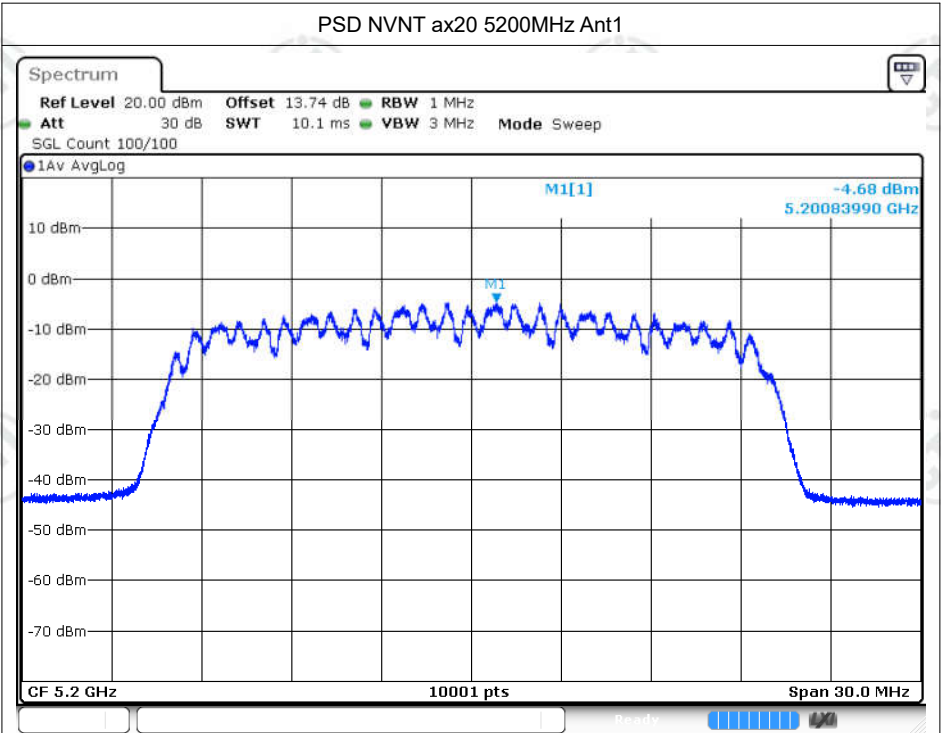


Date: 28.MAR.2023 10:44:40

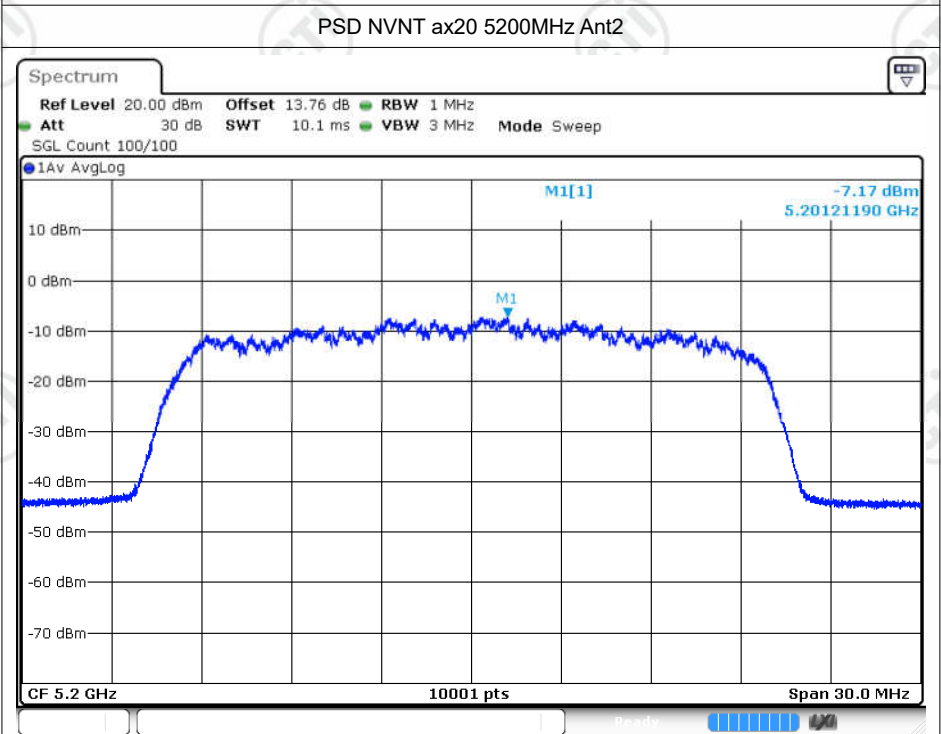


Date: 28.MAR.2023 10:44:43

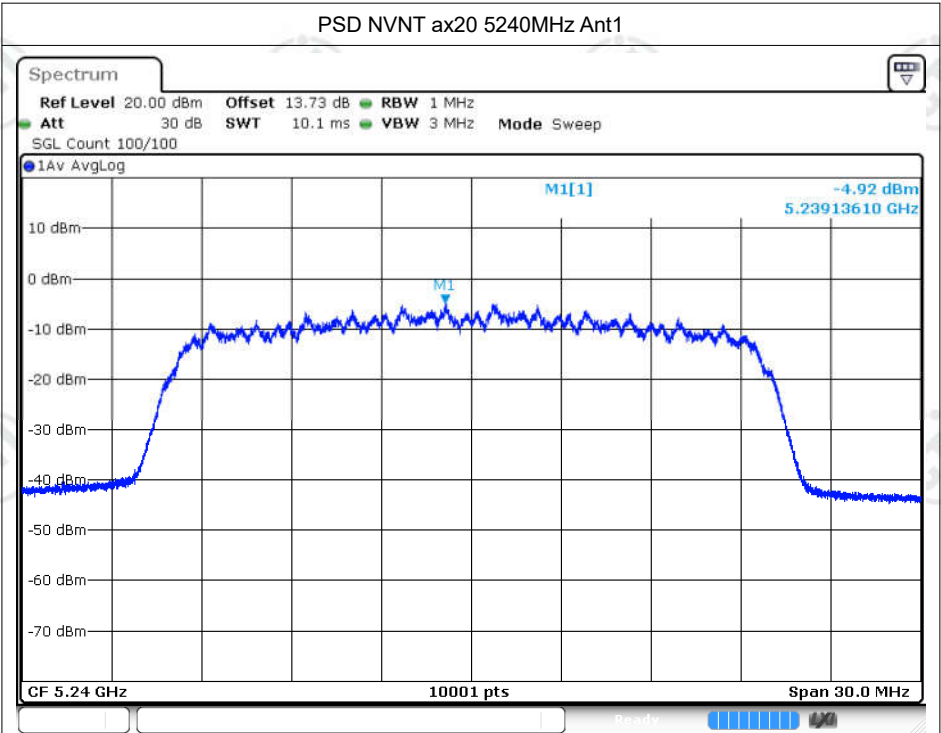


Date: 28.MAR.2023 10:46:45

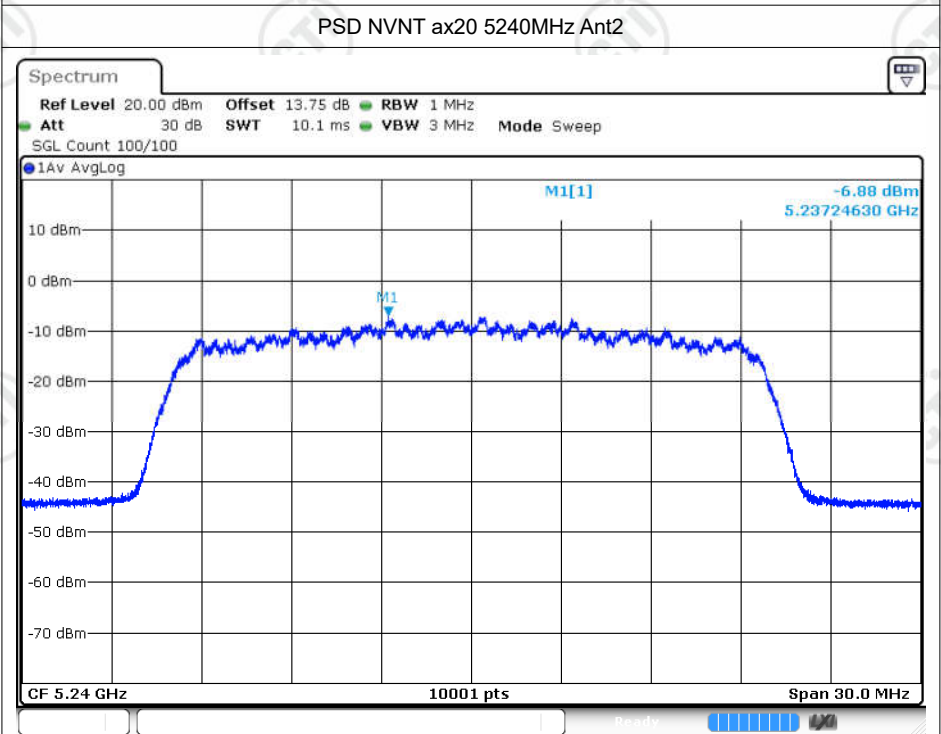


Date: 28.MAR.2023 10:46:49

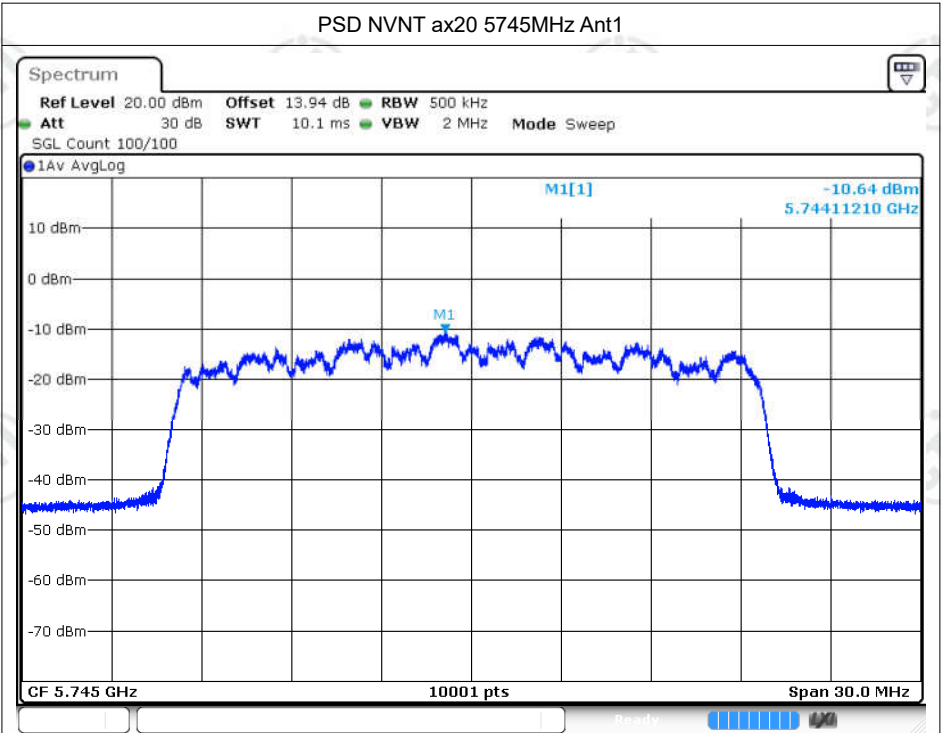


Date: 28.MAR.2023 10:48:17

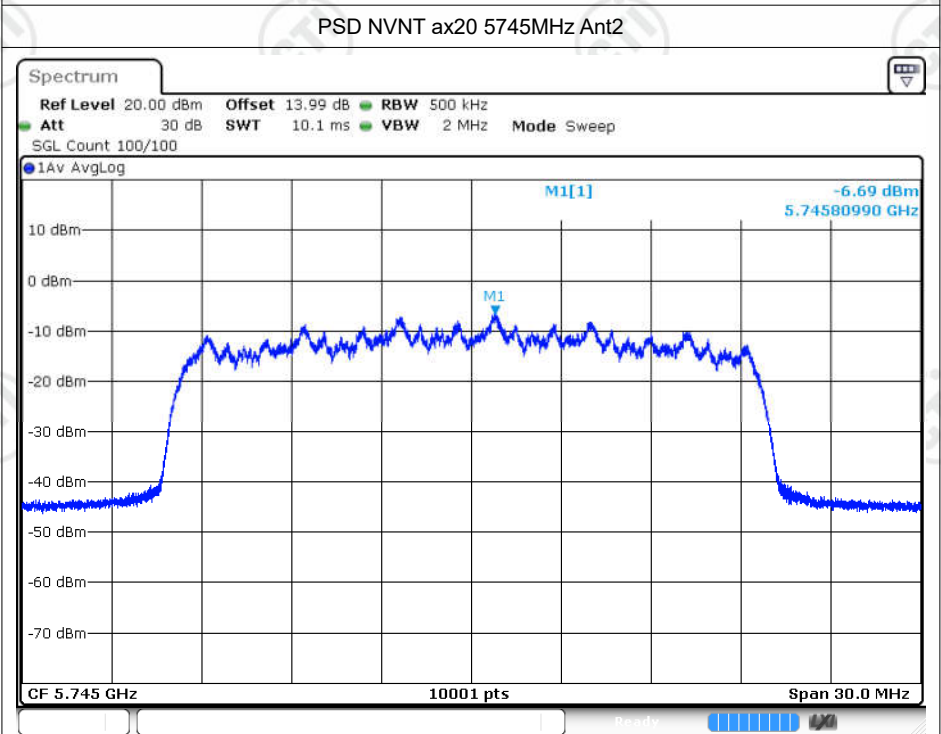


Date: 28.MAR.2023 10:48:20

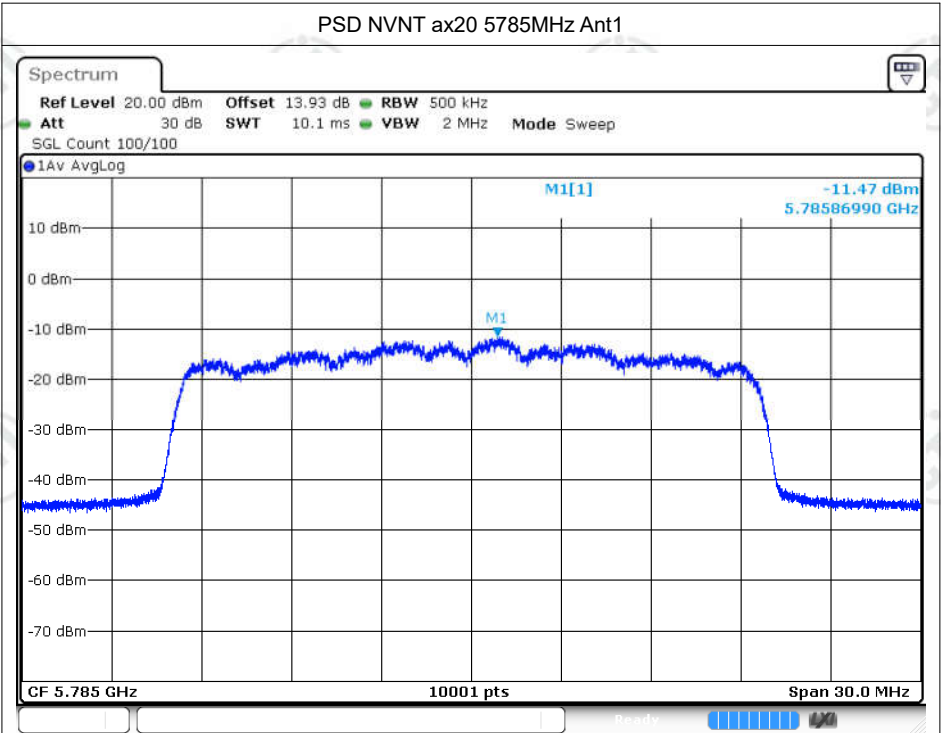


Date: 28.MAR.2023 10:49:13

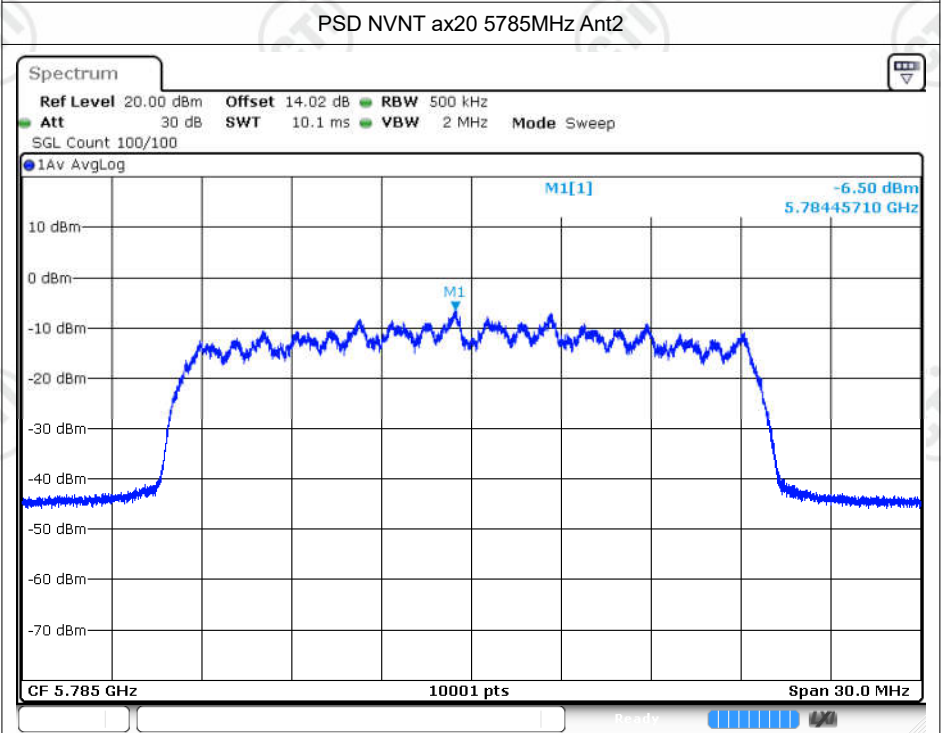


Date: 28.MAR.2023 10:49:16

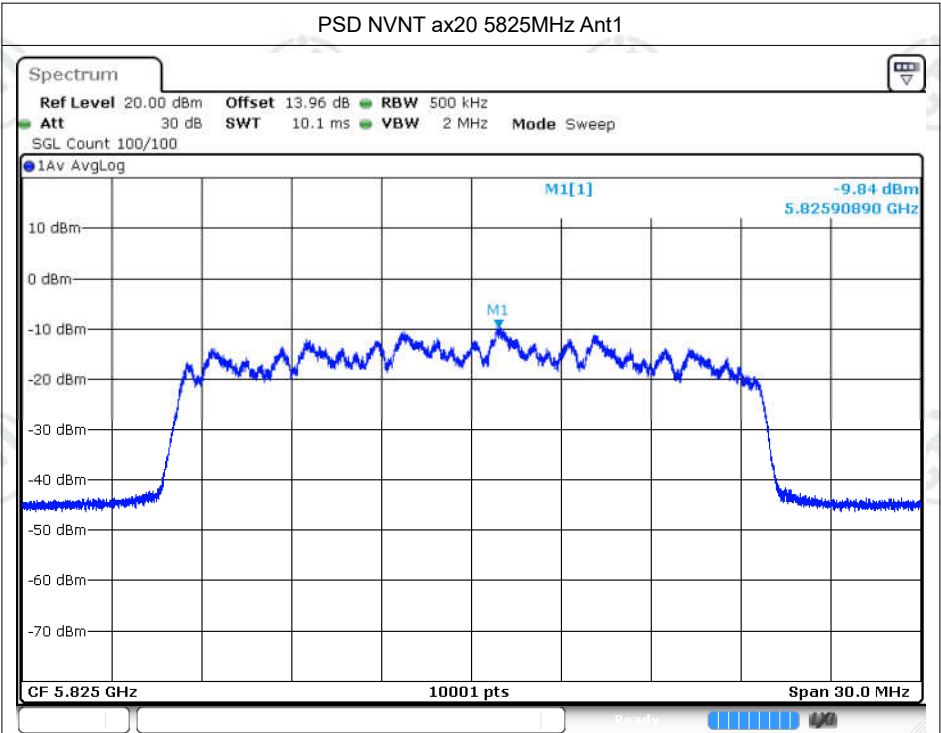


Date: 28.MAR.2023 10:49:41

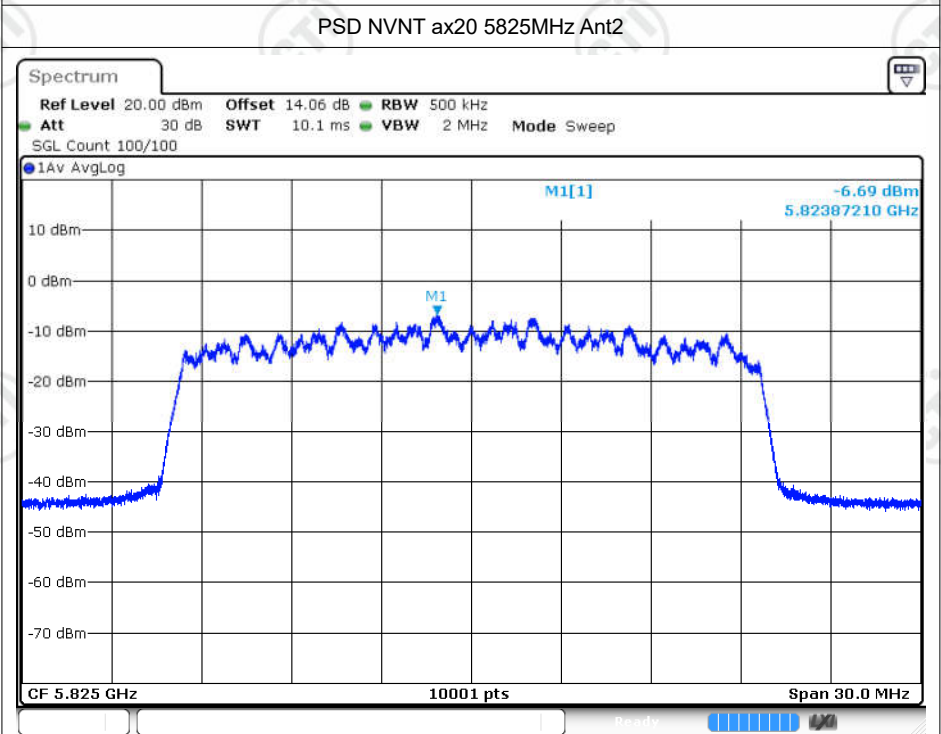


Date: 28.MAR.2023 10:49:45

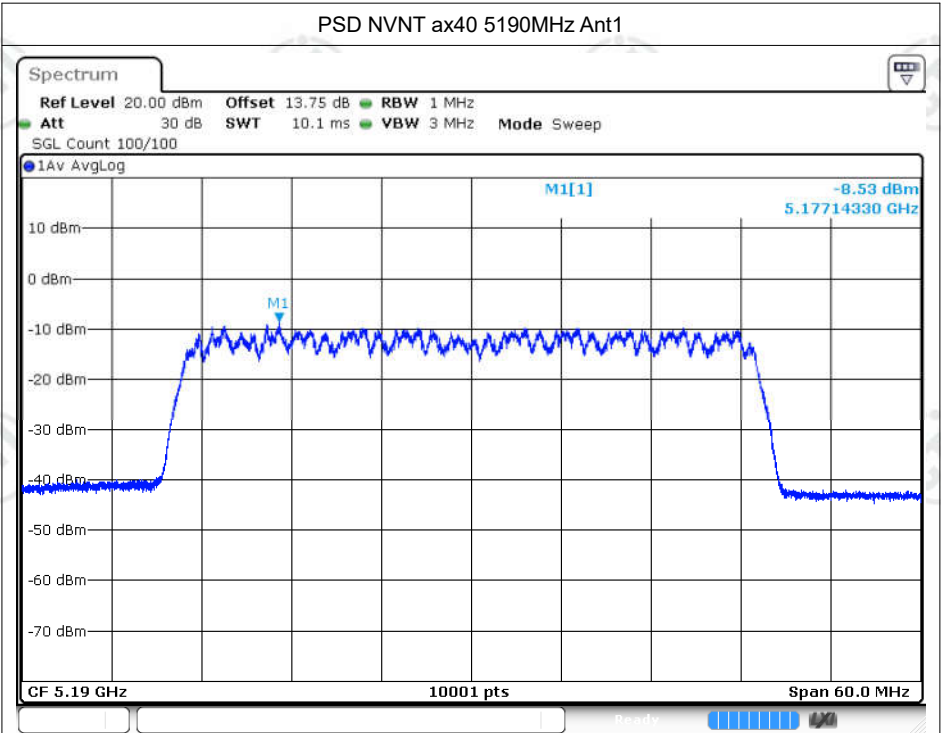


Date: 27. MAR 2023 16:55:57

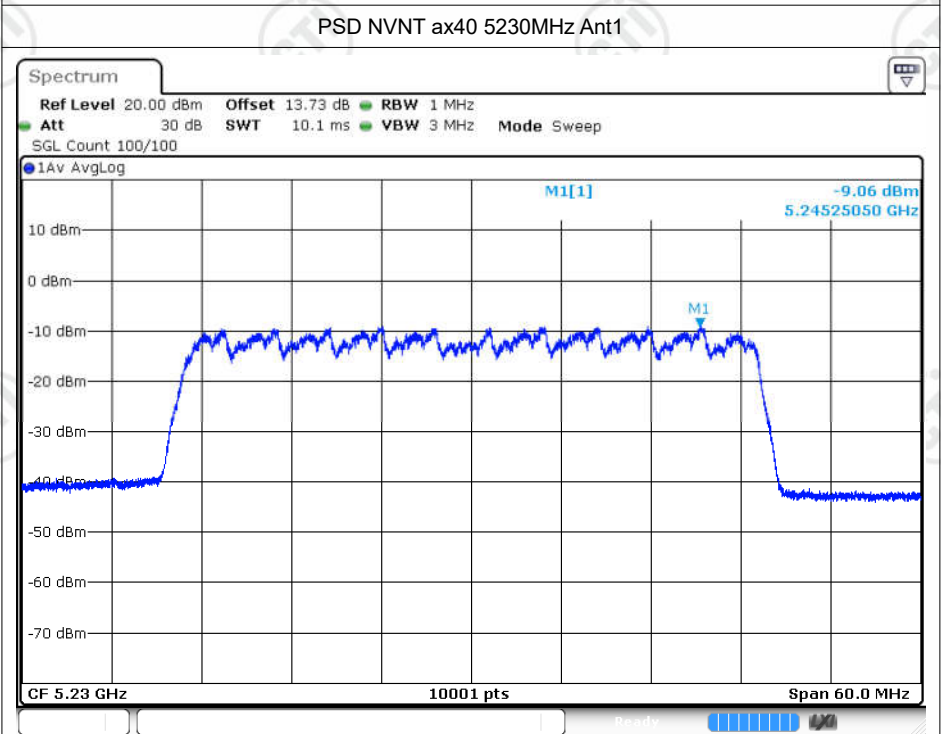


Date: 27. MAR 2023 16:56:54

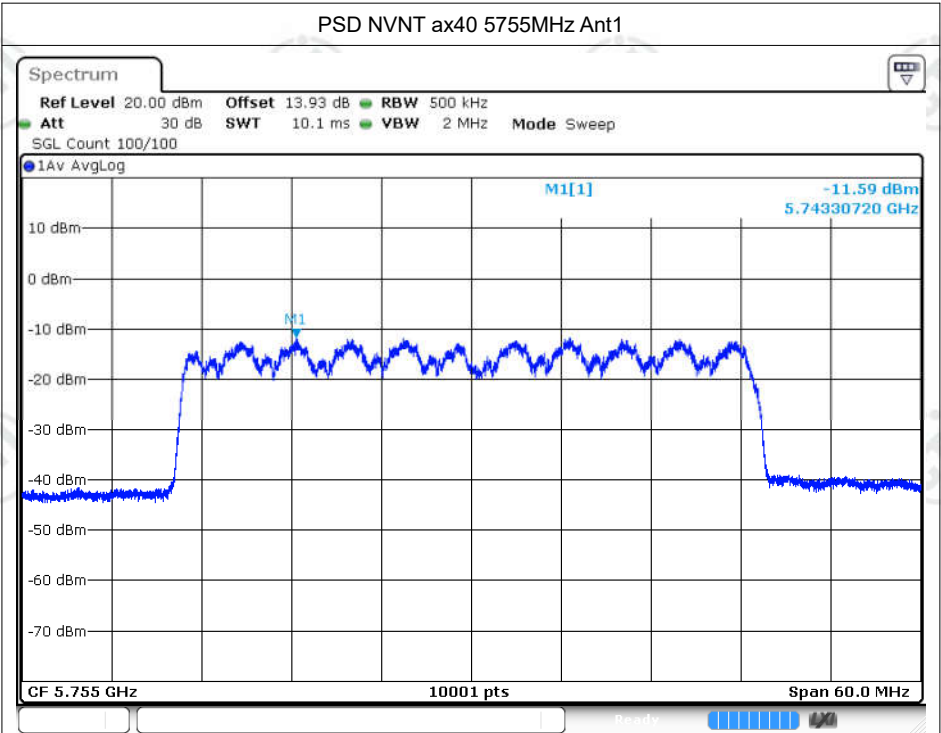


Date: 27. MAR 2023 17:00:23

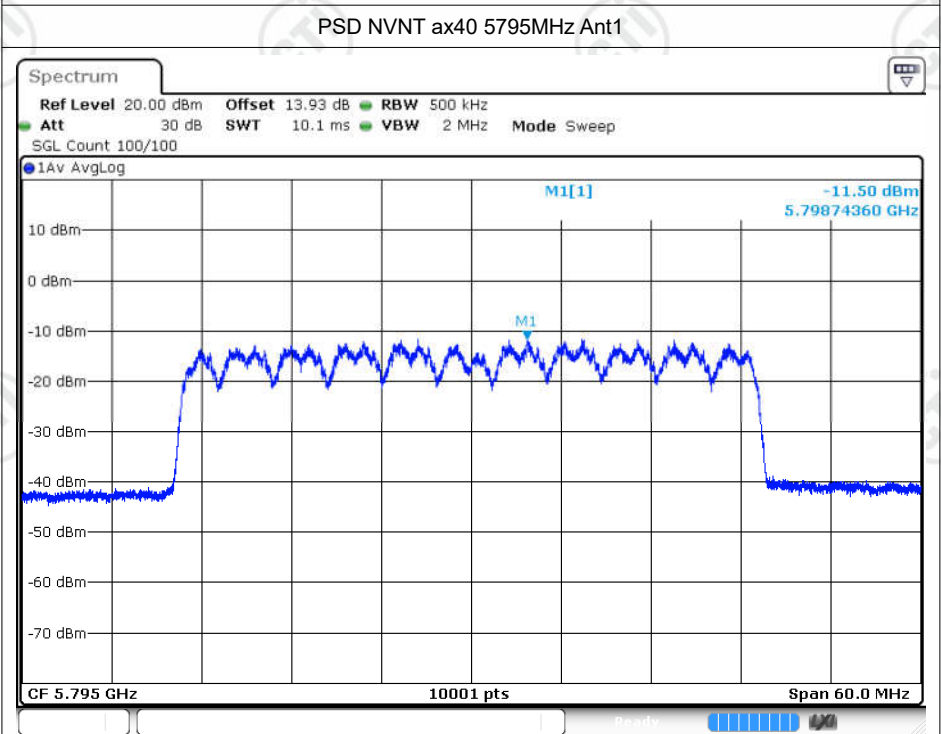


Date: 27. MAR 2023 17:02:00




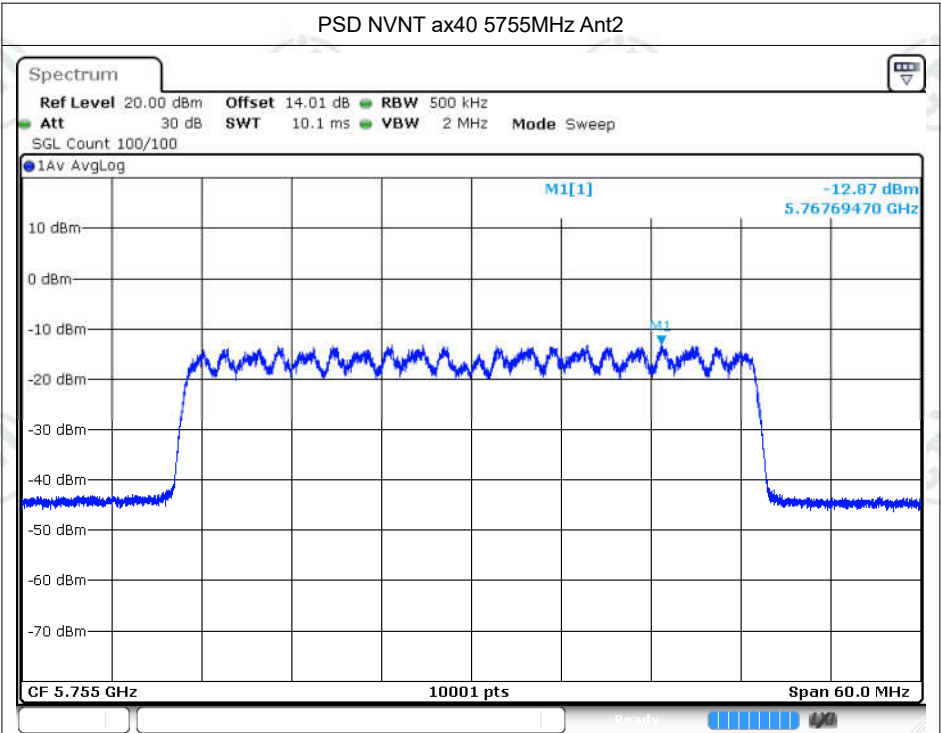


Date: 27. MAR 2023 19:50:54

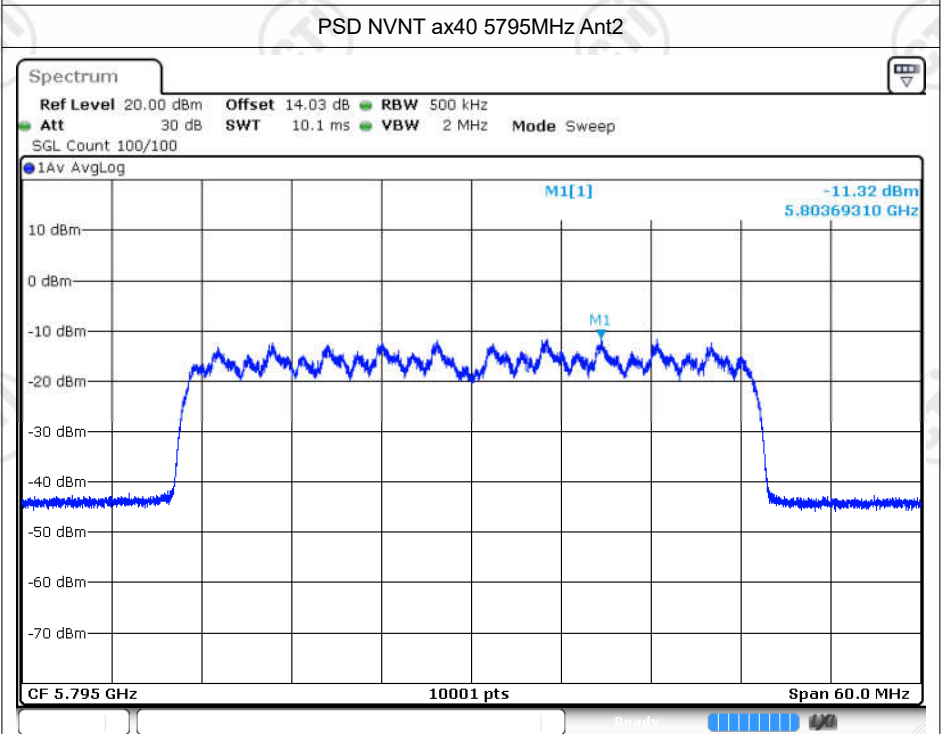


Date: 27. MAR 2023 19:53:14

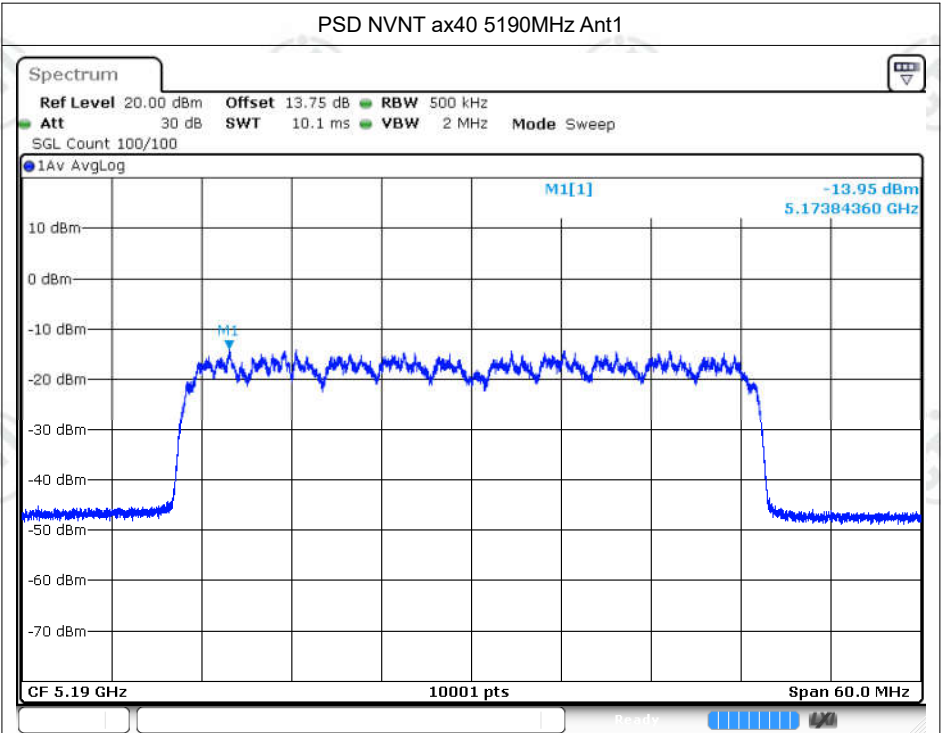


Date: 28.MAR.2023 10:51:01

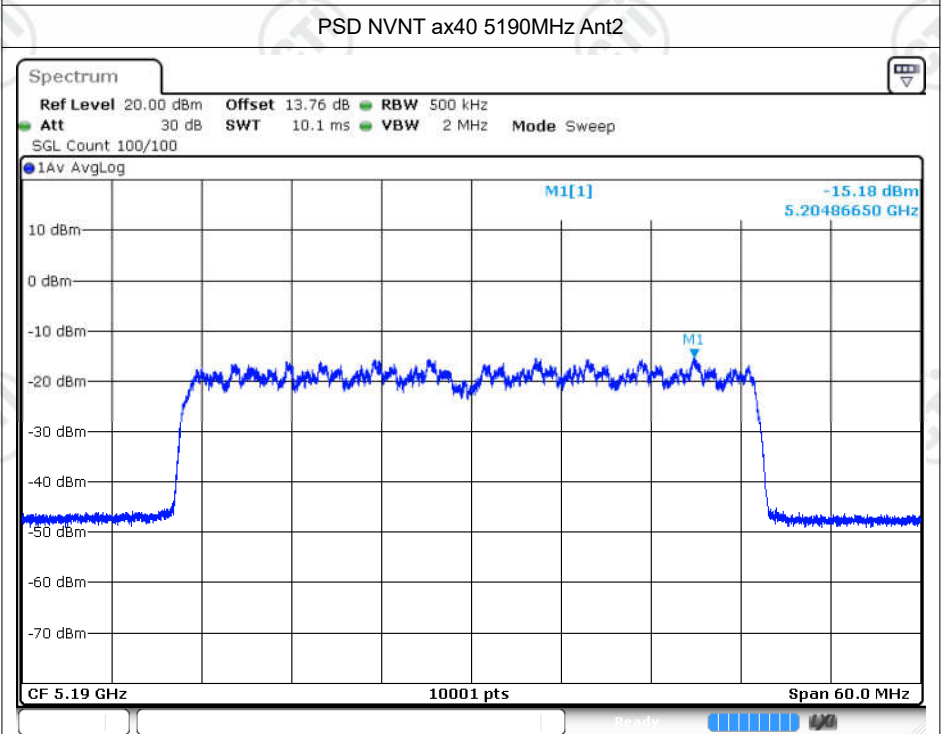


Date: 28.MAR.2023 10:51:04

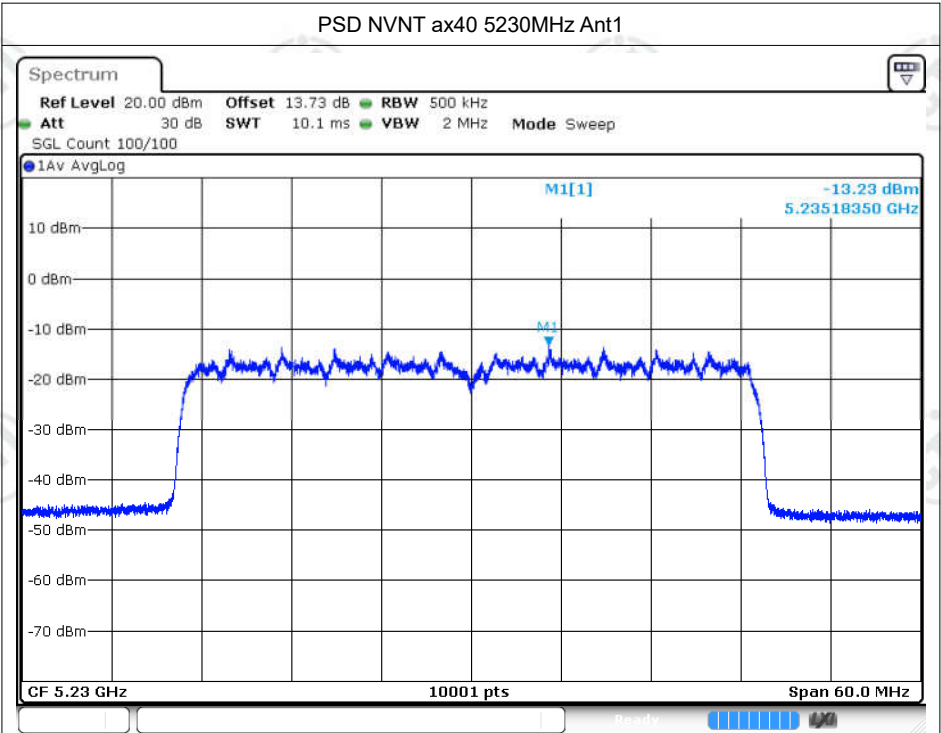


Date: 28.MAR.2023 10:51:33

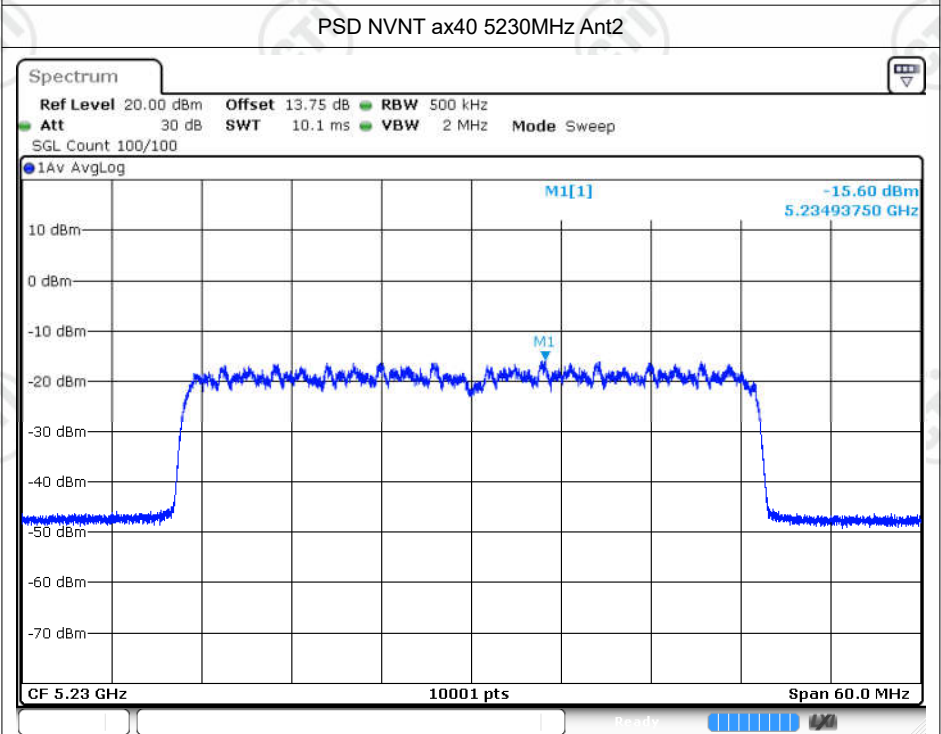


Date: 28.MAR.2023 10:51:37

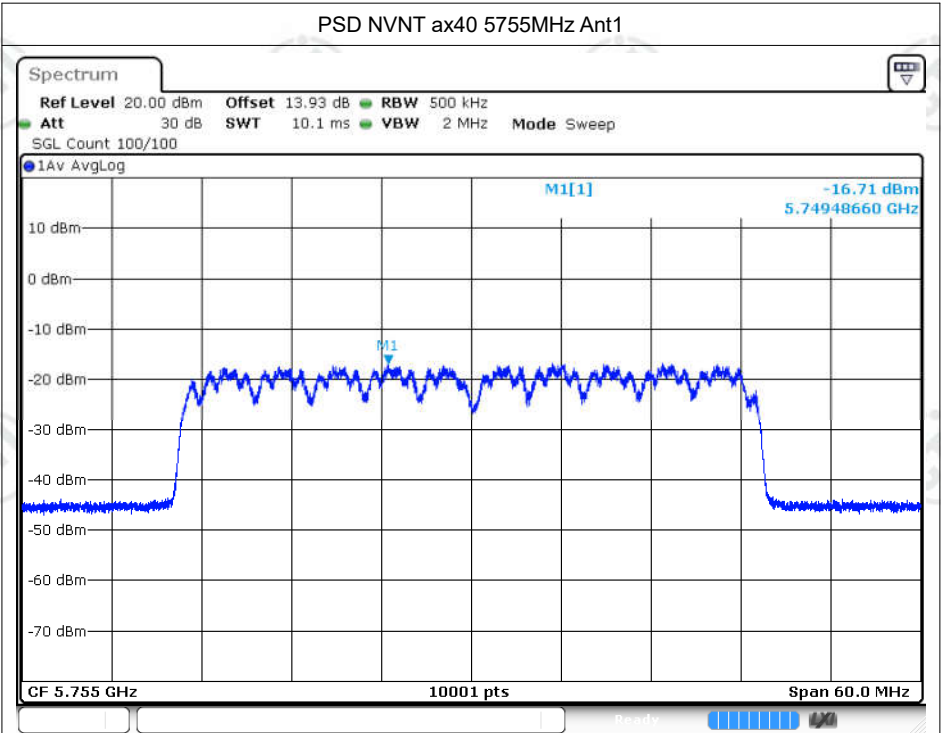


Date: 28.MAR.2023 10:54:46

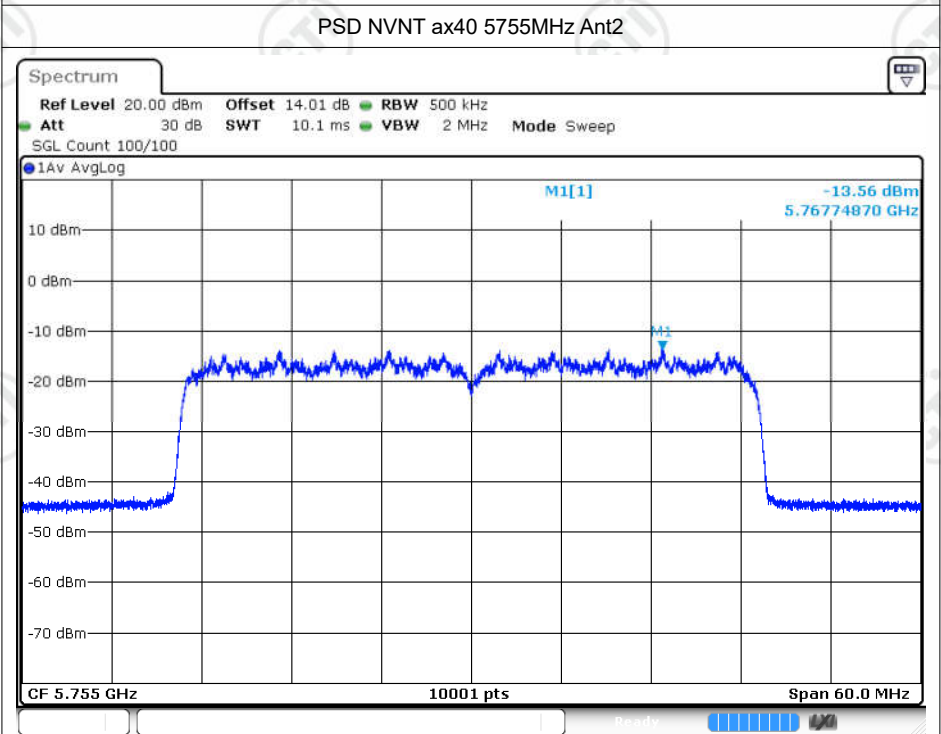


Date: 28.MAR.2023 10:54:49

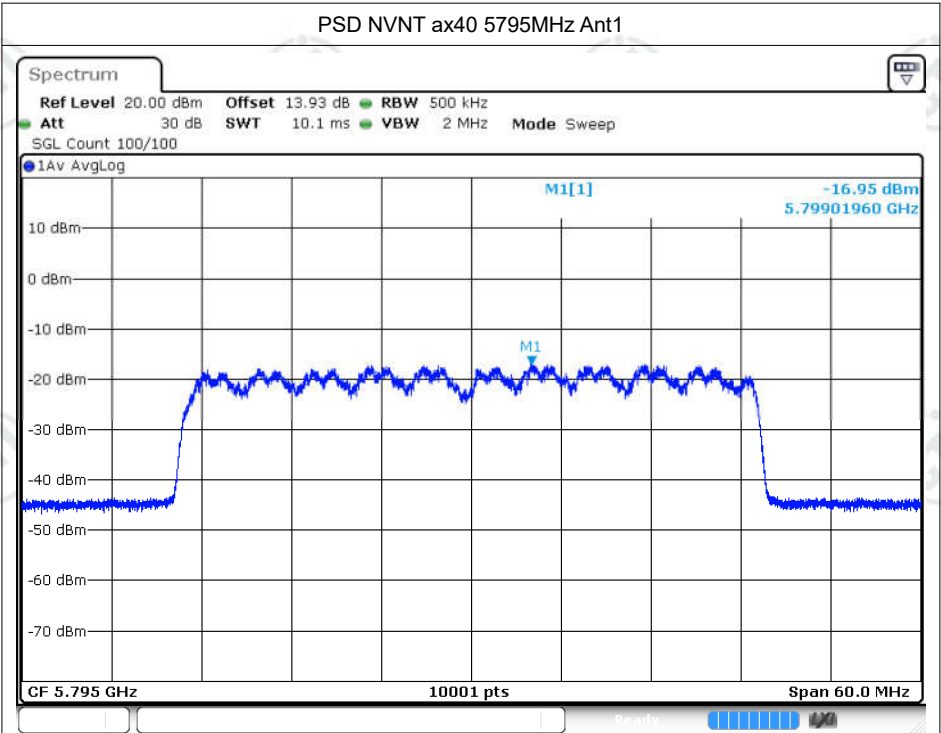


Date: 28.MAR.2023 10:55:42

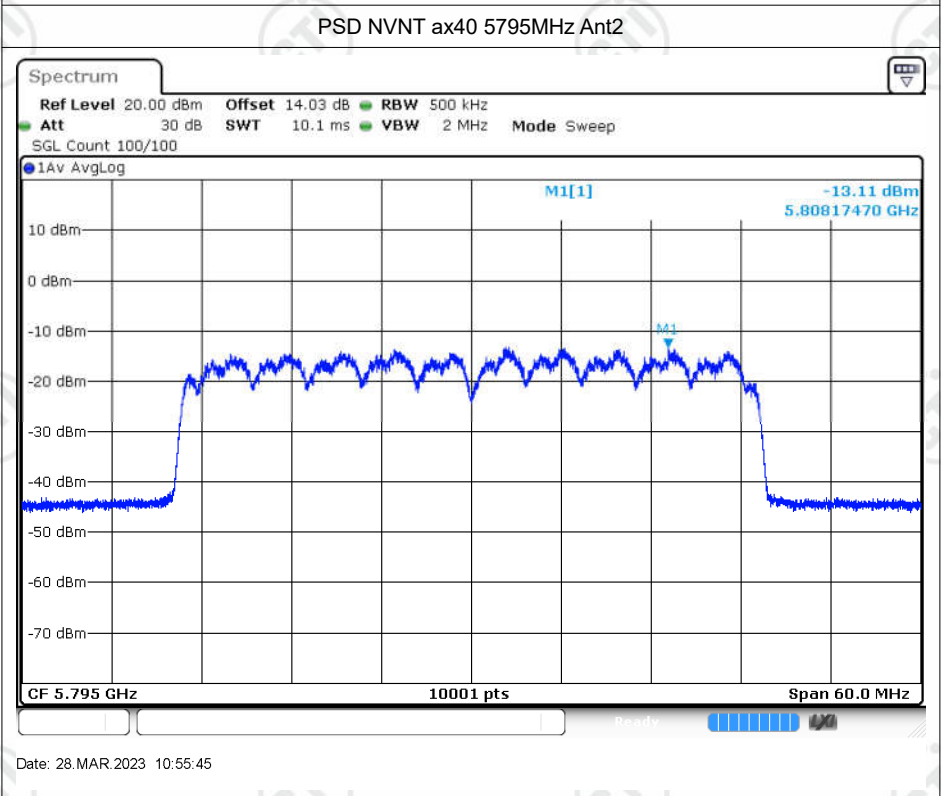



Date: 28.MAR.2023 10:55:45

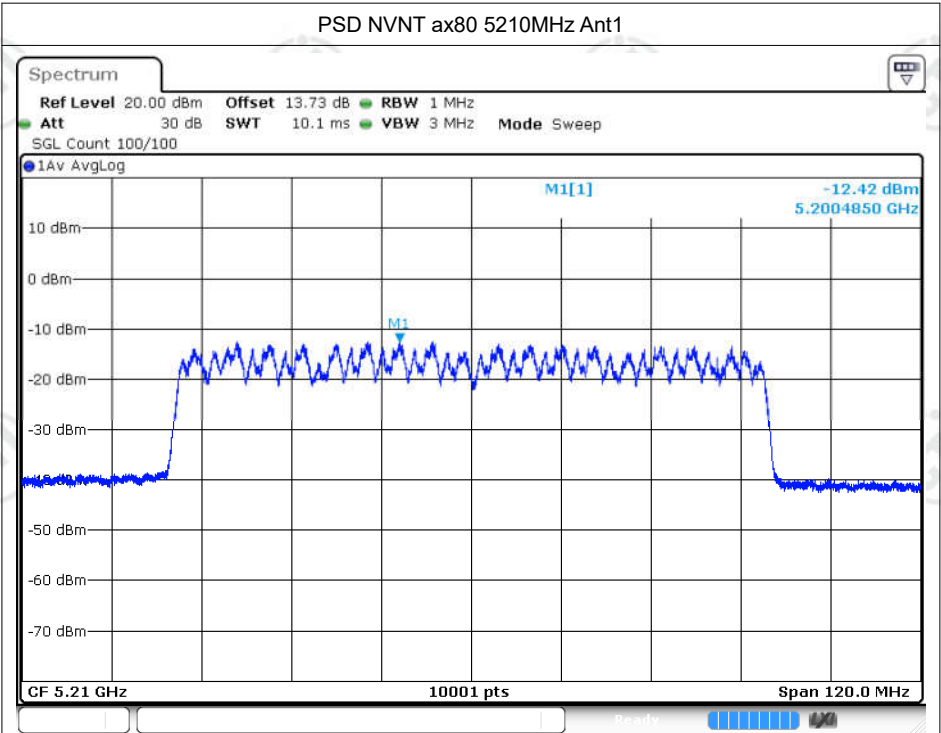


Date: 27. MAR 2023 17:04:59

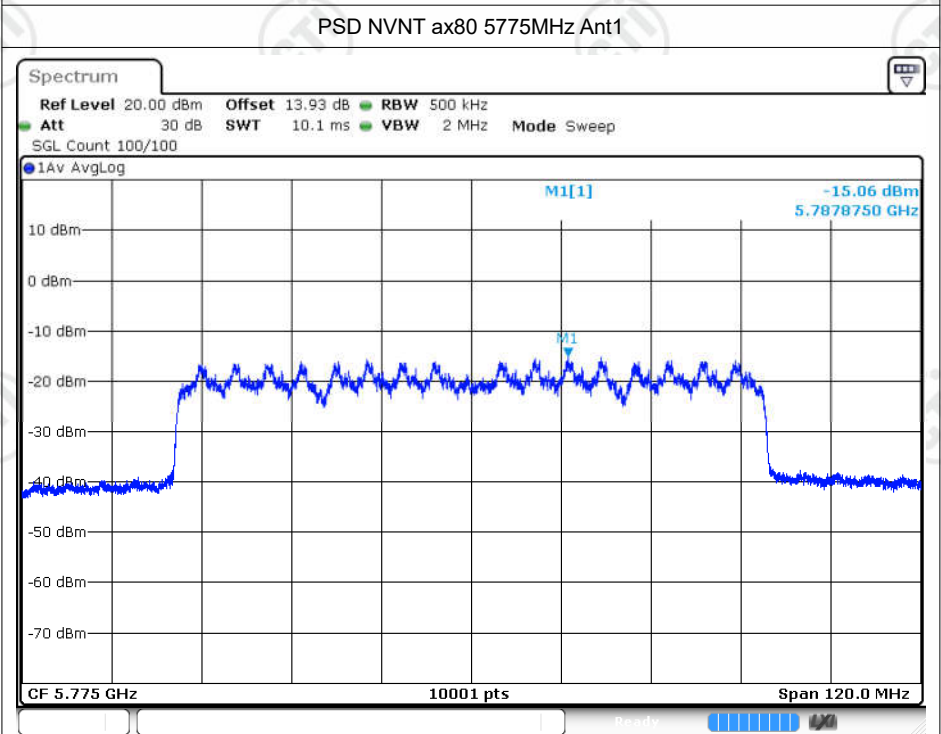


Date: 27. MAR 2023 17:10:33

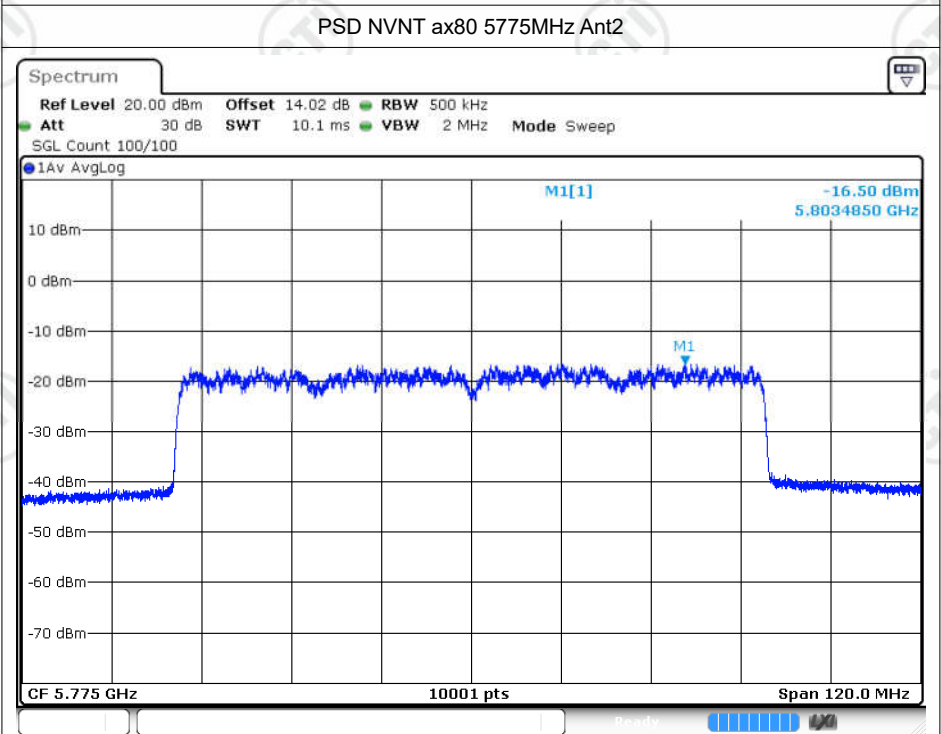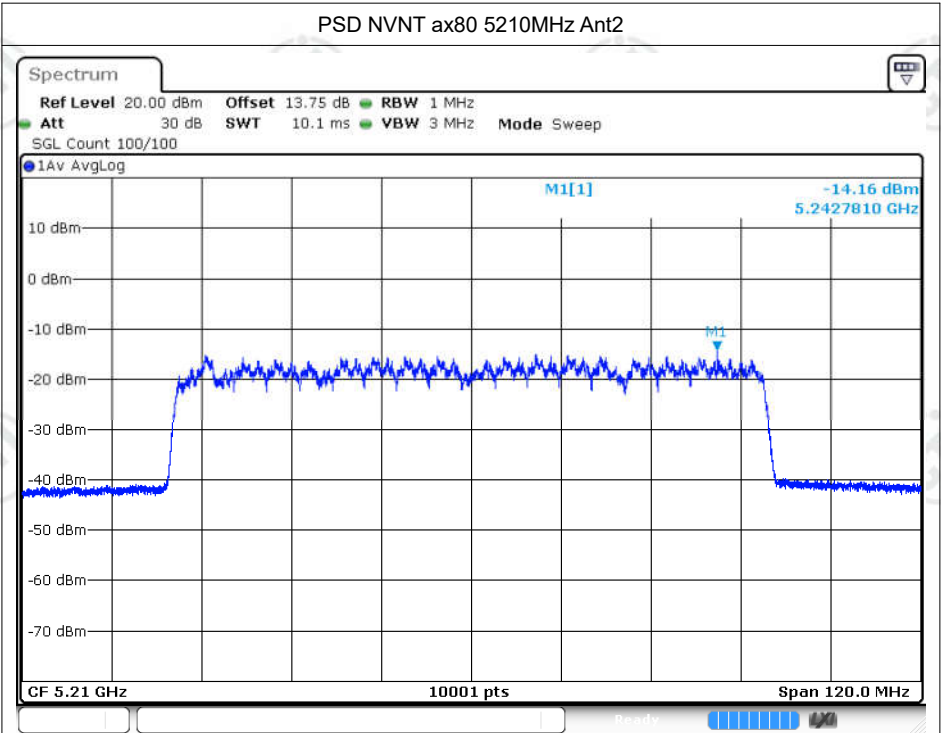


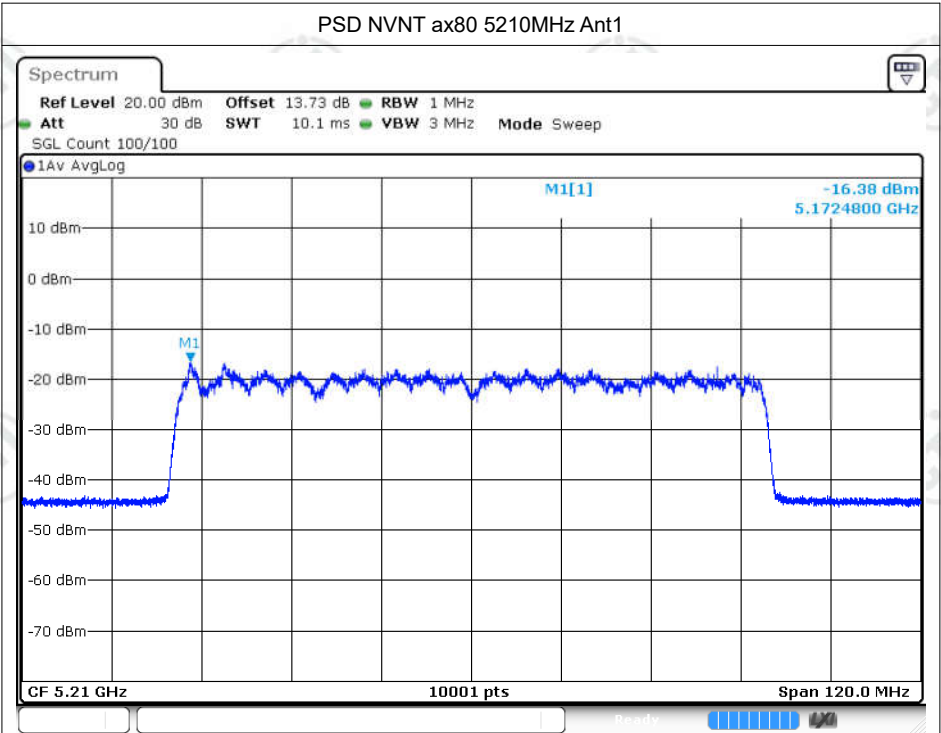


Date: 28.MAR.2023 10:57:13

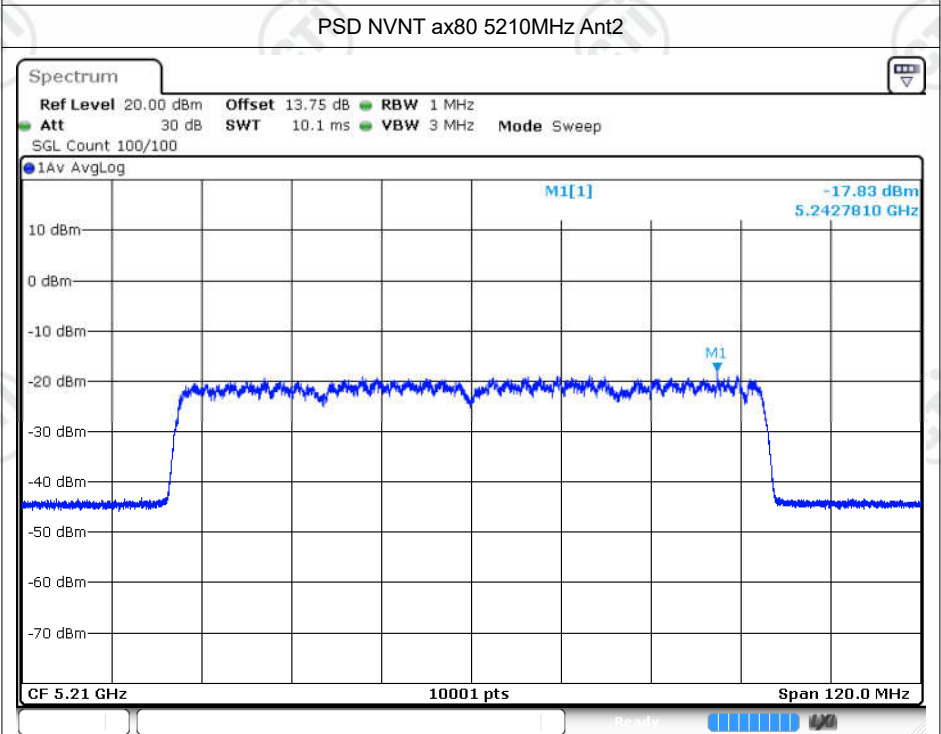

Date: 28.MAR.2023 10:57:17

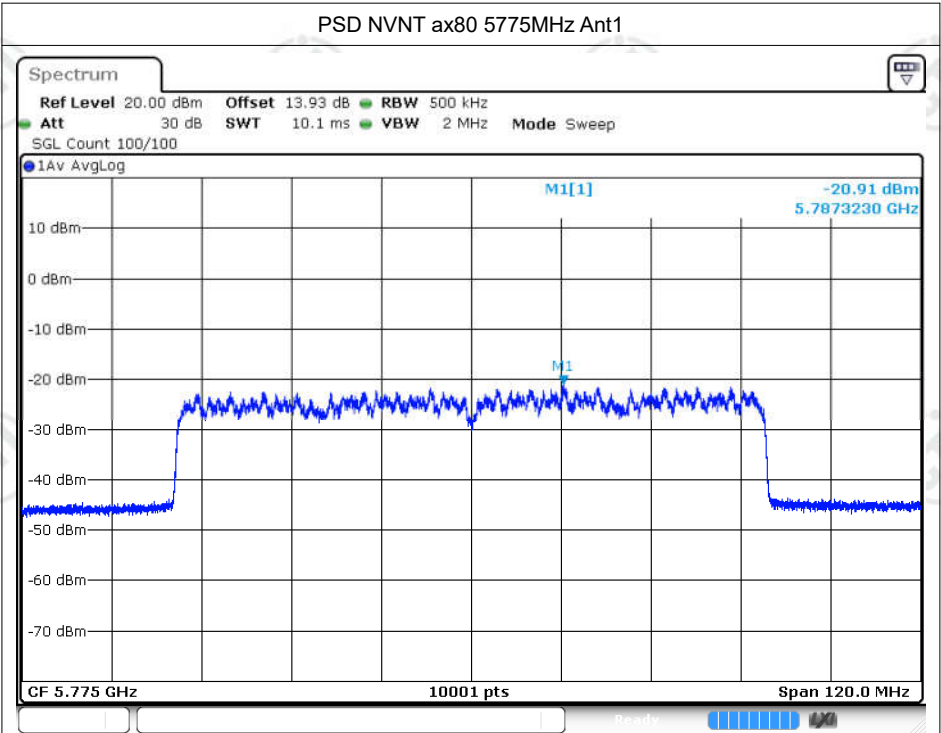

Date: 28.MAR.2023 10:58:04

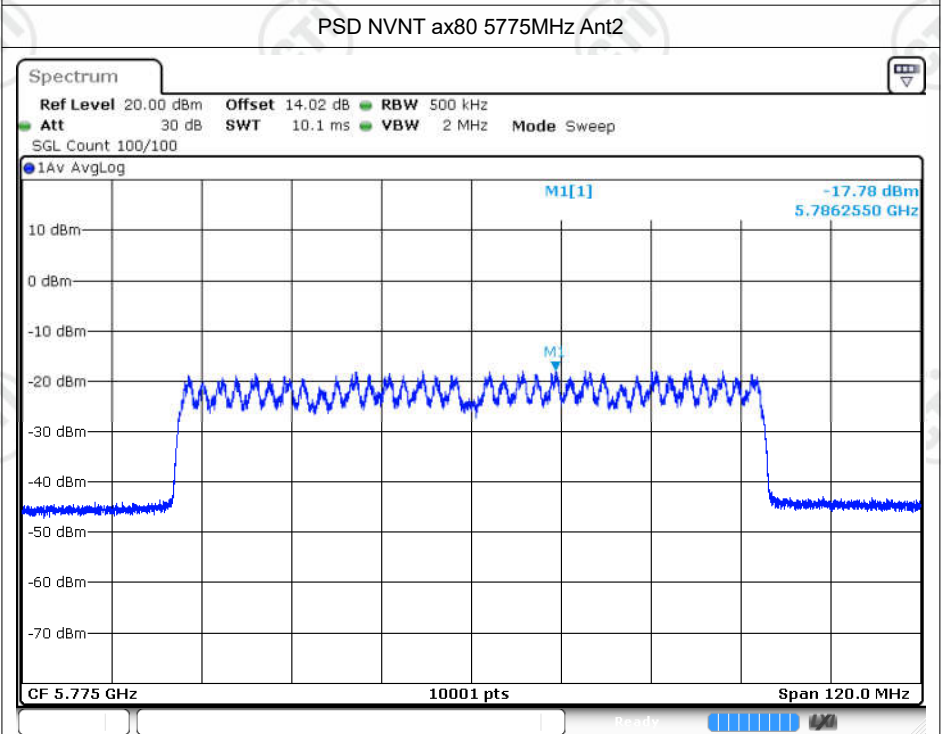

Date: 28.MAR.2023 10:58:07

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5180	Ant1	5179.92	-80000	-15.44	25	Pass
20C 120V	a	5180	Ant1	5179.9	-100000	-19.31	25	Pass
20C 138V	a	5180	Ant1	5179.94	-60000	-11.58	25	Pass
-20C 120V	a	5180	Ant1	5179.92	-80000	-15.44	25	Pass
-10C 120V	a	5180	Ant1	5179.92	-80000	-15.44	25	Pass
0C 120V	a	5180	Ant1	5179.92	-80000	-15.44	25	Pass
10C 120V	a	5180	Ant1	5179.94	-60000	-11.58	25	Pass
30C 120V	a	5180	Ant1	5179.92	-80000	-15.44	25	Pass
40C 120V	a	5180	Ant1	5179.92	-80000	-15.44	25	Pass
50C 120V	a	5180	Ant1	5179.94	-60000	-11.58	25	Pass
20C 102V	a	5240	Ant1	5239.92	-80000	-15.27	25	Pass
20C 120V	a	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 138V	a	5240	Ant1	5239.92	-80000	-15.27	25	Pass
-20C 120V	a	5240	Ant1	5239.92	-80000	-15.27	25	Pass
-10C 120V	a	5240	Ant1	5239.94	-60000	-11.45	25	Pass
0C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
10C 120V	a	5240	Ant1	5239.92	-80000	-15.27	25	Pass
30C 120V	a	5240	Ant1	5239.94	-60000	-11.45	25	Pass
40C 120V	a	5240	Ant1	5239.94	-60000	-11.45	25	Pass
50C 120V	a	5240	Ant1	5239.92	-80000	-15.27	25	Pass
20C 102V	a	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 120V	a	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 138V	a	5745	Ant1	5744.92	-80000	-13.93	25	Pass
-20C 120V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
-10C 120V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
0C 120V	a	5745	Ant1	5744.92	-80000	-13.93	25	Pass
10C 120V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
30C 120V	a	5745	Ant1	5744.94	-60000	-10.44	25	Pass
40C 120V	a	5745	Ant1	5744.92	-80000	-13.93	25	Pass
50C 120V	a	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 102V	a	5825	Ant1	5824.92	-80000	-13.73	25	Pass
20C 120V	a	5825	Ant1	5824.9	-100000	-17.17	25	Pass
20C 138V	a	5825	Ant1	5824.94	-60000	-10.3	25	Pass
-20C 120V	a	5825	Ant1	5824.92	-80000	-13.73	25	Pass
-10C 120V	a	5825	Ant1	5824.94	-60000	-10.3	25	Pass
0C 120V	a	5825	Ant1	5824.94	-60000	-10.3	25	Pass
10C 120V	a	5825	Ant1	5824.9	-100000	-17.17	25	Pass

30C 120V	a	5825	Ant1	5824.92	-80000	-13.73	25	Pass
40C 120V	a	5825	Ant1	5824.92	-80000	-13.73	25	Pass
50C 120V	a	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 102V	a	5180	Ant2	5179.94	-60000	-11.58	25	Pass
20C 120V	a	5180	Ant2	5179.92	-80000	-15.44	25	Pass
20C 138V	a	5180	Ant2	5179.94	-60000	-11.58	25	Pass
-20C 120V	a	5180	Ant2	5179.92	-80000	-15.44	25	Pass
-10C 120V	a	5180	Ant2	5179.92	-80000	-15.44	25	Pass
0C 120V	a	5180	Ant2	5179.92	-80000	-15.44	25	Pass
10C 120V	a	5180	Ant2	5179.94	-60000	-11.58	25	Pass
30C 120V	a	5180	Ant2	5179.94	-60000	-11.58	25	Pass
40C 120V	a	5180	Ant2	5179.96	-40000	-7.72	25	Pass
50C 120V	a	5180	Ant2	5179.94	-60000	-11.58	25	Pass
20C 102V	a	5240	Ant2	5239.94	-60000	-11.45	25	Pass
20C 120V	a	5240	Ant2	5239.94	-60000	-11.45	25	Pass
20C 138V	a	5240	Ant2	5239.92	-80000	-15.27	25	Pass
-20C 120V	a	5240	Ant2	5239.94	-60000	-11.45	25	Pass
-10C 120V	a	5240	Ant2	5239.94	-60000	-11.45	25	Pass
0C 120V	a	5240	Ant2	5239.96	-40000	-7.63	25	Pass
10C 120V	a	5240	Ant2	5239.94	-60000	-11.45	25	Pass
30C 120V	a	5240	Ant2	5239.94	-60000	-11.45	25	Pass
40C 120V	a	5240	Ant2	5239.94	-60000	-11.45	25	Pass
50C 120V	a	5240	Ant2	5239.92	-80000	-15.27	25	Pass
20C 102V	a	5745	Ant2	5744.92	-80000	-13.93	25	Pass
20C 120V	a	5745	Ant2	5744.92	-80000	-13.93	25	Pass
20C 138V	a	5745	Ant2	5744.92	-80000	-13.93	25	Pass
-20C 120V	a	5745	Ant2	5744.92	-80000	-13.93	25	Pass
-10C 120V	a	5745	Ant2	5744.92	-80000	-13.93	25	Pass
0C 120V	a	5745	Ant2	5744.92	-80000	-13.93	25	Pass
10C 120V	a	5745	Ant2	5744.94	-60000	-10.44	25	Pass
30C 120V	a	5745	Ant2	5744.92	-80000	-13.93	25	Pass
40C 120V	a	5745	Ant2	5744.9	-100000	-17.41	25	Pass
50C 120V	a	5745	Ant2	5744.92	-80000	-13.93	25	Pass
20C 102V	a	5825	Ant2	5824.94	-60000	-10.3	25	Pass
20C 120V	a	5825	Ant2	5824.9	-100000	-17.17	25	Pass
20C 138V	a	5825	Ant2	5824.92	-80000	-13.73	25	Pass
-20C 120V	a	5825	Ant2	5824.92	-80000	-13.73	25	Pass
-10C 120V	a	5825	Ant2	5824.92	-80000	-13.73	25	Pass
0C 120V	a	5825	Ant2	5824.94	-60000	-10.3	25	Pass
10C 120V	a	5825	Ant2	5824.92	-80000	-13.73	25	Pass
30C 120V	a	5825	Ant2	5824.92	-80000	-13.73	25	Pass
40C 120V	a	5825	Ant2	5824.9	-100000	-17.17	25	Pass

50C 120V	a	5825	Ant2	5824.92	-80000	-13.73	25	Pass
20C 102V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 120V	n20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
20C 138V	n20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
-20C 120V	n20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
-10C 120V	n20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
0C 120V	n20	5180	Ant1	5179.92	-80000	-15.44	25	Pass
10C 120V	n20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
30C 120V	n20	5180	Ant1	5179.92	-80000	-15.44	25	Pass
40C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
50C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 102V	n20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 120V	n20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 138V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
-20C 120V	n20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
-10C 120V	n20	5240	Ant1	5239.92	-80000	-15.27	25	Pass
0C 120V	n20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
10C 120V	n20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
30C 120V	n20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
40C 120V	n20	5240	Ant1	5239.92	-80000	-15.27	25	Pass
50C 120V	n20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 102V	n20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 120V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 138V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
-20C 120V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
-10C 120V	n20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
0C 120V	n20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
10C 120V	n20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
30C 120V	n20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
40C 120V	n20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
50C 120V	n20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 102V	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 120V	n20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 138V	n20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
-20C 120V	n20	5825	Ant1	5824.9	-100000	-17.17	25	Pass
-10C 120V	n20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
0C 120V	n20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
10C 120V	n20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
30C 120V	n20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
40C 120V	n20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
50C 120V	n20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 102V	n20	5180	Ant2	5179.92	-80000	-15.44	25	Pass

20C 120V	n20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
20C 138V	n20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
-20C 120V	n20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
-10C 120V	n20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
0C 120V	n20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
10C 120V	n20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
30C 120V	n20	5180	Ant2	5179.92	-80000	-15.44	25	Pass
40C 120V	n20	5180	Ant2	5179.92	-80000	-15.44	25	Pass
50C 120V	n20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
20C 102V	n20	5240	Ant2	5239.92	-80000	-15.27	25	Pass
20C 120V	n20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
20C 138V	n20	5240	Ant2	5239.92	-80000	-15.27	25	Pass
-20C 120V	n20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
-10C 120V	n20	5240	Ant2	5239.92	-80000	-15.27	25	Pass
0C 120V	n20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
10C 120V	n20	5240	Ant2	5239.96	-40000	-7.63	25	Pass
30C 120V	n20	5240	Ant2	5239.92	-80000	-15.27	25	Pass
40C 120V	n20	5240	Ant2	5239.96	-40000	-7.63	25	Pass
50C 120V	n20	5240	Ant2	5239.92	-80000	-15.27	25	Pass
20C 102V	n20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
20C 120V	n20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
20C 138V	n20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
-20C 120V	n20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
-10C 120V	n20	5745	Ant2	5744.94	-60000	-10.44	25	Pass
0C 120V	n20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
10C 120V	n20	5745	Ant2	5744.94	-60000	-10.44	25	Pass
30C 120V	n20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
40C 120V	n20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
50C 120V	n20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
20C 102V	n20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
20C 120V	n20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
20C 138V	n20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
-20C 120V	n20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
-10C 120V	n20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
0C 120V	n20	5825	Ant2	5824.96	-40000	-6.87	25	Pass
10C 120V	n20	5825	Ant2	5824.96	-40000	-6.87	25	Pass
30C 120V	n20	5825	Ant2	5824.94	-60000	-10.3	25	Pass
40C 120V	n20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
50C 120V	n20	5825	Ant2	5824.94	-60000	-10.3	25	Pass
20C 102V	n40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
20C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 138V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass

-20C 120V	n40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
-10C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
0C 120V	n40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
10C 120V	n40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
30C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
40C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
50C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 102V	n40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
20C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 138V	n40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
-20C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-10C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
0C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
10C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
30C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
40C 120V	n40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
50C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 102V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
20C 120V	n40	5755	Ant1	5754.88	-120000	-20.85	25	Pass
20C 138V	n40	5755	Ant1	5754.88	-120000	-20.85	25	Pass
-20C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
0C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
10C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
30C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
40C 120V	n40	5755	Ant1	5754.88	-120000	-20.85	25	Pass
50C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
20C 102V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 138V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
-20C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-10C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
0C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
10C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
30C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
40C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
50C 120V	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 102V	n40	5190	Ant2	5189.92	-80000	-15.41	25	Pass
20C 120V	n40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
20C 138V	n40	5190	Ant2	5189.92	-80000	-15.41	25	Pass
-20C 120V	n40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
-10C 120V	n40	5190	Ant2	5189.92	-80000	-15.41	25	Pass

0C 120V	n40	5190	Ant2	5189.92	-80000	-15.41	25	Pass
10C 120V	n40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
30C 120V	n40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
40C 120V	n40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
50C 120V	n40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
20C 102V	n40	5230	Ant2	5229.92	-80000	-15.3	25	Pass
20C 120V	n40	5230	Ant2	5229.92	-80000	-15.3	25	Pass
20C 138V	n40	5230	Ant2	5229.92	-80000	-15.3	25	Pass
-20C 120V	n40	5230	Ant2	5229.92	-80000	-15.3	25	Pass
-10C 120V	n40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
0C 120V	n40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
10C 120V	n40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
30C 120V	n40	5230	Ant2	5229.92	-80000	-15.3	25	Pass
40C 120V	n40	5230	Ant2	5229.92	-80000	-15.3	25	Pass
50C 120V	n40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 102V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
20C 120V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
20C 138V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
-20C 120V	n40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
-10C 120V	n40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
0C 120V	n40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
10C 120V	n40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
30C 120V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
40C 120V	n40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
50C 120V	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
20C 102V	n40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
20C 120V	n40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
20C 138V	n40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
-20C 120V	n40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
-10C 120V	n40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
0C 120V	n40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
10C 120V	n40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
30C 120V	n40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
40C 120V	n40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
50C 120V	n40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 102V	ac20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
20C 120V	ac20	5180	Ant1	5179.92	-80000	-15.44	25	Pass
20C 138V	ac20	5180	Ant1	5179.92	-80000	-15.44	25	Pass
-20C 120V	ac20	5180	Ant1	5179.92	-80000	-15.44	25	Pass
-10C 120V	ac20	5180	Ant1	5179.92	-80000	-15.44	25	Pass
0C 120V	ac20	5180	Ant1	5179.92	-80000	-15.44	25	Pass
10C 120V	ac20	5180	Ant1	5179.94	-60000	-11.58	25	Pass

30C 120V	ac20	5180	Ant1	5179.92	-80000	-15.44	25	Pass
40C 120V	ac20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
50C 120V	ac20	5180	Ant1	5179.92	-80000	-15.44	25	Pass
20C 102V	ac20	5240	Ant1	5239.9	-100000	-19.08	25	Pass
20C 120V	ac20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 138V	ac20	5240	Ant1	5239.92	-80000	-15.27	25	Pass
-20C 120V	ac20	5240	Ant1	5239.92	-80000	-15.27	25	Pass
-10C 120V	ac20	5240	Ant1	5239.92	-80000	-15.27	25	Pass
0C 120V	ac20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
10C 120V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
30C 120V	ac20	5240	Ant1	5239.9	-100000	-19.08	25	Pass
40C 120V	ac20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
50C 120V	ac20	5240	Ant1	5239.92	-80000	-15.27	25	Pass
20C 102V	ac20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 120V	ac20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 138V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
-20C 120V	ac20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
-10C 120V	ac20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
0C 120V	ac20	5745	Ant1	5744.9	-100000	-17.41	25	Pass
10C 120V	ac20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
30C 120V	ac20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
40C 120V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
50C 120V	ac20	5745	Ant1	5744.94	-60000	-10.44	25	Pass
20C 102V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 120V	ac20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 138V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-20C 120V	ac20	5825	Ant1	5824.9	-100000	-17.17	25	Pass
-10C 120V	ac20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
0C 120V	ac20	5825	Ant1	5824.9	-100000	-17.17	25	Pass
10C 120V	ac20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
30C 120V	ac20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
40C 120V	ac20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
50C 120V	ac20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
20C 102V	ac20	5180	Ant2	5179.9	-100000	-19.31	25	Pass
20C 120V	ac20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
20C 138V	ac20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
-20C 120V	ac20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
-10C 120V	ac20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
0C 120V	ac20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
10C 120V	ac20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
30C 120V	ac20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
40C 120V	ac20	5180	Ant2	5179.92	-80000	-15.44	25	Pass

50C 120V	ac20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
20C 102V	ac20	5240	Ant2	5239.96	-40000	-7.63	25	Pass
20C 120V	ac20	5240	Ant2	5239.96	-40000	-7.63	25	Pass
20C 138V	ac20	5240	Ant2	5239.92	-80000	-15.27	25	Pass
-20C 120V	ac20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
-10C 120V	ac20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
0C 120V	ac20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
10C 120V	ac20	5240	Ant2	5239.96	-40000	-7.63	25	Pass
30C 120V	ac20	5240	Ant2	5239.96	-40000	-7.63	25	Pass
40C 120V	ac20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
50C 120V	ac20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
20C 102V	ac20	5745	Ant2	5744.94	-60000	-10.44	25	Pass
20C 120V	ac20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
20C 138V	ac20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
-20C 120V	ac20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
-10C 120V	ac20	5745	Ant2	5744.94	-60000	-10.44	25	Pass
0C 120V	ac20	5745	Ant2	5744.94	-60000	-10.44	25	Pass
10C 120V	ac20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
30C 120V	ac20	5745	Ant2	5744.94	-60000	-10.44	25	Pass
40C 120V	ac20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
50C 120V	ac20	5745	Ant2	5744.94	-60000	-10.44	25	Pass
20C 102V	ac20	5825	Ant2	5824.96	-40000	-6.87	25	Pass
20C 120V	ac20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
20C 138V	ac20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
-20C 120V	ac20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
-10C 120V	ac20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
0C 120V	ac20	5825	Ant2	5824.94	-60000	-10.3	25	Pass
10C 120V	ac20	5825	Ant2	5824.94	-60000	-10.3	25	Pass
30C 120V	ac20	5825	Ant2	5824.96	-40000	-6.87	25	Pass
40C 120V	ac20	5825	Ant2	5824.9	-100000	-17.17	25	Pass
50C 120V	ac20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
20C 102V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
20C 138V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-20C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
-10C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
0C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
10C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
30C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
40C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
50C 120V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
20C 102V	ac40	5230	Ant1	5229.92	-80000	-15.3	25	Pass

20C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 138V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-20C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-10C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
0C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
10C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
30C 120V	ac40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
40C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
50C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 102V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 138V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
-20C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
-10C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
0C 120V	ac40	5755	Ant1	5754.88	-120000	-20.85	25	Pass
10C 120V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
30C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
40C 120V	ac40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
50C 120V	ac40	5755	Ant1	5754.88	-120000	-20.85	25	Pass
20C 102V	ac40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 120V	ac40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 138V	ac40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
-20C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-10C 120V	ac40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
0C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
10C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
30C 120V	ac40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
40C 120V	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
50C 120V	ac40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 102V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
20C 120V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
20C 138V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
-20C 120V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
-10C 120V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
0C 120V	ac40	5190	Ant2	5189.92	-80000	-15.41	25	Pass
10C 120V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
30C 120V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
40C 120V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
50C 120V	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
20C 102V	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 120V	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 138V	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass

-20C 120V	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
-10C 120V	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
0C 120V	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
10C 120V	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
30C 120V	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
40C 120V	ac40	5230	Ant2	5229.92	-80000	-15.3	25	Pass
50C 120V	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 102V	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
20C 120V	ac40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
20C 138V	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
-20C 120V	ac40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
-10C 120V	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
0C 120V	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
10C 120V	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
30C 120V	ac40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
40C 120V	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
50C 120V	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
20C 102V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 138V	ac40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
-20C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
-10C 120V	ac40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
0C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
10C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
30C 120V	ac40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
40C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
50C 120V	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 102V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
20C 120V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
20C 138V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
-20C 120V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
-10C 120V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
0C 120V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
10C 120V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
30C 120V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
40C 120V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
50C 120V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
20C 102V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 138V	ac80	5775	Ant1	5775	0	0	25	Pass
-20C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
-10C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass

0C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
10C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
30C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
40C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
50C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 102V	ac80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
20C 120V	ac80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
20C 138V	ac80	5210	Ant2	5210	0	0	25	Pass
-20C 120V	ac80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
-10C 120V	ac80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
0C 120V	ac80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
10C 120V	ac80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
30C 120V	ac80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
40C 120V	ac80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
50C 120V	ac80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
20C 102V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
20C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
20C 138V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
-20C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
-10C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
0C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
10C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
30C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
40C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
50C 120V	ac80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
20C 102V	ax20	5180	Ant1	5179.92	-80000	-15.44	25	Pass
20C 120V	ax20	5180	Ant1	5179.92	-80000	-15.44	25	Pass
20C 138V	ax20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
-20C 120V	ax20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
-10C 120V	ax20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
0C 120V	ax20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
10C 120V	ax20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
30C 120V	ax20	5180	Ant1	5179.92	-80000	-15.44	25	Pass
40C 120V	ax20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
50C 120V	ax20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
20C 102V	ax20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 120V	ax20	5240	Ant1	5239.92	-80000	-15.27	25	Pass
20C 138V	ax20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
-20C 120V	ax20	5240	Ant1	5239.92	-80000	-15.27	25	Pass
-10C 120V	ax20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
0C 120V	ax20	5240	Ant1	5239.92	-80000	-15.27	25	Pass
10C 120V	ax20	5240	Ant1	5239.94	-60000	-11.45	25	Pass


30C 120V	ax20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
40C 120V	ax20	5240	Ant1	5239.92	-80000	-15.27	25	Pass
50C 120V	ax20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
20C 102V	ax20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 120V	ax20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 138V	ax20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
-20C 120V	ax20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
-10C 120V	ax20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
0C 120V	ax20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
10C 120V	ax20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
30C 120V	ax20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
40C 120V	ax20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
50C 120V	ax20	5745	Ant1	5744.92	-80000	-13.93	25	Pass
20C 102V	ax20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
20C 120V	ax20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
20C 138V	ax20	5825	Ant1	5824.9	-100000	-17.17	25	Pass
-20C 120V	ax20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
-10C 120V	ax20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
0C 120V	ax20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
10C 120V	ax20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
30C 120V	ax20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
40C 120V	ax20	5825	Ant1	5824.94	-60000	-10.3	25	Pass
50C 120V	ax20	5825	Ant1	5824.92	-80000	-13.73	25	Pass
20C 102V	ax20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
20C 120V	ax20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
20C 138V	ax20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
-20C 120V	ax20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
-10C 120V	ax20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
0C 120V	ax20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
10C 120V	ax20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
30C 120V	ax20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
40C 120V	ax20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
50C 120V	ax20	5180	Ant2	5179.94	-60000	-11.58	25	Pass
20C 102V	ax20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
20C 120V	ax20	5240	Ant2	5239.92	-80000	-15.27	25	Pass
20C 138V	ax20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
-20C 120V	ax20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
-10C 120V	ax20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
0C 120V	ax20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
10C 120V	ax20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
30C 120V	ax20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
40C 120V	ax20	5240	Ant2	5239.96	-40000	-7.63	25	Pass

50C 120V	ax20	5240	Ant2	5239.94	-60000	-11.45	25	Pass
20C 102V	ax20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
20C 120V	ax20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
20C 138V	ax20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
-20C 120V	ax20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
-10C 120V	ax20	5745	Ant2	5744.94	-60000	-10.44	25	Pass
0C 120V	ax20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
10C 120V	ax20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
30C 120V	ax20	5745	Ant2	5744.94	-60000	-10.44	25	Pass
40C 120V	ax20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
50C 120V	ax20	5745	Ant2	5744.92	-80000	-13.93	25	Pass
20C 102V	ax20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
20C 120V	ax20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
20C 138V	ax20	5825	Ant2	5824.94	-60000	-10.3	25	Pass
-20C 120V	ax20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
-10C 120V	ax20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
0C 120V	ax20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
10C 120V	ax20	5825	Ant2	5824.92	-80000	-13.73	25	Pass
30C 120V	ax20	5825	Ant2	5824.94	-60000	-10.3	25	Pass
40C 120V	ax20	5825	Ant2	5824.94	-60000	-10.3	25	Pass
50C 120V	ax20	5825	Ant2	5824.86	-140000	-24.03	25	Pass
20C 102V	ax40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
20C 120V	ax40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 138V	ax40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-20C 120V	ax40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
-10C 120V	ax40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
0C 120V	ax40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
10C 120V	ax40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
30C 120V	ax40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
40C 120V	ax40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
50C 120V	ax40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
20C 102V	ax40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
20C 120V	ax40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 138V	ax40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-20C 120V	ax40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-10C 120V	ax40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
0C 120V	ax40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
10C 120V	ax40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
30C 120V	ax40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
40C 120V	ax40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
50C 120V	ax40	5230	Ant1	5229.92	-80000	-15.3	25	Pass
20C 102V	ax40	5755	Ant1	5754.96	-40000	-6.95	25	Pass


20C 120V	ax40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
20C 138V	ax40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
-20C 120V	ax40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
-10C 120V	ax40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
0C 120V	ax40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
10C 120V	ax40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
30C 120V	ax40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
40C 120V	ax40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
50C 120V	ax40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
20C 102V	ax40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 120V	ax40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
20C 138V	ax40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-20C 120V	ax40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
-10C 120V	ax40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
0C 120V	ax40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
10C 120V	ax40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
30C 120V	ax40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
40C 120V	ax40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
50C 120V	ax40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 102V	ax40	5190	Ant2	5189.92	-80000	-15.41	25	Pass
20C 120V	ax40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
20C 138V	ax40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
-20C 120V	ax40	5190	Ant2	5189.92	-80000	-15.41	25	Pass
-10C 120V	ax40	5190	Ant2	5189.92	-80000	-15.41	25	Pass
0C 120V	ax40	5190	Ant2	5189.92	-80000	-15.41	25	Pass
10C 120V	ax40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
30C 120V	ax40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
40C 120V	ax40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
50C 120V	ax40	5190	Ant2	5189.92	-80000	-15.41	25	Pass
20C 102V	ax40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 120V	ax40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 138V	ax40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
-20C 120V	ax40	5230	Ant2	5229.92	-80000	-15.3	25	Pass
-10C 120V	ax40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
0C 120V	ax40	5230	Ant2	5229.92	-80000	-15.3	25	Pass
10C 120V	ax40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
30C 120V	ax40	5230	Ant2	5229.92	-80000	-15.3	25	Pass
40C 120V	ax40	5230	Ant2	5229.92	-80000	-15.3	25	Pass
50C 120V	ax40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 102V	ax40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
20C 120V	ax40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
20C 138V	ax40	5755	Ant2	5754.92	-80000	-13.9	25	Pass

-20C 120V	ax40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
-10C 120V	ax40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
0C 120V	ax40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
10C 120V	ax40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
30C 120V	ax40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
40C 120V	ax40	5755	Ant2	5754.92	-80000	-13.9	25	Pass
50C 120V	ax40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
20C 102V	ax40	5795	Ant2	5795	0	0	25	Pass
20C 120V	ax40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
20C 138V	ax40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
-20C 120V	ax40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
-10C 120V	ax40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
0C 120V	ax40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
10C 120V	ax40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
30C 120V	ax40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
40C 120V	ax40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
50C 120V	ax40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
20C 102V	ax80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
20C 120V	ax80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
20C 138V	ax80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
-20C 120V	ax80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
-10C 120V	ax80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
0C 120V	ax80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
10C 120V	ax80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
30C 120V	ax80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
40C 120V	ax80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
50C 120V	ax80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
20C 102V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 138V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
-20C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
-10C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
0C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
10C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
30C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
40C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
50C 120V	ax80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 102V	ax80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
20C 120V	ax80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
20C 138V	ax80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
-20C 120V	ax80	5210	Ant2	5210	0	0	25	Pass
-10C 120V	ax80	5210	Ant2	5209.92	-80000	-15.36	25	Pass


0C 120V	ax80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
10C 120V	ax80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
30C 120V	ax80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
40C 120V	ax80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
50C 120V	ax80	5210	Ant2	5209.92	-80000	-15.36	25	Pass
20C 102V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
20C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
20C 138V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
-20C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
-10C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
0C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
10C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
30C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
40C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass
50C 120V	ax80	5775	Ant2	5774.92	-80000	-13.85	25	Pass

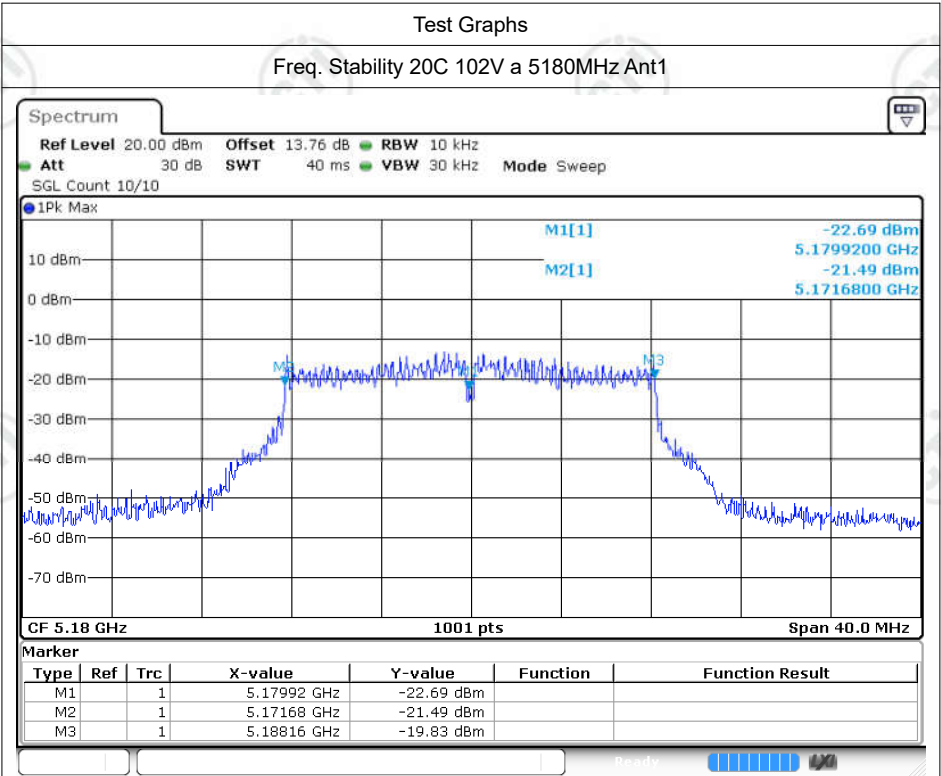


Date: 27.MAR.2023 10:48:39

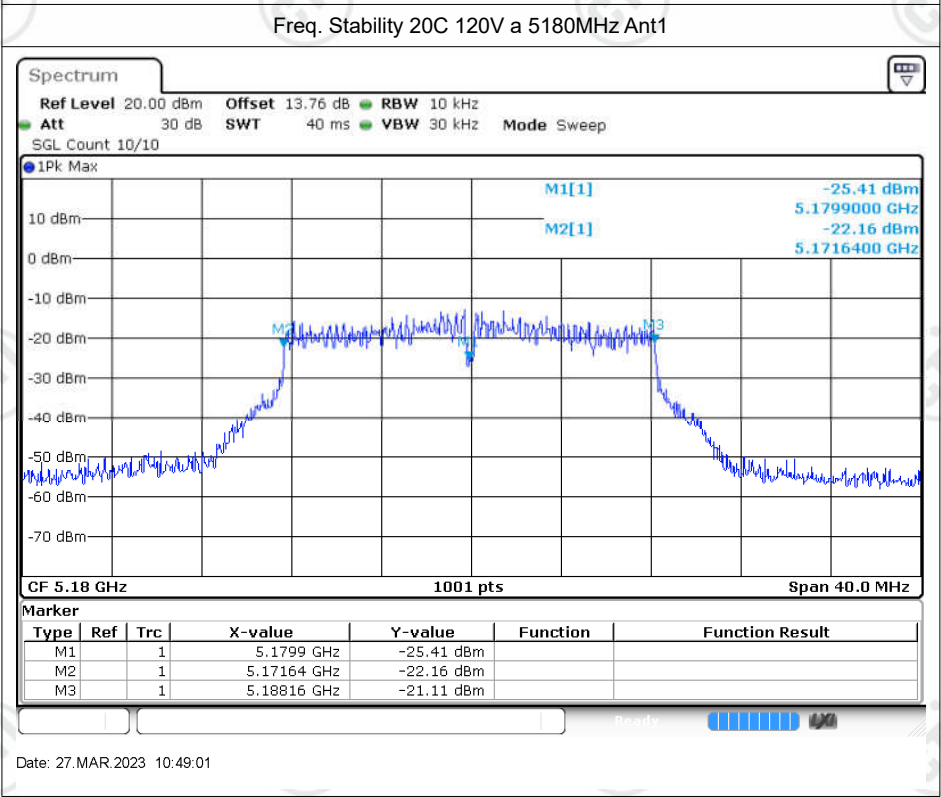


Date: 27.MAR.2023 10:49:01

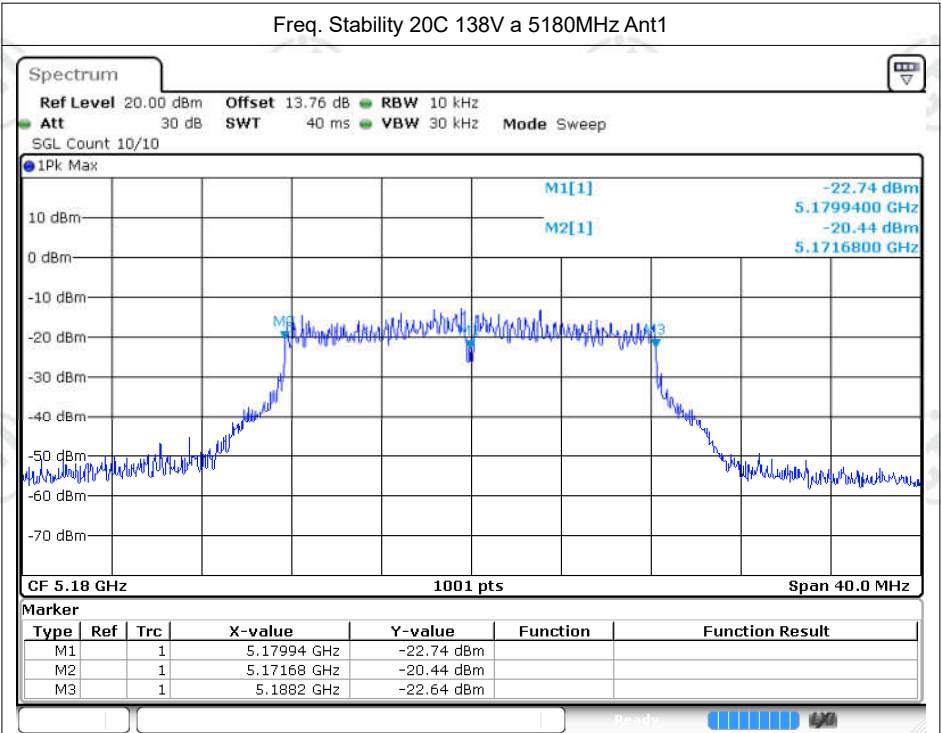


Date: 27. MAR 2023 10:48:45

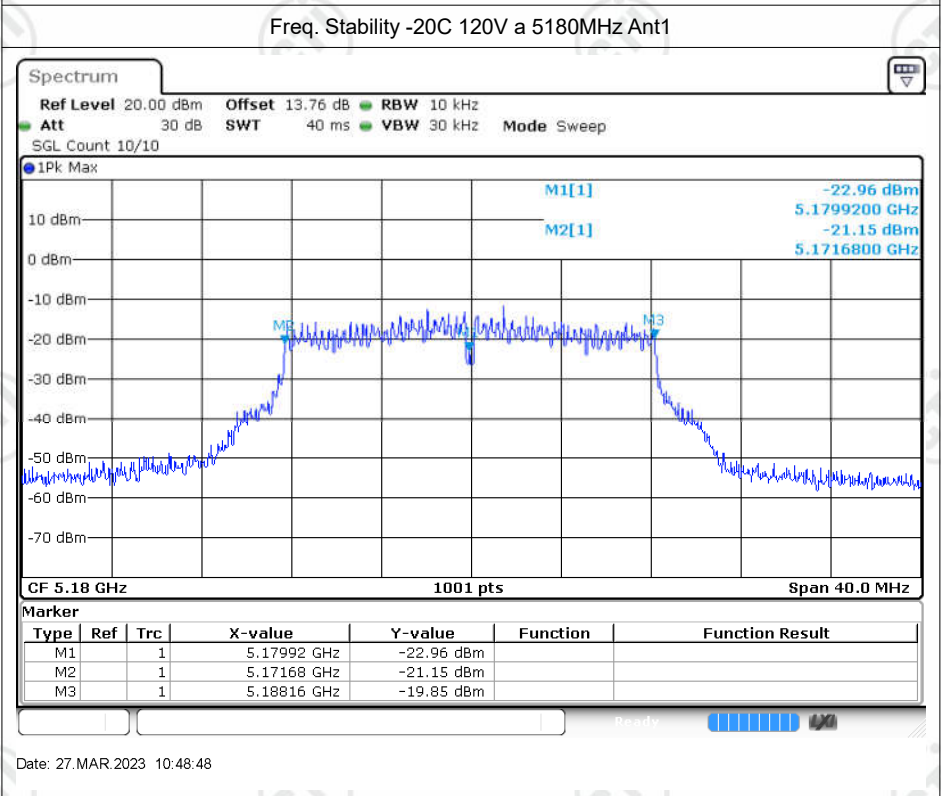


Date: 27. MAR 2023 10:48:48

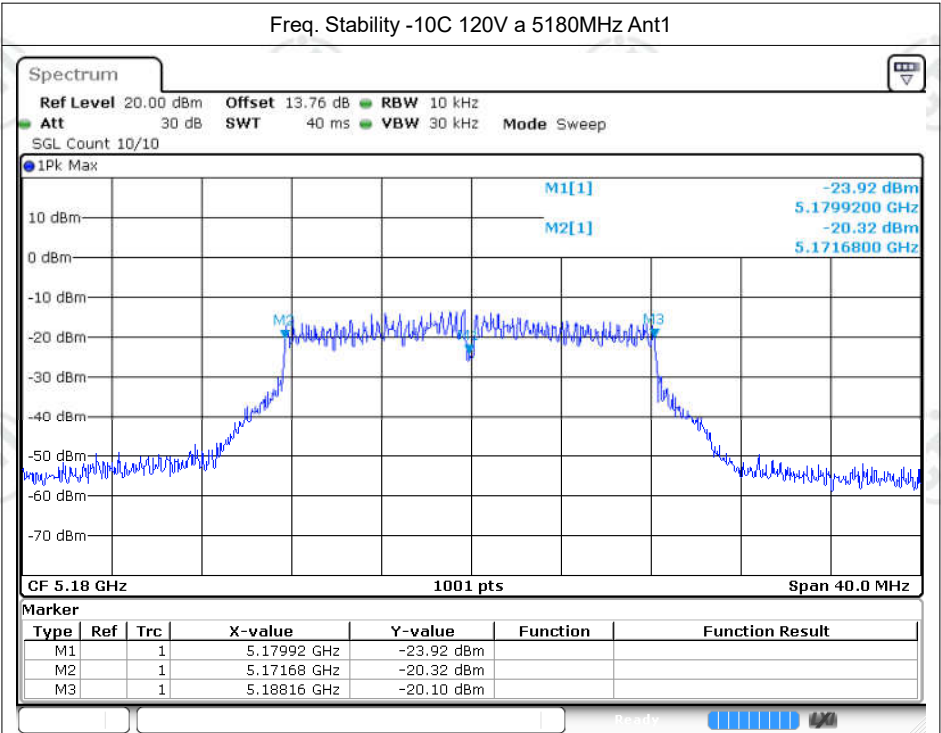


Date: 27. MAR 2023 10:48:51

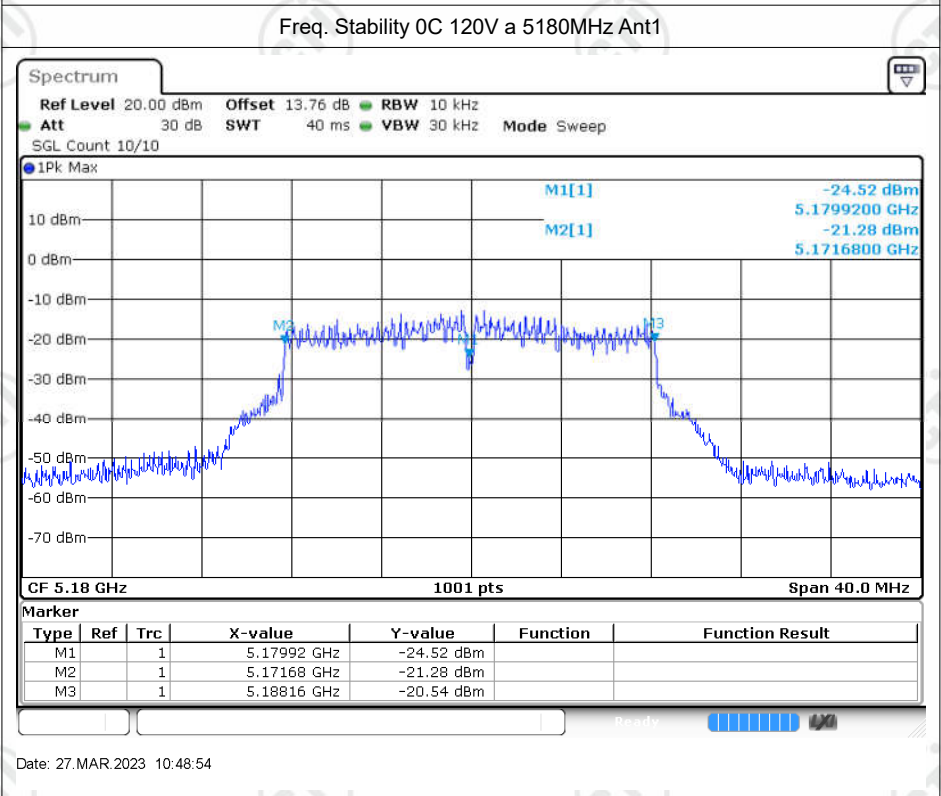


Date: 27. MAR 2023 10:48:54

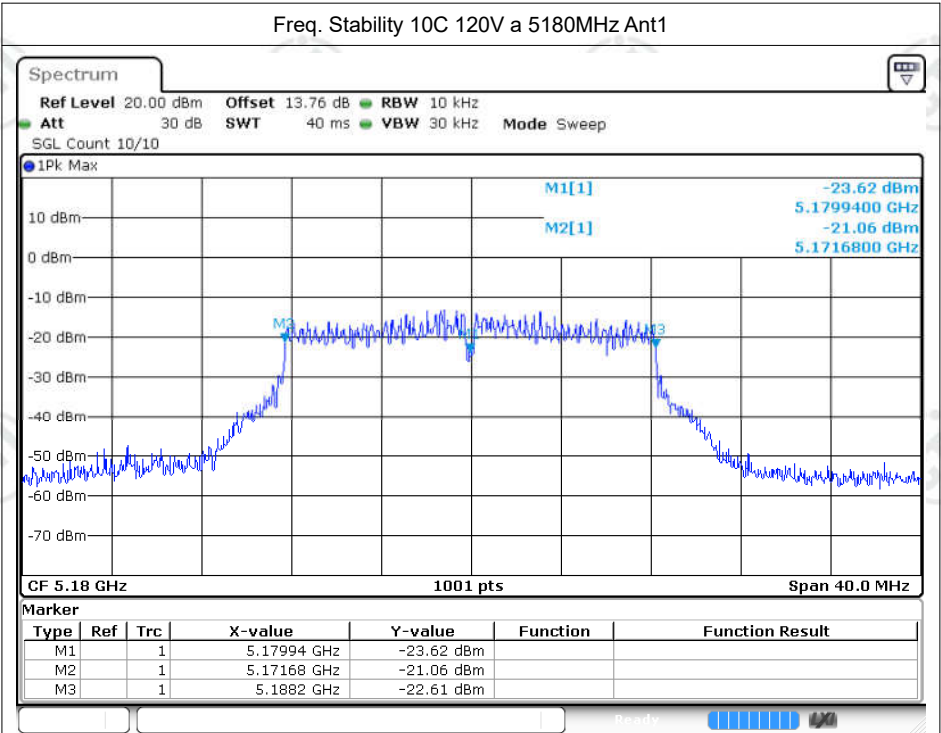


Date: 27. MAR 2023 10:48:58

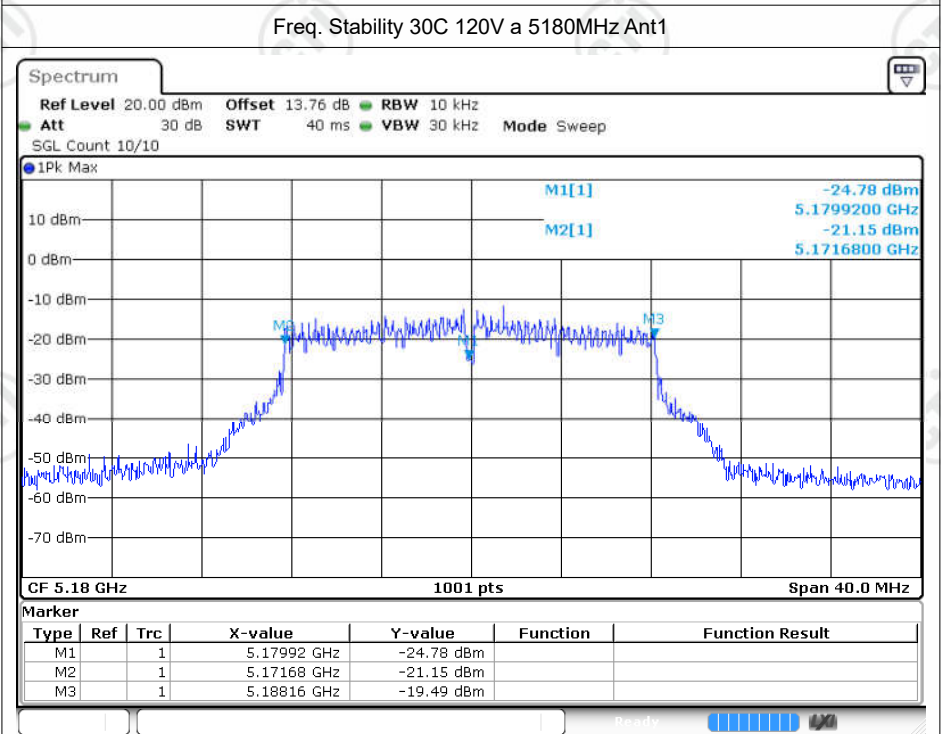


Date: 27. MAR 2023 10:49:04

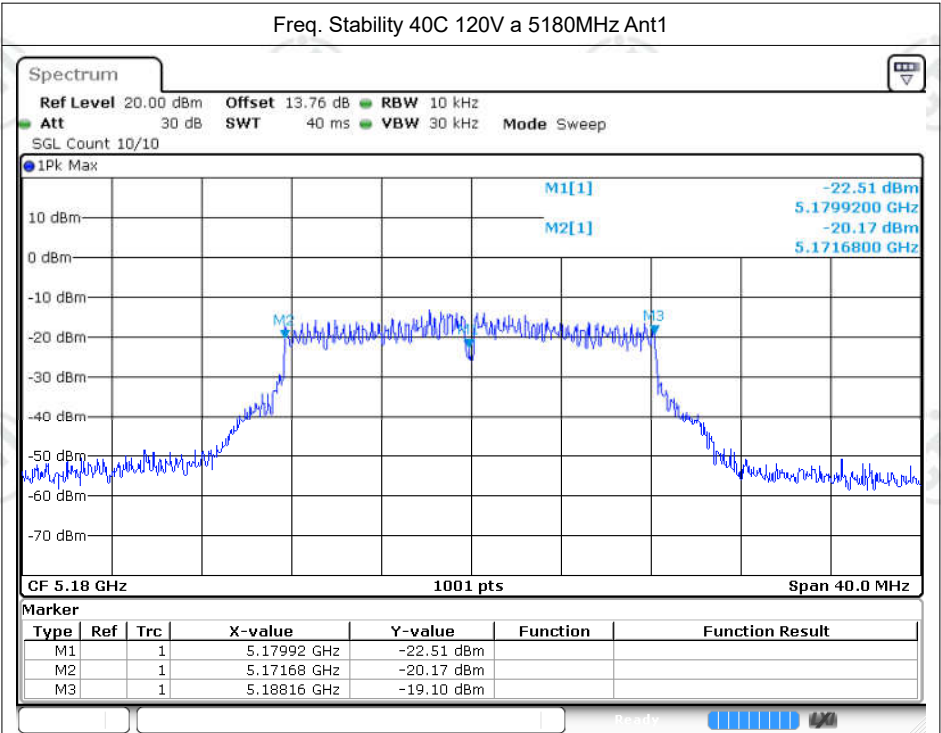


Date: 27. MAR 2023 10:49:07

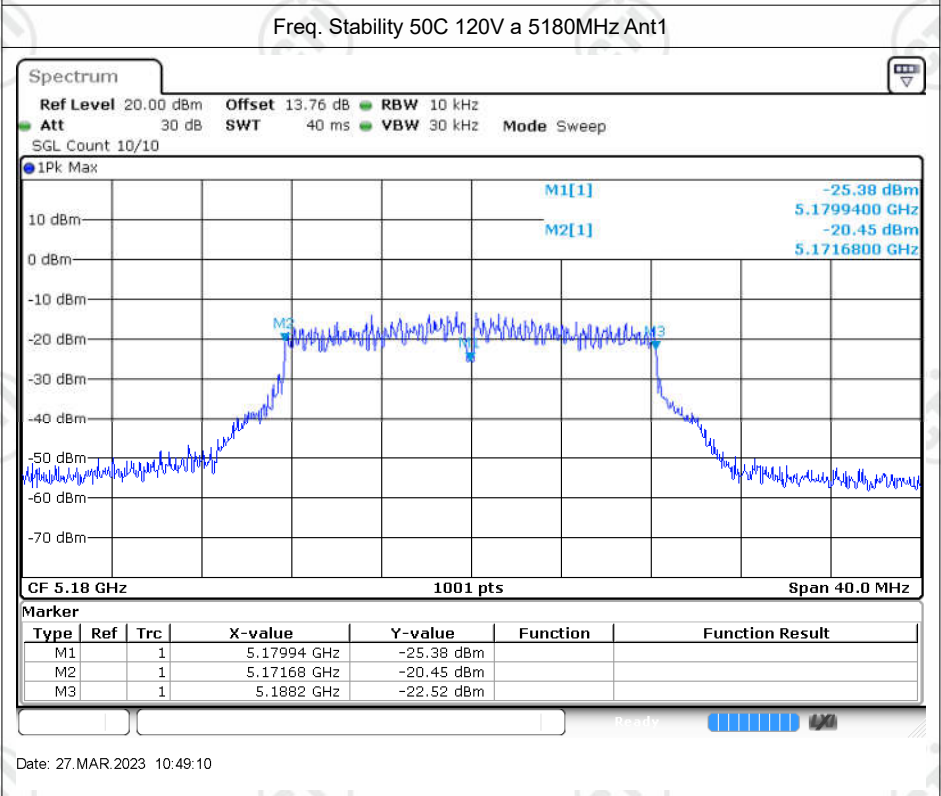


Date: 27. MAR 2023 10:49:10

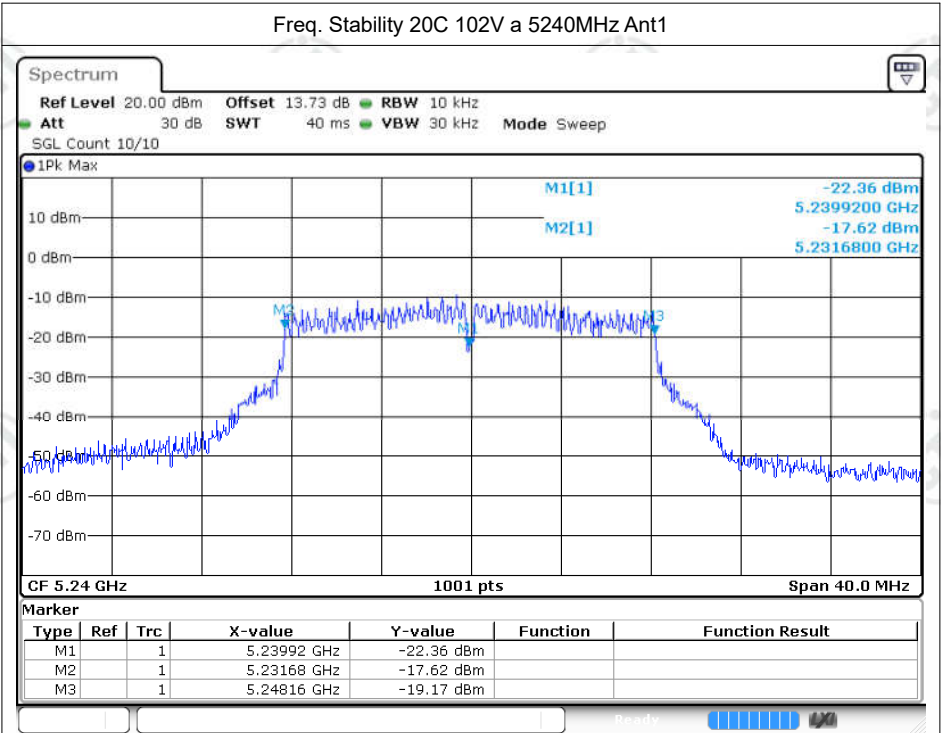


Date: 27. MAR. 2023 14:05:45

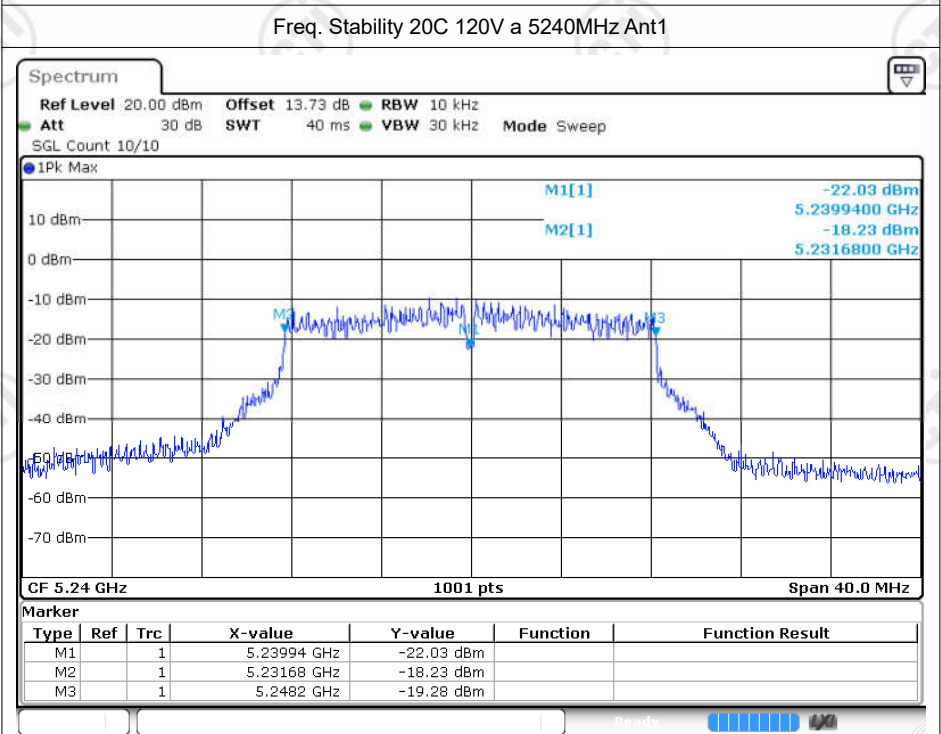


Date: 27. MAR. 2023 14:06:07

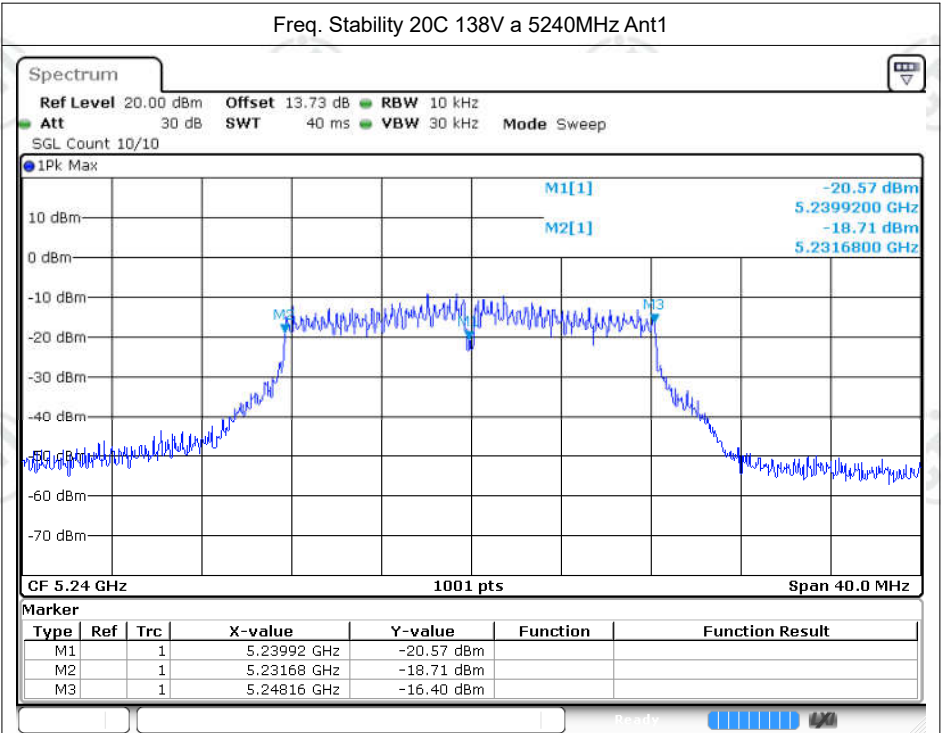


Date: 27. MAR 2023 14:05:52

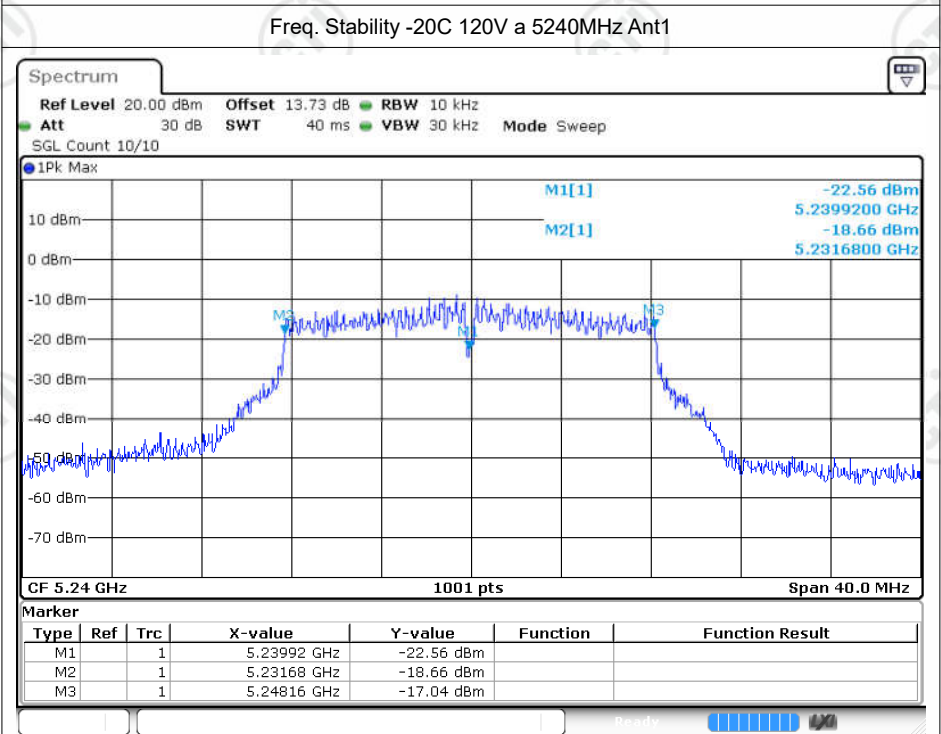


Date: 27. MAR 2023 14:05:55

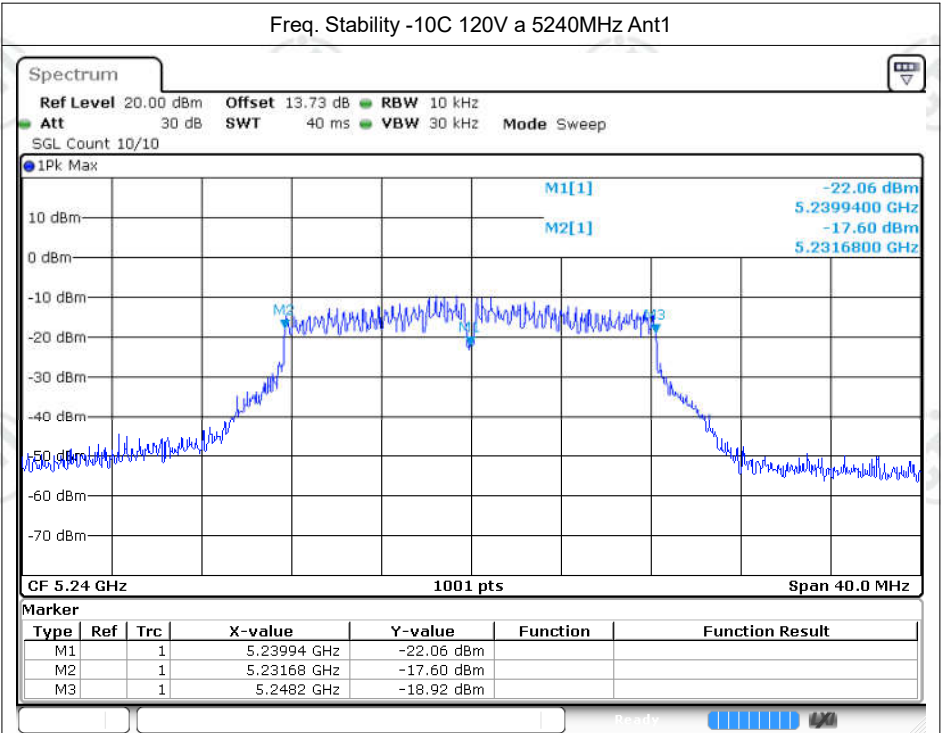


Date: 27. MAR 2023 14:05:58

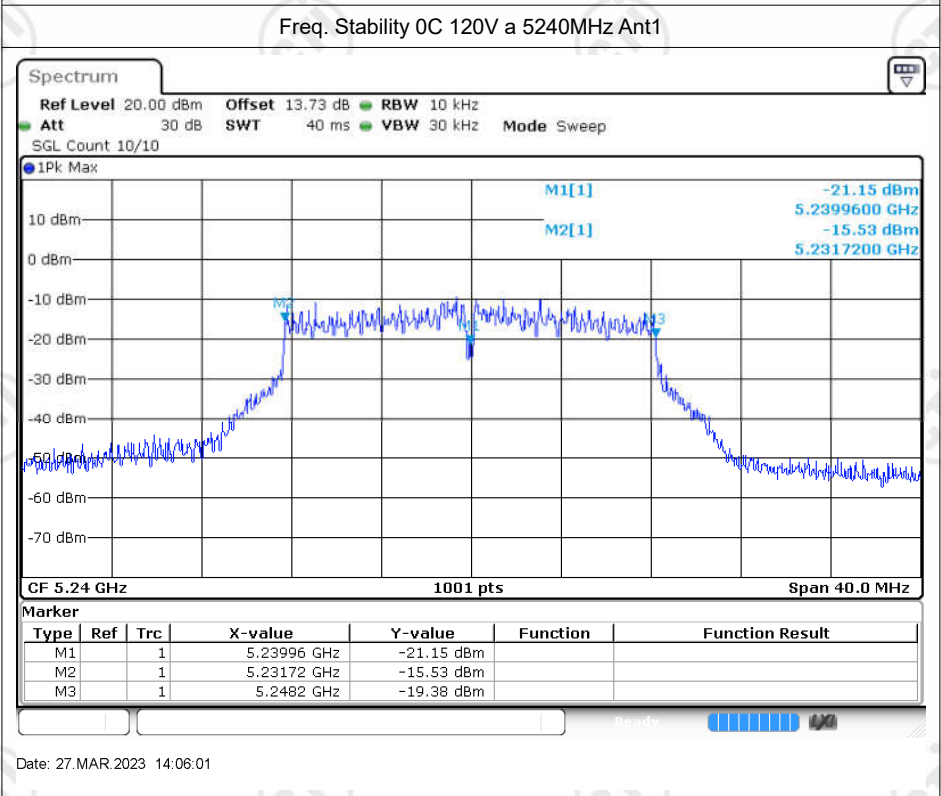


Date: 27. MAR 2023 14:06:01

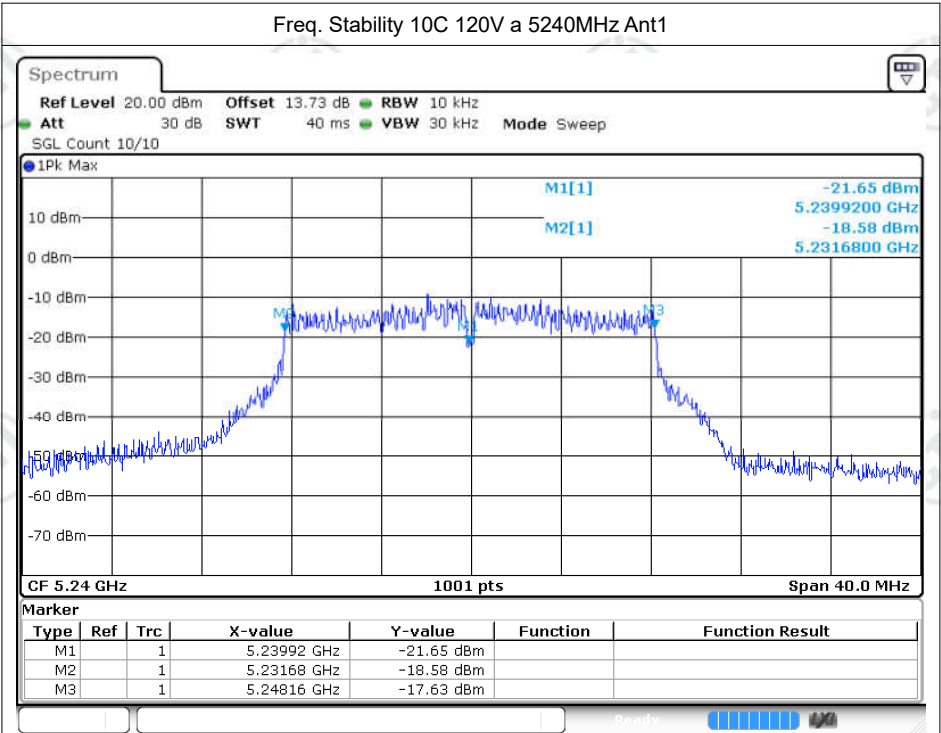


Date: 27. MAR 2023 14:06:04

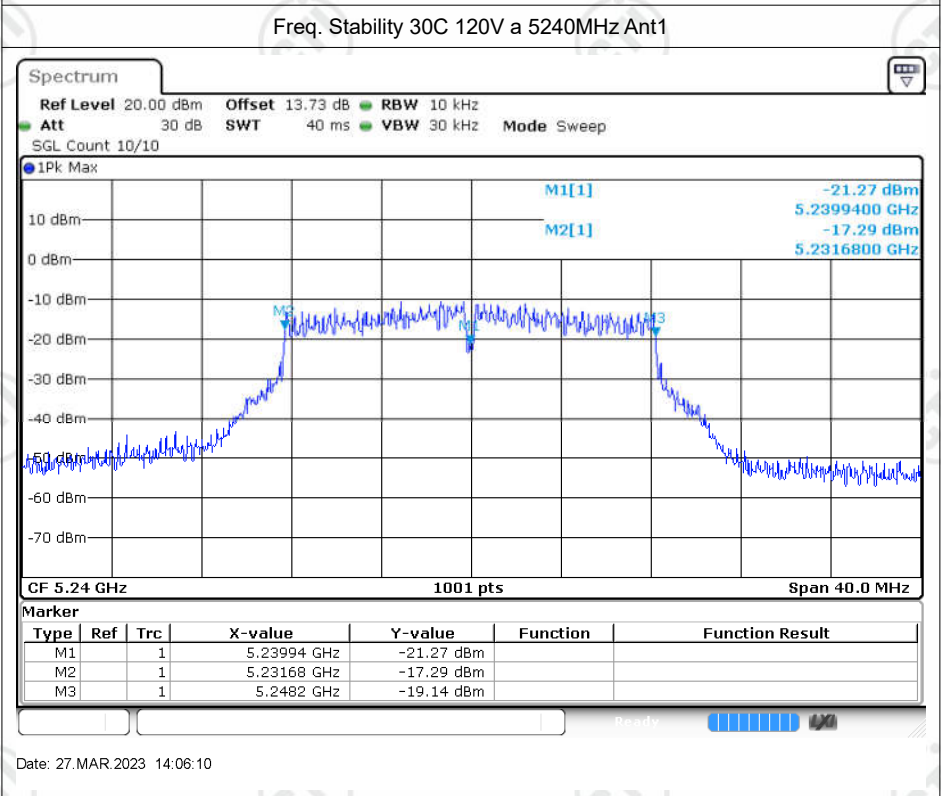


Date: 27. MAR 2023 14:06:10

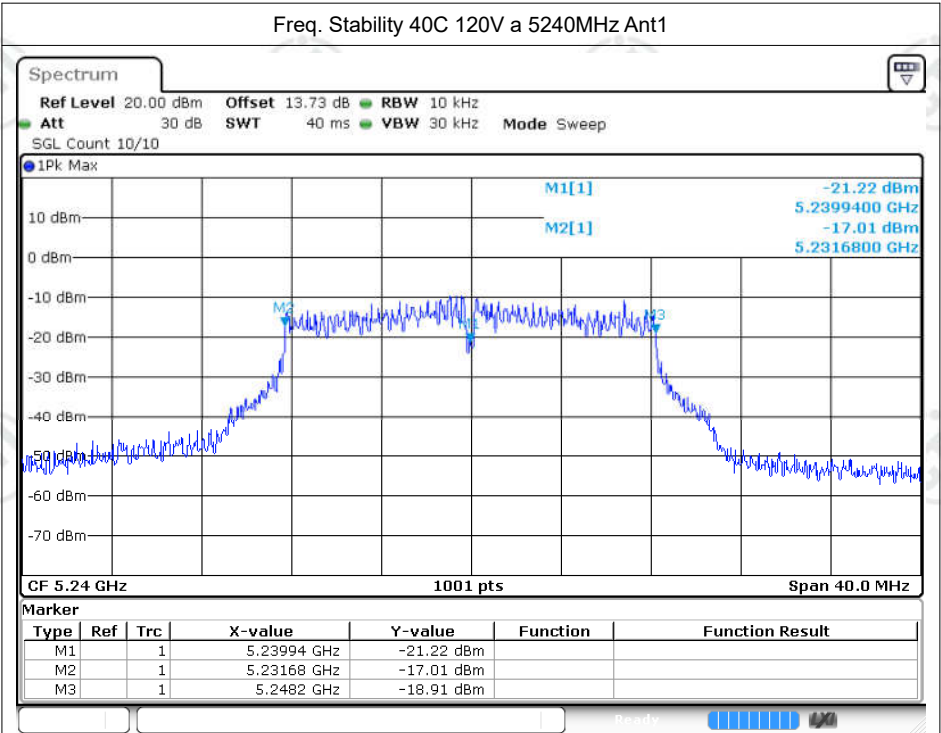


Date: 27. MAR. 2023 14:06:13

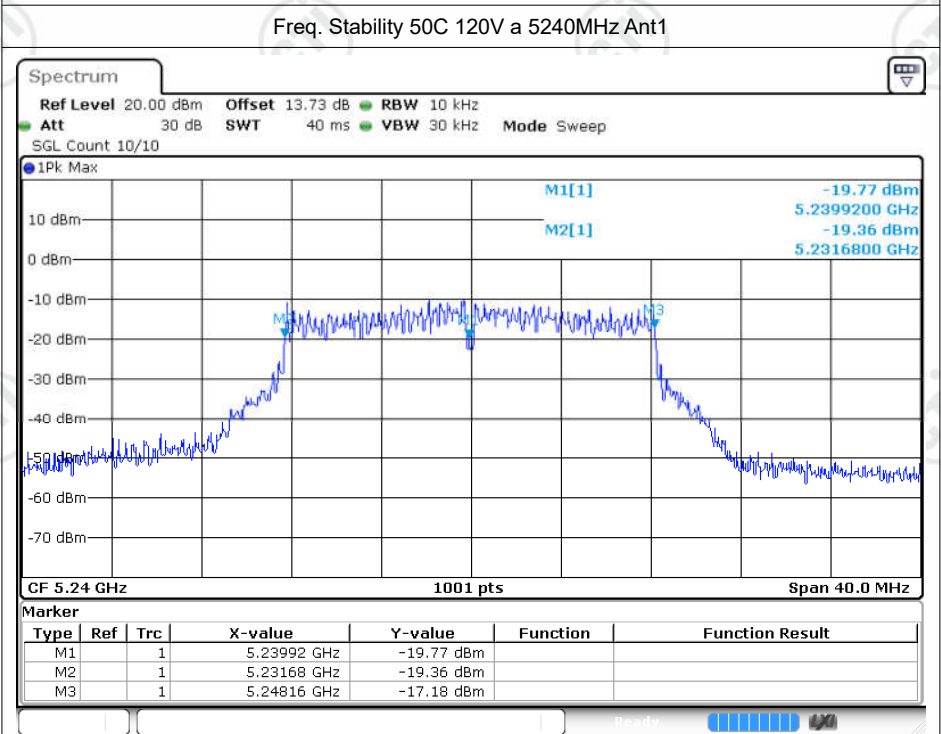


Date: 27. MAR. 2023 14:06:16

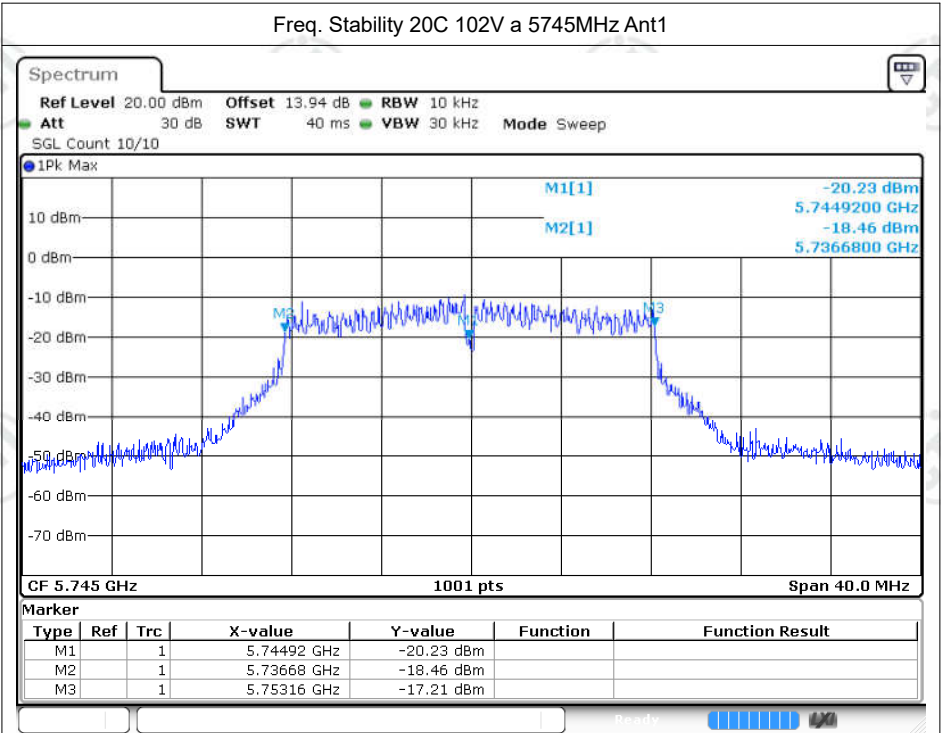


Date: 27.MAR.2023 14:11:23

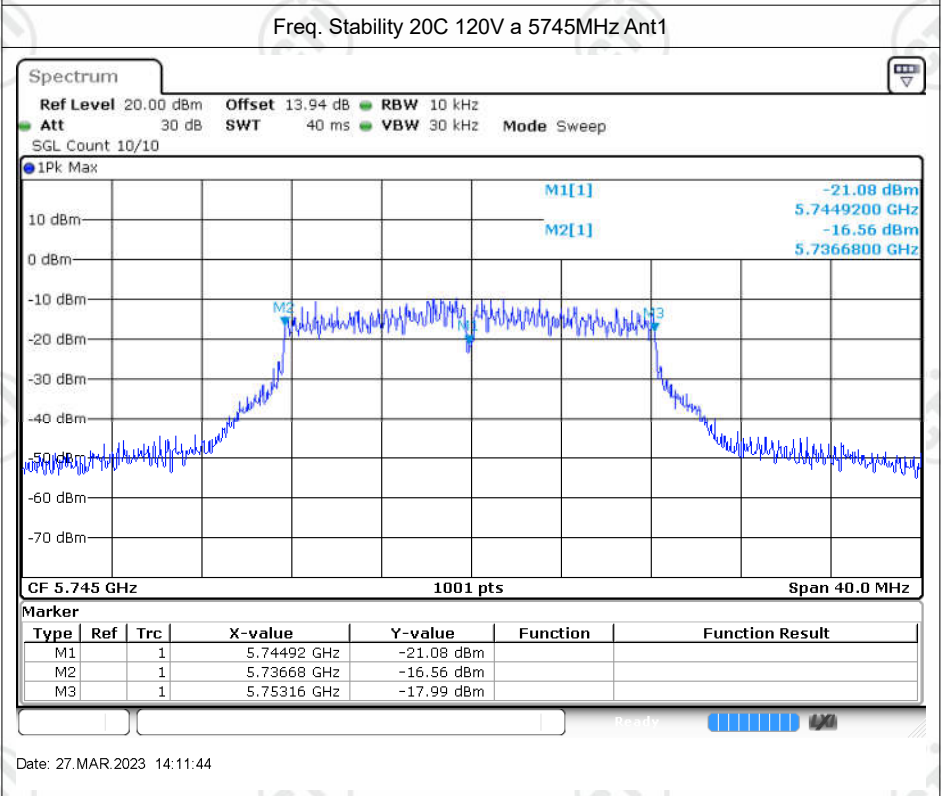


Date: 27.MAR.2023 14:11:44

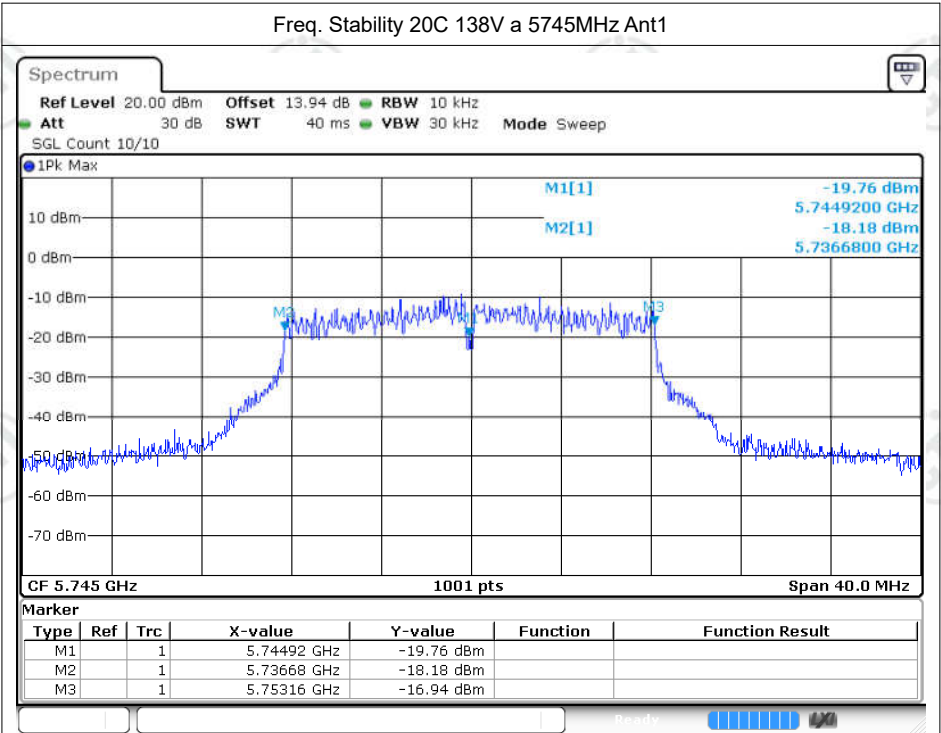


Date: 27. MAR 2023 14:11:29

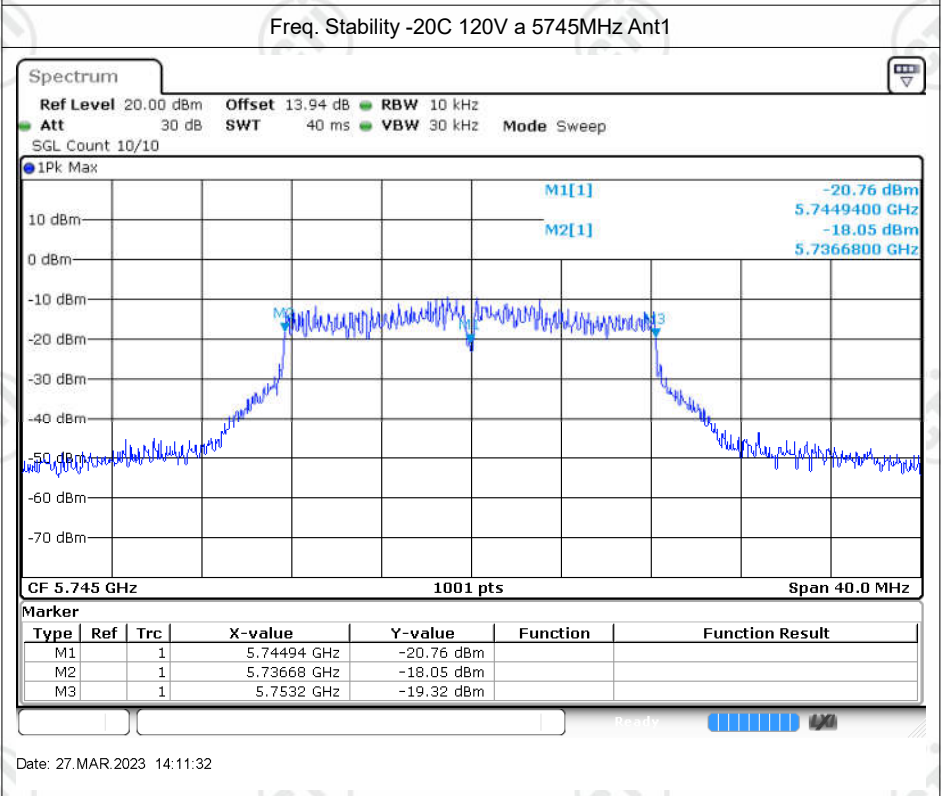

Date: 27. MAR 2023 14:11:32

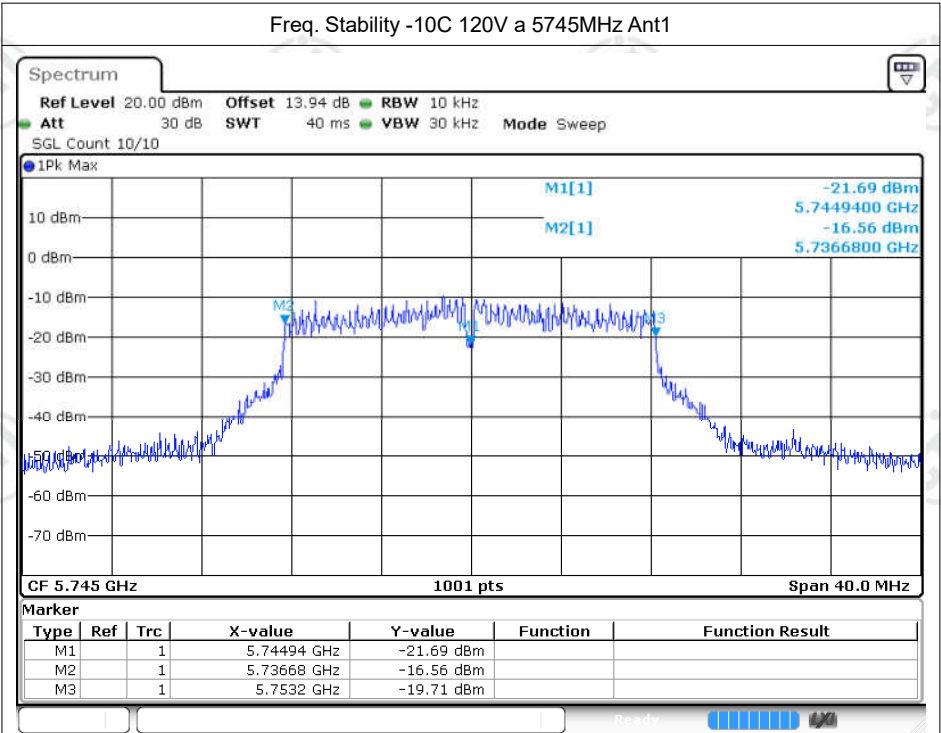

Date: 27.MAR.2023 14:11:35

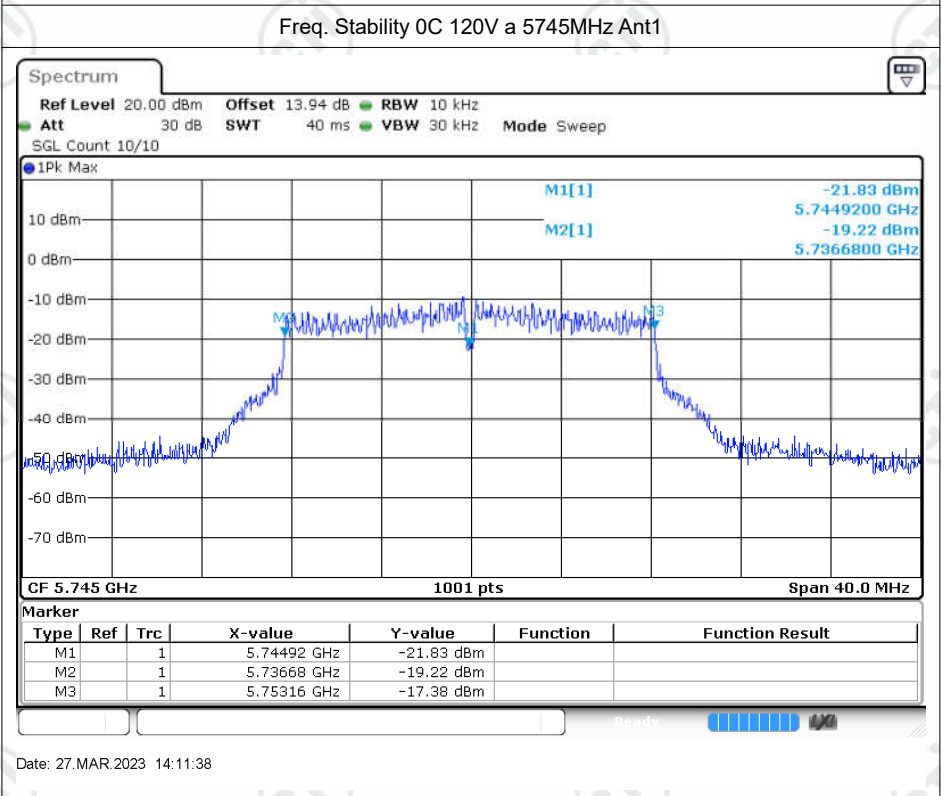

Date: 27.MAR.2023 14:11:38