

Report No.: HA851419-01B



HEARING AID COMPATIBILITY T-COIL TEST REPORT

FCC ID : AZ489FT7104

Equipment: LEX L11 Mission Critical LTE Device

Brand Name: Motorola Solutions

Model Name : LEX L11n

T-Rating : T3

Applicant : Motorola Solutions Inc.

8000 West Sunrise Boulevard, Fort Lauderdale,

Florida 33322

Manufacturer: Motorola Solutions Penang

Motorola Solutions Malaysia Sd. Bhd., Plot 2A, Medan Bayan Lepas, Mukim 12 SWD, 11900,

Bayan Lepas, Penang, Malaysia

Standard: FCC 47 CFR §20.19

ANSI C63.19-2011

The product was received and testing was started from Aug. 10, 2018, and completed on Aug. 22, 2018. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The report must not be used by the client to claim product certification, approval, or endorsement by TAF or any agency of government.

The test results in this variant report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERTIONAL INC. EMC & Wireless Communications Laboratory, the test report shall not be reproduced except in full.

Approved by: Jones Tsai / Manager

SPORTON INTERTIONAL INC. EMC & Wireless Communications Laboratory

No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.)

TEL: 886-3-327-3456 Page: 1 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

Table of Contents

Report No.: HA851419-01B

Page: 2 of 20

Issued Date: Sep. 14, 2018

General Information	4
Testing Location	
Applied Standards	5
Air Interface and Operating Mode	6
Measurement standards for T-Coil	7
5.1 Frequency Response	7
5.2 T-Coil Signal Quality Categories	7
T-Coil Test Procedure	8
6.1 Test Flow Chart	9
6.2 Test Setup Diagram	10
6.3 Description of EUT Test Position	12
Test Equipment List	13
T-Coil testing for CMRS IP Voice	14
8.1 VoLTE Tests Results	14
T-Coil testing for OTT VoIP Calling	17
Uncertainty Assessment	19
References	
	Testing Location Applied Standards Air Interface and Operating Mode Measurement standards for T-Coil 5.1 Frequency Response 5.2 T-Coil Signal Quality Categories T-Coil Test Procedure 6.1 Test Flow Chart 6.2 Test Setup Diagram 6.3 Description of EUT Test Position Test Equipment List T-Coil testing for CMRS IP Voice 8.1 VoLTE Tests Results T-Coil testing for OTT VoIP Calling Uncertainty Assessment

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate Appendix C. Test Setup Photo

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Form version: 180516

History of this test report

Report No. : HA851419-01B

Report No.	Version	Description	Issued Date
HA851419-01B	Rev. 01	Initial issue of report	Sep. 14, 2018

TEL: 886-3-327-3456 Page: 3 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

1. General Information

	Product Feature & Specification
Applicant Name	Motorola Solutions Inc.
Equipment Name	LEX L11 Mission Critical LTE Device
Brand Name	Motorola Solutions
Model Name	LEX L11n
FCC ID	AZ489FT7104
EUT Stage	Identical Prototype
Frequency Band	GSM850: 824.2 MHz ~ 848.8 MHz GSM1900: 1850.2 MHz ~ 1909.8 MHz WCDMA Band II: 1852.4 MHz ~ 1907.6 MHz WCDMA Band IV: 1712.4 MHz ~ 1752.6 MHz WCDMA Band IV: 1712.4 MHz ~ 846.6 MHz LTE Band 2: 1850.7 MHz ~ 1909.3 MHz LTE Band 2: 1850.7 MHz ~ 1754.3 MHz LTE Band 4: 1710.7 MHz ~ 1754.3 MHz LTE Band 5: 824.7 MHz ~ 848.3 MHz LTE Band 7: 2502.5 MHz ~ 2567.5 MHz LTE Band 12: 699.7 MHz ~ 715.3 MHz LTE Band 13: 779.5 MHz ~ 784.5 MHz LTE Band 14: 790.5 MHz ~ 779.5 MHz LTE Band 17: 706.5 MHz ~ 731.5 MHz LTE Band 25: 1850.7 MHz ~ 1914.3 MHz LTE Band 26: 814.7 MHz ~ 848.3 MHz LTE Band 30: 2307.5 MHz ~ 2312.5 MHz LTE Band 41: 2498.5 MHz ~ 2687.5 MHz LTE Band 66: 1710.7 MHz ~ 1779.3 MHz WLAN 2.4GHz Band: 2412 MHz ~ 2462 MHz WLAN 5.2GHz Band: 5180 MHz ~ 5240 MHz WLAN 5.3GHz Band: 5500 MHz ~ 5320 MHz WLAN 5.5GHz Band: 5500 MHz ~ 5825 MHz Bluetooth: 2402 MHz ~ 2480 MHz NFC: 13.56 MHz
Mode Remark:	GSM/GPRS/EGPRS RMC/AMR 12.2Kbps HSDPA HSUPA LTE: QPSK, 16QAM 802.11a/b/g/n/ac HT20/HT40/VHT40/VHT80 Bluetooth BR/EDR/LE NFC:ASK

Report No.: HA851419-01B

 This is a variant report to add LTE B13/B17/B25/B26/B41 VoLTE and VoIP evaluation for LEX L11n, others band refer to Sporton HAC report, FCC ID: AZ489FT7104, Report No.: HA851419B for VoIP evaluation, BV HAC report, FCC ID: AZ489FT7104, Report No.: SA180214C01-1 for CMRS voice evaluation.

Reviewed by: <u>Eric Huang</u> Report Producer: <u>Wan Liu</u>

Accessories Information							
AC Adapter Brand Name Motorola Solutions Model Name MU08-L050150-A1							
Battery 1	Brand Name	Motorola Solutions	Model Name	PMNN4546A			
Battery 2	Brand Name	Motorola Solutions	Model Name	PMNN4545A			
USB Cable	Brand Name	Motorola Solutions	Model Name	CB000756A01			

TEL: 886-3-327-3456 Page: 4 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

2. Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1190 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC test.

Report No.: HA851419-01B

Testing Laboratory				
Test Site	SPORTON INTERNATIONAL INC.			
Test Site Location	No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978			
Test Site No.	Sporton Site No.: SAR04-HY			

3. Applied Standards

- FCC CFR47 Part 20.19
- ANSI C63.19 2011-version
- FCC KDB 285076 D01 HAC Guidance v05
- FCC KDB 285076 D02 T Coil testing v03
- FCC KDB 285076 D03 HAC FAQ v01

TEL: 886-3-327-3456 Page: 5 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

4. Air Interface and Operating Mode

Air Interface	Band MHz	Туре	C63.19 Tested	Simultaneous Transmitter	Name of Voice Service	Power Reduction	
	Band 13			WLAN, BT	VoLTE	No	
LTE	Band 17	VD			WLAN, BT	/ Google	No
(FDD)	Band 25		Yes	WLAN, BT	hangouts ⁽¹⁾	No	
	Band 26				WLAN, BT	/ Google Duo ⁽¹⁾	No
LTE (TDD)	Band 41	VD	Yes	WLAN, BT	VoLTE / Google hangouts ⁽¹⁾ / Google Duo ⁽¹⁾	No	

Report No.: HA851419-01B

Type Transport: VO= Voice only

DT= Digital Transport only (no voice)
VD= CMRS and IP Voice Service over Digital Transport

Remark:

TEL: 886-3-327-3456 Page: 6 of 20 FAX: 886-3-328-4978 Issued Date : Sep. 14, 2018


For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of -20 dBm0 should be used.

5. Measurement standards for T-Coil

5.1 Frequency Response


The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA851419-01B

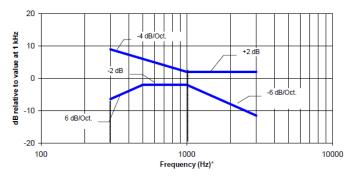

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

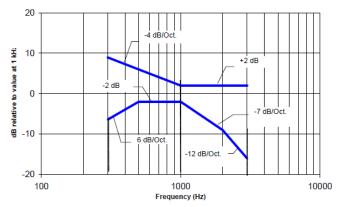

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds -15 dB(A/m) at 1 kHz

5.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

Category	Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB)
Category T1	0 to 10 dB
Category T2	10 to 20 dB
Category T3	20 to 30 dB
Category T4	> 30 dB

Table 1 T-Coil Signal Quality Categories

TEL: 886-3-327-3456 Page: 7 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

6. T-Coil Test Procedure

Referenced to ANSI C63.19-2011, Section 7.4,

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA851419-01B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,


Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.

The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- a. A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

TEL: 886-3-327-3456 Page: 8 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

6.1 Test Flow Chart

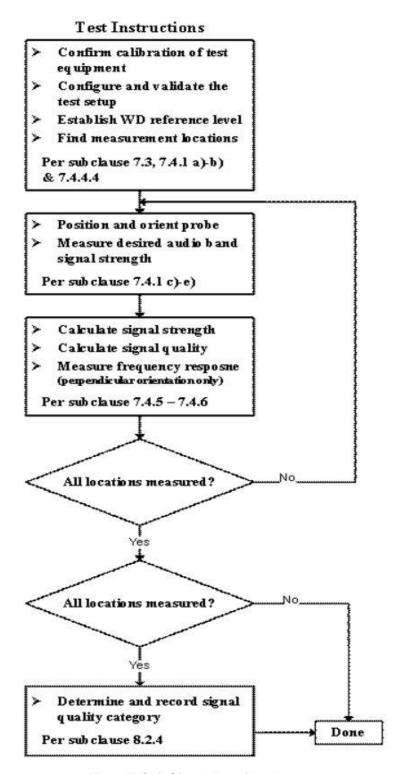


Report No.: HA851419-01B

Fig. 2 T-Coil Signal Test flowchart

TEL: 886-3-327-3456 Page: 9 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

6.2 Test Setup Diagram

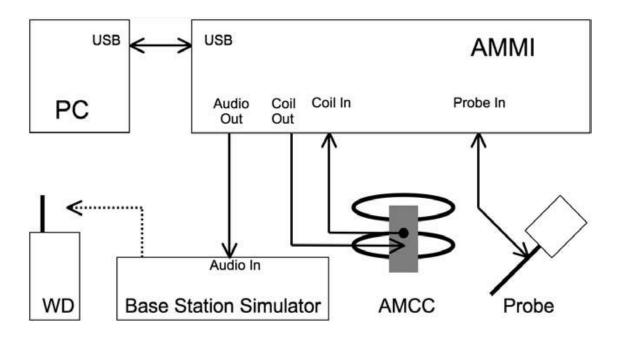

Report No.: HA851419-01B

General Note:

- 1. Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
 - OTT VoIP input Level: -20dBm0
- 2. The test setup used for Google DUO and Google Hangouts VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0.

TEL: 886-3-327-3456 Page: 10 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018



SPORTON LAB. HAC T-COIL TEST REPORT

 The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA851419-01B

2. The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k_csek_8k_441_white_10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	

(*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

Calculation formula:

- Audio Level at -16dBm0 = ((-16dBm0) (3.14dBm0)) + X dBv
- Calculated Gain at -16dBm0 = 10((audio level at -16dBm0 Y dBm0) / 20) * 10

Gatting setting at -16dBm0 = required gain factor * calculated gain

Gain Value	20* log(gain)	AMCC Coil In	Level
(linear)	dB	(dBv RMS)	dBm0
		-2.47	3.14
10	20	-19.85	-14.24
8.17	18.24	-21.61	-16

Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Required Gain Factor	Calculated Gain Setting
1kHz sine	-	3	0	1	8.17
48k_voice_1kHz	1	16.2	-12.7	4.33	35.36
48k_voice_300Hz ~ 3kHz	2	21.6	-18.6	8.48	69.25

TEL: 886-3-327-3456 Page: 11 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

6.3 Description of EUT Test Position

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

Report No.: HA851419-01B

- ♦ The area is 5 cm by 5 cm.
- ◆ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- The measurement plane is parallel to, and 10 mm in front of, the reference plane.

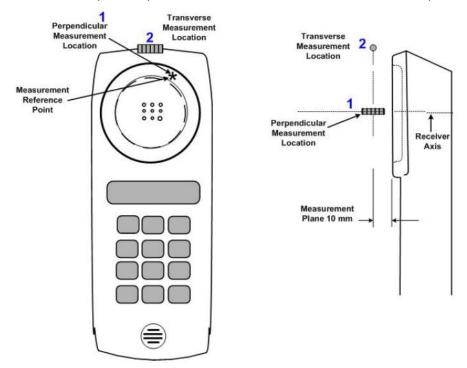


Fig.3 A typical EUT reference and plane for T-Coil measurements

TEL: 886-3-327-3456 Page: 12 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

7. Test Equipment List

Manufacturer	Name of Equipment	Type/Medal	Serial Number	Calibration	
Manuracturer	Name of Equipment	Type/Model	Serial Number	Last Cal.	Due Date
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3130	Nov. 21, 2017	Nov. 20, 2018
SPEAG	Data Acquisition Electronics	DAE3	577	Sep. 25, 2017	Sep. 24, 2018
SPEAG	Data Acquisition Electronics	DAE4	917	Dec. 14, 2017	Dec. 13, 2018
SPEAG	Audio Magnetic Calibration Coil	AMCC	1049	NCR	NCR
SPEAG	Audio Measuring Instrument	AMMI	1041	NCR	NCR
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR
SPEAG	Phone Positioner	N/A	N/A	NCR	NCR
TESTO	Hygro meter	608-H1	34913631	Aug. 22, 2017	Aug. 21, 2018
TESTO	Hygro meter	608-H1	34852481	Sep. 20, 2017	Sep. 19, 2018
R&S	Base Station	CMW500	115793	May. 24, 2018	May. 23, 2019

Report No.: HA851419-01B

Note:

TEL: 886-3-327-3456 Page: 13 of 20 FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

^{1.} NCR: "No-Calibration Required"

8. T-Coil testing for CMRS IP Voice

8.1 VoLTE Tests Results

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel / band, the following worst investigation codec would be remarked to be used for the testing for the handset.

2. Air Interface Investigation:

a. Use the worst-case codec test and document a limited set of bands / channel / bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.

Report No.: HA851419-01B

- b. Select LTE FDD / TDD one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/RB size to verify the variation to find out worst configuration, the observed variation is very little to be within 1.5 dB which is much less than the margin from the rating threshold.
- c. The TDD LTE power class 3 supports uplink-downlink configuration 0 to 6, an investigation was performed to determine the worst-case uplink-downlink configuration to be used for the testing for the handset.
- According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

<Codec Investigation>

LTE FDD

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	6.11	4.96	6.23	2.11	- Axial	B25 / 20M / 26340
ABM 2 (dBA/m)	-32.18	-31.71	-32.41	-33.66		
Signal Quality (dB)	38.29	36.67	38.64	35.77		D25 / ZUWI / Z0340
Freq. Response	PASS	PASS	PASS	PASS		

Codec	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	5.03	5.23	5.12	4.98	5.13	2.96		
ABM 2 (dBA/m)	-30.95	-30.84	-30.81	-31.13	-30.86	-32.89 Axial		B25 / 20M /
Signal Quality (dB)	35.98 36.07		35.93	36.11	35.99	35.85	Axiai	26340
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS		

Remark: According to codec investigation, the worst codec is WB AMR 23.85Kbps

TEL: 886-3-327-3456 Page: 14 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

LTE TDD

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	Orientation	Band / BW / Channel		
ABM 1 (dBA/m)	6.19	6.26	6.22	5.1				
ABM 2 (dBA/m)	-26.54	-26.77	-26.6	-27.2	Axial	D.44 / 0004 / 40000		
Signal Quality (dB)	32.73	33.03	32.82	32.3	Axiai	B41 / 20M / 40620		
Freq. Response	PASS	PASS	PASS	PASS				

Report No.: HA851419-01B

Codec	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	6.23	6.27	6.24	6.22	6.24	6.26		
ABM 2 (dBA/m)	-26.53	-26.74	-26.52	-26.58	-26.63	-26.63	Axial	B41 / 20M /
Signal Quality (dB)	32.76	33.01	32.76	32.8	32.87	32.89	Axiai	40620
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS		

Remark: According to codec investigation, the worst codec is WB AMR 23.85Kbps

<Air Interface Investigation>

Air Interface	BW (MHz)	Modulation / Mode	RB Size	RB offset	Channel	UL-DL Configuration	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
LTE B25	20	QPSK	1	0	23640	-	6.39	-28.96	35.35
LTE B25	20	QPSK	50	0	23640	-	6.36	-29.04	35.40
LTE B25	20	QPSK	100	0	23640	=	6.36	-29.31	35.67
LTE B25	20	16QAM	1	0	23640	-	6.34	-29.09	35.43
LTE B25	20	64QAM	1	0	23640	=	6.39	-29.37	35.76
LTE B25	15	QPSK	1	0	23640	=	6.38	-28.98	35.36
LTE B25	10	QPSK	1	0	23640	-	6.37	-29.01	35.38
LTE B25	5	QPSK	1	0	23640	=	6.35	-29.19	35.54
LTE B25	3	QPSK	1	0	23640	-	6.36	-29.05	35.41
LTE B25	1.4	QPSK	1	0	23640	=	6.36	-29.35	35.71
LTE B41	20	QPSK	1	0	40620	0	5.38	-26.78	32.16
LTE B41	20	QPSK	50	0	40620	0	5.44	-26.96	32.40
LTE B41	20	QPSK	100	0	40620	0	5.42	-26.96	32.38
LTE B41	20	16QAM	1	0	40620	0	5.42	-27.03	32.45
LTE B41	20	64QAM	1	0	40620	0	5.40	-26.94	32.34
LTE B41	15	QPSK	1	0	40620	0	5.39	-26.90	32.29
LTE B41	10	QPSK	1	0	40620	0	5.44	-26.94	32.38
LTE B41	5	QPSK	1	0	40620	0	5.41	-26.91	32.32
LTE B41	20	QPSK	1	0	40620	1	5.42	-26.84	32.26
LTE B41	20	QPSK	1	0	40620	2	5.43	-26.90	32.33
LTE B41	20	QPSK	1	0	40620	3	5.46	-26.86	32.32
LTE B41	20	QPSK	1	0	40620	4	5.41	-26.99	32.40
LTE B41	20	QPSK	1	0	40620	5	5.45	-26.89	32.34
LTE B41	20	QPSK	1	0	40620	6	5.42	-27.01	32.43

TEL: 886-3-327-3456 Page: 15 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018



SPORTON LAB. HAC T-COIL TEST REPORT

Plot No.	Air Interface	BW (MHz)	Modulation	RB Size	RB offset	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Response	Frequency Response
1	LTE Band 13	10M	QPSK	1	0	23230	Axial (Z)	5.08	-30.93	36.01	T4	-50.33	0.85	Page
	LIE Dallu 13	TOW	QFSN	'	U	23230	Transversal (Y)	-2.47	-38.07	35.60	T4	-50.22	0.85	Pass
2	LTE Band 17	10M	QPSK	1	0	23790	Axial (Z)	5.80	-29.92	35.72	T4	-50.35	0.74	Pass
	2 LIE Band 17 TOWN QPSK	<u>'</u>	U	237 90	Transversal (Y)	-2.62	-38.25	35.63	T4	-50.24	0.74	1 433		
3	LTE Band 25	20M	QPSK	1	0	26340	Axial (Z)	5.11	-30.66	35.77	T4	-50.26	0.72	Pass
3	LTL Danu 23	20101	QFSK	'			Transversal (Y)	-3.41	-38.73	35.32	T4	-50.23		
4	LTE Band 26	15M	QPSK	1	0	26865	Axial (Z)	4.91	-30.93	35.84	T4	-50.28	0.66	Door
4	LTL Danu 20	TOW	QFSK	'	U	20003	Transversal (Y)	-2.59	-38.10	35.51	T4	-50.26	0.00	Pass
5	5 LTE Band 41 2	2014	OBSK	1	0	40620	Axial (Z)	5.10	-27.20	32.30	T4	-50.30	0.76	Page
3		20M	QPSK				Transversal (Y)	-4.65	-39.40	34.75	T4	-50.21		Pass

Report No.: HA851419-01B

TEL: 886-3-327-3456 Page: 16 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

9. T-Coil testing for OTT VoIP Calling

General Notes:

The google Duo and google hangouts VoIP application are pre-installed on this device. According to KDB 285076
D02, all air interfaces via a data connection with VoIP application need to be considered HAC testing.

Report No.: HA851419-01B

- 2. The Google Duo and google hangouts only support OPUS audio codec and support 6Kbps to 75Kbps bitrate.
- 3. The test setup used for OTT VoIP call is the DUT connect to the CMW500 and via the data application unit on CMW500 connection to the Internet, the Auxiliary EUT is connected to the WiFi access point, the channel/Modulation/Frequency bands/data rate is configured on the CMW500 for the DUT unit. For the Auxiliary VoIP unit which is used to configure the audio codec rate and determine the audio input level of -20dBm0 based on the KDB 285076 D02v03 requirement.
- 4. <u>Codec Investigation:</u> For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following tests results which the worst case codec would be remarked to be used for the testing for the handset.
- 5. Air Interface Investigation:
 - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.
 - b. Due to OTT service and CMRS IP service are all be established over the internet protocol for the voice service, and on both services use the identical RF air interface for the LTE, therefore according to VoLTE test results of air interface investigation, the worst configuration and frequency band of air interface was used for OTT T-Coil testing.
 - -LTE FDD worst configuration and band: LTE Band 25/20MHz/QPSK/1RB Size
 - -LTE TDD worst configuration and band: LTE Band 41/20MHz/QPSK/1RB Size

<Codec Investigation>

LTE FDD

	VoIP Codec(Google Duo)		Vol	Codec(Hango	Orientation	Band /		
Codec	Codec Opus 6kbps		Opus 75kbps	Opus 6kbps Opus 40kbps		Opus 75kbps	Orientation	Channel	
ABM 1 (dBA/m)	10.81	9.58	10.11	-0.5	0.14	-0.59		B25 / 20M /	
ABM 2 (dBA/m)	-25.54	-25.43	-23.99	-31.73	-30.85	-31.54	Axial		
Signal Quality (dB)	36.35	35.01	34.1	31.23	30.99	30.95	Axiai	26340	
Freq. Response	PASS	PASS	PASS	Pass	Pass	Pass			

Remark: According to codec investigation, the worst codec bitrate is Opus 75kbps

TEL: 886-3-327-3456 Page: 17 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

LTE TDD

	VoIP Co	dec(Duo)		Vol	Codec(Hango	outs)		Band /	
Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	Opus 6kbps	pus 6kbps Opus 40kbps		Orientation	Channel	
ABM 1 (dBA/m)	10.12	9.93	9.22	7.86	7.71	7.65		B41 / 20M / 40620	
ABM 2 (dBA/m)	-27.24	-25.26	-25.79	-22.63	-22.78	-22.72	Axial		
Signal Quality (dB)	37.36	35.19	35.01	30.49	30.49	30.37	Axiai		
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS			

Report No.: HA851419-01B

Remark: According to codec investigation, the worst codec bitrate is Opus 75kbps

<Air Interface Investigation>

Plot No.	Air Interface	BW (MHz)	Modulation	RB Size	RB offset	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Response	Frequency Response
6	LTE Band 25	20M	QPSK	1	0	26340	Axial (Z)	-0.59	-31.54	30.95	T4	-50.30	0.03	Pass
0	LTE Dallu 20	ZUIVI	QFSK	'	0		Transversal (Y)	-2.78	-33.31	30.53	T4	-50.22		
7	LTE Bond 41	20M	QPSK	1	0	40620	Axial (Z)	7.65	-22.72	30.37	T4	-50.32	0.09	Door
'	7 LTE Band 41 20	ZUIVI	QF3K	1	U	40620	Transversal (Y)	1.69	-27.85	29.54	Т3	-50.25		Pass

Remark:

1. Phone Condition: Mute on; Backlight off; Max Volume

2. The detail frequency response results please refer to appendix A.

3. Hearing Aid mode was set on for HAC T-Coil compliance.

4. Test Engineer : Tom Jiang

TEL: 886-3-327-3456 Page: 18 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

10. Uncertainty Assessment

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2.

Report No.: HA851419-01B

Uncertainty Error Description Value (±%)		Probability Distribution	Divisor	Ci (ABM1)	Ci (ABM2)	Standard Uncertainty (ABM1)	Standard Uncertainty (ABM2)
		Probe Sen	sitivity				
Reference Level	Reference Level 3.0				1	± 3.0 %	± 3.0 %
AMCC Geometry	0.4	Rectangular	√3	1	1	± 0.2 %	± 0.2 %
AMCC Current	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %
Probe Positioning During Calibrate	0.1	Rectangular	√3	1	1	± 0.1 %	± 0.1 %
Noise Contribution	0.7	Rectangular	√3	0.0143	1	± 0.0 %	± 0.4 %
Frequency Slope	5.9	Rectangular	√3	0.1	1	± 0.3 %	± 3.5 %
		Probe Sy	stem				
Repeatability / Drift	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %
Linearity / Dynamic Range	0.6	Rectangular	√3	1	1	± 0.4 %	± 0.4 %
Acoustic Noise	1.0	Rectangular	√3	0.1	1	± 0.1 %	± 0.6 %
Probe Angle	2.3	Rectangular	√3	1	1	± 1.4 %	± 1.4 %
Spectral Processing	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %
Integration Time	0.6	Normal	1	1	5	± 0.6 %	± 3.0 %
Field Disturbation	0.2	Rectangular	√3	1	1	± 0.1 %	± 0.1 %
		Test Siç	gnal				
Reference Signal Spectral Response	0.6	Rectangular	√3	0	1	± 0.0 %	± 0.4 %
		Position	ning				
Probe Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %
Phantom Thickness	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %
EUT Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %
		External Con	tributions				
RF Interference	0.0	Rectangular	√3	1	0.3	± 0.0 %	± 0.0 %
Test Signal Variation	2.0	Rectangular	√3	1	1	± 1.2 %	± 1.2 %
	Combined Star	ndard Uncertainty				± 4.1 %	± 6.1 %
	Coverage F	actor for 95 %				K :	= 2
	Expanded	Uncertainty				± 8.1 %	± 12.3 %

Table 8.2 Uncertainty Budget of audio band magnetic measurement

TEL: 886-3-327-3456 Page: 19 of 20
FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018

11. References

[1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.

Report No.: HA851419-01B

- [2] FCC KDB 285076 D01v05, "Equipment Authorization Guidance for Hearing Aid Compatibility", Sep 2017
- [3] FCC KDB 285076 D02v03, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Sep 2017
- [4] FCC KDB 285076 D03v01, "Hearing aid compatibility frequently asked questions", Sep 2017
- [5] SPEAG DASY System Handbook

TEL: 886-3-327-3456 Page: 20 of 20 FAX: 886-3-328-4978 Issued Date: Sep. 14, 2018